


ASS. REC. BY: Steve

REP: ALG

**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
 OD /  TP /  WS /  TP RES /  OD RES /  EVA /  INV /  MV  
 To inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured: \_\_\_\_\_  
 Policy No. \_\_\_\_\_  
 Claims No. \_\_\_\_\_  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

(Policy Condition)  
 Remark: The veh had commenced its repair at the time of inspection.

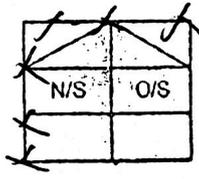

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No  
 Est. Repairs: \_\_\_\_\_ days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No  
 CA / REV / REP. / 24 HRS  
 Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: SMA 83120 Yr Regn: 4/12/19  
 Type:  M.Car /  M.Cycle /  Bus /  Van /  Lorry /  Taxi /  Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: KIA NIRO c.c. 1580  
 Colour: Blue A/C:  Insured /  Std /  NI /  N  
 Sp. Reading: 15013 T/Radio:  Insured /  Std /  NI /  N  
 Eng/No: \_\_\_\_\_  
 C/No: KNACC 81CVL 5338365  
 Gen. Cond:  Good /  Fair /  Poor /  Burnt  
 Steering:  In order /  Jammed /  Leaked /  Burnt or  
 Brake:  In order /  Jammed /  Leaked /  Burnt or  
 Mod:  Nil /  S/Rim /  STD A/Rim or  
 Tyre Size: F: 205/60R16  
 R: 11  
 BS / DUN / EXNOVA / GY / FS / LIZA /  MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or \_\_\_\_\_

Front	Rear
R/Bal. <u>5</u> mm	R/Bal. <u>5</u> mm
L/Bal. <u>5</u> mm	L/Bal. <u>5</u> mm
D.O.A. <u>13/1/21</u>	D.O.I. <u>15/1/21</u>

Survey held at cycle & carriage  
 Des. of Damages:  Frt /  Rear /  O/S /  N/S /  UIC /  Rooftop or  
undercarriage  
 The UIC / Chassis frame / Body Structure affected due to collision

Date / Time	Action / Instruction
	<u>M/V - 105K</u> <u>New Car Price - 141K</u>

Date/Time, File Pass to?  : Prell. Report  
 : Final Report  
 Date/Time, File Return to? \_\_\_\_\_  
 Prop. Formed? \_\_\_\_\_  
 Lump Sum / B.I. Fee \_\_\_\_\_

Days Of Repair: \_\_\_\_\_  
 Resurvey No. of Trip: \_\_\_\_\_

Add Fee:  : Site Insp (\$ \_\_\_\_\_)  
 : Interview (\$ \_\_\_\_\_)  
 : Tech. Invs (\$ \_\_\_\_\_)  
 : Weekend (\$ \_\_\_\_\_)

Survey Fee: \_\_\_\_\_  
 Transportation: \_\_\_\_\_  
 S + RS. \$ \_\_\_\_\_  
 Photos \_\_\_\_\_  
 Others \_\_\_\_\_  
 TOTAL \_\_\_\_\_



**CYCLE & CARRIAGE KIA PTE LTD**  
**PANDAN GARDENS CUSTOMER SERVICE CENTRE**  
 209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



**ESTIMATE**

GST Reg No : MR-8500111-X

Co Reg No : 199405410K

Invoice Name & Address	Owner Name & Vehicle Info	
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name	/RAKESH KUMAR BHARDWAJ
	Reg No/Reg Date	SMQ8312D*ECB1/ 04/12/201
	Date In/Mileage	14/01/2021/ 0
	Chassis No	KNACC81CVL5338365
	Engine No	G4LEKS562188
	Make/Model	KIA/NIRO 1.6 A SX SR ASY PE
	Colour/Trim	C3U DEEP CERULEAN B/ WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
LAX00000	Credit	15/01/2021/ 14:09	BLK	282 / Kevin Leong	27417			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
E PNT88000	REPLACE FRT BUMPER, BONNET, FRT BOTH <sup>2</sup> FENDER, SUPPORT <sup>1</sup> PANEL, FRT LH <sup>1</sup> DOOR, FRT LH BODY CHASSIS, FRT LH BODY FRAME & AFFECTED AREA REPAIR ON FRT RH DOOR & ROOF, TOP				490 X 7	2800		4800.00
E PNT98000	PAINT WORK ON FRT BUMPER, BONNET, BOTH <sup>2</sup> FRT FENDER, BOTH FRT <sup>2</sup> DOOR, (LH) BOTH SIDE <sup>1</sup> ROCKER PANEL, ROOF <sup>1</sup> TOP, FRT LH CHASSIS, FRT LH WHEEL HOUSIN & BOTH FRT A-PILLAR <sup>2</sup>				350 X 10	3500		4550.00
E PNT88000	REPLACE REAR <sup>1</sup> BUMPER, REAR LH <sup>2</sup> FENDER, REAR LH <sup>1</sup> DOOR & AFFECTED AREA				490 X 4	1600		2000.00
E PNT98000	PAINT WORK ON REAR <sup>1</sup> BUMPER, REAR LH FENDER & REAR LH DOOR							1050.00
E PNT88000	REMOVE & INSTALL FRT RADIATOR, CONDENSER FOR FACILITATE REPAIR							120.00
M SUNDRY	TO TOP UP AIRCON GAS					(photo)	?	400.00
A 11900199	REMOVE & INSTALL ENGINE FOR FACILITATE REPAIR					(photo)	?	400.00
E PNT88000	REMOVE & INSTALL REAR HYBRID BATTERY FOR FACILITATE REPAIR							120.00
E PNT88000	TO TANSFER FRT LH DOOR ATTACHMENTS TO NEW PANEL							120.00
E PNT88000	TO TANSFER REAR LH DOOR ATTACHMENTS TO NEW PANEL					(photo)	?	4000.00
A 52900099	REMOVE & INSTALL DASH BOARD FOR FACILITATE REPAIR					(photo)	?	200.00
A 52900099	TO REMOVE & INSTALL FRT UNDER CARPET FOR FACILITATE REPAIR					(photo)	?	400.00
A 13900099	REMOVE & INSTALL FUEL TANK FOR FACILITATE REPAIR					(photo)		240.00
E PNT88000	REMOVE & INSTALL SUN ROOF FOR FACILITATE REPAIR							180.00

**Estimate**

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



**CYCLE & CARRIAGE KIA PTE LTD**  
**PANDAN GARDENS CUSTOMER SERVICE CENTRE**  
 209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



**ESTIMATE**

Reg No : 199405410K

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info	
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name	/RAKESH KUMAR BHARDWAJ
	Reg No/Reg Date	SMQ8312D*ECB1/ 04/12/201
	Date In/Mileage	14/01/2021/ 0
	Chassis No	KNACC81CVL5338365
	Engine No	G4LEKS562188
	Make/Model	KIA/NIRO 1.6 A SX SR ASY PE
	Colour/Trim	C3U DEEP CERULEAN B/ WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
LAX00000	Credit	15/01/2021/ 14:09	BLK	282 / Kevin Leong	27417

Description of Goods / Services	Qty	Unit Price	Disc%	Amount
TO REMOVE & INSTALL REAR LH QUARTER GLASS FOR FACILITATE REPAIR				50.00
M SUNDRY				
TO APPLY REAR QUARTER GLASS SEALANT				120.00
E PNT88000			(photo)	120.00
REMOVE & INSTALL REAR BOOT COMPARTMENT FOR FACILITATE REPAIR				120.00
E PNT88000			(photo)	400.00
REMOVE & INSTALL REAR SEAT FOR FACILITATE REPAIR				400.00
A 33900099			(photo)	400.00
REPLACE FRT UNDERCARRIAGE				120.00
A 34900099			(photo)	120.00
REPLACE REAR UNDERCARRIAGE				150.00
A WHEELALIGNMENTBP				
To Conduct Computerize Full Wheel Alignment				90
M SUNDRY				
TO TANSFER RIM INCLUDING BALANCING				400.00
A 52900099				400.00
REPLACE ROOF LINING				200.00
A 16000010				200.00
REPLACE LH CURTAIN AIRBAG				200.00
A 52900099				200.00
REPLACE FRT LH SEAT AIRBAG				30.00
A 52900099				120.00
REPLACE AIR BAG CONTROL UNIT				
A 54900099				
CHECK WIRING & CHASSIS ELECTRICAL SYSTEM				900.00
A 10028901				
TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST				600
USING HI-SCAN PRO TEST				
M SUNDRY				
REPLACE ALL TYRES (Front LH & Rear LH)				30
M SUNDRY				
SUNDRIES				
M LAMP ASSY-HEAD,LH / BR	1.00	2102.00	20.00	1681.60

**Estimate**

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD  
PANDAN GARDENS CUSTOMER SERVICE CENTRE  
209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



ESTIMATE

GST Reg No : MR-8500111-X

Reg No : 199405410K

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /RAKESH KUMAR BHARDWAJ Reg No/Reg Date SMQ8312D*ECB1/ 04/12/201 Date In/Mileage 14/01/2021/ 0 Chassis No KNACC81CVL5338365 Engine No G4LEKS562188 Make/Model KIA/NIRO 1.6 A SX SR ASY PE Colour/Trim C3U DEEP CERULEAN B/ WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
LAX00000	Credit	15/01/2021/ 14:09	BLK	282 / Kevin Leong	27417

Description of Goods / Services	Qty	Unit Price	Disc%	Amount
M LAMP ASSY-HEAD,RH ?	1.00	2102.00	20.00	1681.60
M LAMP ASSY-REAR COMB INSIDE,LH X ?	1.00	636.00	20.00	508.80
M LAMP ASSY-REAR COMB OUTSIDE,LH ?	1.00	775.00	20.00	620.00
M HORN ASSY-LOW PITCH X	1.00	79.00	20.00	63.20
M HORN ASSY-HIGH PITCH / MIS	1.00	79.00	20.00	63.20
M PAD-HOOD INSULATING X	1.00	213.00	20.00	170.40
M MOULDING ASSY-FRONT FRAME,LH ?	1.00	48.00	20.00	38.40
M W/STRIP ASSY-FR DR BELT O/S LH ?	1.00	54.00	20.00	43.20
M W/STRIP ASSY-FR DR SIDE LH ?	1.00	111.00	20.00	88.80
M W/STRIP-FR DR BODY SIDE LH ?	1.00	109.00	20.00	87.20
M HANDLE ASSY-DOOR OUTSIDE X	1.00	66.00	20.00	52.80
M COVER-FR DR O/S HDL X	1.00	24.00	20.00	19.20
M MOULDING ASSY-RR DR FRAME,LH	1.00	33.00	20.00	26.40
M W/STRIP ASSY-RR DR BELT O/S LH ?	1.00	50.00	20.00	40.00
M W/STRIP ASSY-RR DR SIDE LH ?	1.00	122.00	20.00	97.60
M HANDLE ASSY-DOOR OUTSIDE X	1.00	42.00	20.00	33.60
M COVER-FR DR O/S HDL,PASSENGER X	1.00	24.00	20.00	19.20
M DOOR ASSY-FUEL FILLER X	1.00	48.00	20.00	38.40
M TRIM ASSY-LUGGAGE SIDE LH ?	1.00	330.00	20.00	264.00
M HEADLINING ASSY / CRU	1.00	1563.00	20.00	1250.40
M TRIM ASSY-CTR PILLAR UPR LH ?	1.00	70.00	20.00	56.00
M UNDER COVER ASSY,LH ?	1.00	191.00	20.00	152.80
P COVER-FR BUMPER UPR / MIS	1.00	637.00	20.00	509.60
M STRIP ASSY-FR BUMPER UPR / MIS	1.00	28.00	20.00	22.40
M COVER-FR BUMPER,LWR / MIS	1.00	373.00	20.00	298.40
M LIP ASSY-FRONT BUMPER / MIS	1.00	38.00	20.00	30.40
M SKID PLATE-FR BUMPER / MIS	1.00	60.00	20.00	48.00
M PIECE-FRT BUMPER GUARD LWR,LH / MIS	1.00	16.00	20.00	12.80
M PIECE-FRT BUMPER GUARD LWR,RH / MIS	1.00	16.00	20.00	12.80
M COVER ASSY-RADIATOR GRILLE UPR / MIS	1.00	40.00	20.00	32.00
M GRILLE ASSY-RADIATOR / MIS	1.00	441.00	20.00	352.80
M ABSORBER-FRONT BUMPER ENERGY / MIS	1.00	68.00	20.00	54.40
M GRILLE-FRONT BUMPER / MIS	1.00	131.00	20.00	104.80

Estimate

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



**CYCLE & CARRIAGE KIA PTE LTD**  
**PANDAN GARDENS CUSTOMER SERVICE CENTRE**  
 209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



**ESTIMATE**

GST Reg No : MR-8500111-X

Reg No : 199405410K

Invoice Name & Address	Owner Name & Vehicle Info	
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name	/RAKESH KUMAR BHARDWAJ
	Reg No/Reg Date	SMQ8312D*ECB1/ 04/12/201
	Date In/Mileage	14/01/2021/ 0
	Chassis No	KNACC81CVL5338365
	Engine No	G4LEKS562188
	Make/Model	KIA/NIRO 1.6 A SX SR ASY PE
	Colour/Trim	C3U DEEP CERULEAN B/ WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			Amount
LAX00000	Credit	15/01/2021/ 14:09	BLK	282 / Kevin Leong	27417			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M	COVER-DAYTIME RUNNING LIGHT,LH	/ MIS			1.00	46.00	20.00	36.80
M	COVER-DAYTIME RUNNING LIGHT,RH	/ CUT			1.00	46.00	20.00	36.80
M	LAMP ASSY-DAY RUNNING LIGHT,LH	/ BR			1.00	619.00	20.00	495.20
M	LAMP ASSY-DAY RUNNING LIGHT,RH	/ BR			1.00	619.00	20.00	495.20
M	LAMP ASSY-FRONT FOG,LH	/ MIS			1.00	223.00	20.00	178.40
M	LAMP ASSY-FRONT FOG,RH	/ MIS			1.00	223.00	20.00	178.40
M	FLAP ASSY-ACTIVE AIR,LWR	/ BR			1.00	481.00	20.00	384.80
M	DUCT ASSY-ACTIVE AIR	/ BR			1.00	64.00	20.00	51.20
M	WIRING HARNESS-FR BUMPER	/ BR			1.00	189.00	20.00	151.20
M	STIFFNER-FR BPR LWR	/ MIS			1.00	116.00	20.00	92.80
M	BRACKET-FR BUMPER SIDE,LH	/ BR			1.00	12.00	20.00	9.60
M	BRACKET-FR BUMPER SIDE,RH	/ BR			1.00	12.00	20.00	9.60
M	GUARD ASSY-FRONT WHEEL,LH	/ MIS			1.00	126.00	20.00	100.80
M	GUARD ASSY-FRONT MUD,LH	/ CUT			1.00	17.00	20.00	13.60
M	GUARD ASSY-REAR WHEEL,LH	/ CUT			1.00	158.00	20.00	126.40
M	SAB MODULE ASSY-FR,LH (Air bag)	/ BR			1.00	357.00	20.00	285.60
M	CUSHION ASSY-FR SEAT,LH	/ TN			1.00	1136.00	20.00	908.80
M	S/BELT ASSY-FR RH	/ Jammed			1.00	347.00	20.00	277.60
P	BUCKLE ASSY-FR S/BELT,LH	/ ?			2.00	82.00	20.00	131.20
M	S/BELT ASSY-FR LH	/ Jammed			1.00	347.00	20.00	277.60
M	ADJUSTER ASSY-HEIGHT	/ ?			2.00	43.00	20.00	68.80
M	TAPE-FR DR BLACK FRAME RR LH	/ NPC			1.00	14.00	20.00	11.20
M	TAPE-RR DR BLACK FRAME FR,LH	/ NPC			1.00	11.00	20.00	8.80
M	FILM-ANTI CHIPPG LH	/ NPC			1.00	15.00	20.00	12.00
M	TAPE-RR DR BLACK RR,LH	/ NPC			1.00	9.00	20.00	7.20
P	COVER-RR BUMPER,UPR	/ BR			1.00	486.00	20.00	388.80
M	COVER-RR BUMPER LWR	/ CUT			1.00	392.00	20.00	313.60
M	SKID PLATE-RR BUMPER	/ ?			1.00	98.00	20.00	78.40
M	COVER-RR BUMPER SIDE UNDER,LH	/ MIS			1.00	12.00	20.00	9.60
M	MOULDING ASSY-RR BUMPER SIDE,L	/ MIS			1.00	15.00	20.00	12.00
M	MOULDING ASSY-RR BUMPER SIDE,R	/ X			1.00	15.00	20.00	12.00
M	COVER- RR REFLECTOR, LH	/ CUT			1.00	51.00	20.00	40.80
M	LAMP ASSY-REAR FOG & R/REFL,LH	/ ?			1.00	364.00	20.00	291.20

**Estimate**

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD  
PANDAN GARDENS CUSTOMER SERVICE CENTRE  
209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



ESTIMATE

GST Reg No : MR-8500111-X

Reg No : 199405410K

Invoice Name & Address		Owner Name & Vehicle Info	
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000		Cust No/Name	/RAKESH KUMAR BHARDWAJ
		Reg No/Reg Date	SMQ8312D*ECB1/ 04/12/201
		Date In/Mileage	14/01/2021/ 0
		Chassis No	KNACCB1CVL5338365
		Engine No	G4LEKS562188
		Make/Model	KIA/NIRO 1.6 A SX SR ASY PE
		Colour/Trim	C3U DEEP CERULEAN B/ WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
LAX00000	Credit	15/01/2021/ 14:09	BLK	282 / Kevin Leong	27417

Description of Goods / Services	Qty	Unit Price	Disc%	Amount
M BRACKET-RR BEAM UPR MTG, LH X	1.00	5.00	20.00	4.00
M BRACKET-RR BEAM LWR MTG, LH X	1.00	5.00	20.00	4.00
M BRACKET-RR RAIL LWR MTG X	1.00	5.00	20.00	4.00
M BRACKET-RR BEAM UPR MTG, RH X	2.00	5.00	20.00	8.00
M BRACKET-RR BEAM LWR MTG, LH X	1.00	261.00	20.00	208.80
M BEAM-RR BUMPER X	1.00	39.00	20.00	31.20
M ANTENNA ASSY-SMARTKEY X	1.00	67.00	20.00	53.60
M STAY-RR BUMPER LH X	1.00	67.00	20.00	53.60
M STAY-RR BUMPER RH X	1.00	25.00	20.00	20.00
M BRACKET ASSY-RR BUMPER SIDE, LH BR	1.00	25.00	20.00	20.00
M BRACKET ASSY-RR BUMPER SIDE, RH BR	1.00	368.00	20.00	294.40
M GLASS & MOULDING ASSY-QUARTER X	1.00	1222.00	20.00	977.60
M PANEL ASSY-HOOD DD	1.00	385.00	20.00	308.00
M PANEL-FENDER, LH DD	1.00	385.00	20.00	308.00
M PANEL-FENDER, RH DD	1.00	46.00	20.00	36.80
M INSULATOR-FENDER LH CRU	1.00	46.00	20.00	36.80
M INSULATOR-FENDER RH X	1.00	661.00	20.00	528.80
M BEAM COMPLETE-FR BUMPER DD	1.00	675.00	20.00	540.00
M CARRIER ASSY-FRONT END MODULE BR	1.00	30.00	20.00	24.00
M BRACKET ASSY-FENDER MTG FR, LH MIS	1.00	810.00	20.00	648.00
M CROSSMEMBER COMPL BT	1.00	22.00	20.00	17.60
M STAY LH X	1.00	22.00	20.00	17.60
M STAY RH X	1.00	286.00	20.00	228.80
M ARM COMPLETE-FR LWR, LH BT	1.00	286.00	20.00	228.80
M ARM COMPLETE-FR LWR, RH BT	1.00	1466.00	20.00	1172.80
M PANEL ASSY-FRONT DOOR, LH DD	1.00	1542.00	20.00	1233.60
M PANEL ASSY-REAR DOOR, LH DD	1.00	33.00	20.00	26.40
M HINGE ASSY-REAR DOOR UPPER, LH ?	1.00	26.00	20.00	20.80
M HINGE ASSY-DOOR UPPER, LH	1.00	1207.00	20.00	965.60
M PANEL ASSY-QUARTER OUTER, LH DD	1.00	649.00	20.00	519.20
M PANEL-SIDE SILL OUTER, LH ?	1.00	832.00	20.00	665.60
M GEAR ASSY-STEERING BT	1.00	584.00	20.00	467.20
M BRAKE ASSY-FR, LH TN	1.00			

Estimate

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE KIA PTE LTD
PANDAN GARDENS CUSTOMER SERVICE CENTRE
209 Pandan Gardens Singapore 609339 Tel: 65684555 Fax: 65651240



ESTIMATE

GST Reg No : MR-8500111-X

Reg No : 199405410K

Table with 2 main columns: Invoice Name & Address (AIG Asia Pacific Insurance Pte. Ltd.) and Owner Name & Vehicle Info (RAKESH KUMAR BHARDWAJ).

Table with 6 columns: Account No, Terms, Date/Time Printed, CSE, Operator, WIP No.

Main table with 5 columns: Description of Goods / Services, Qty, Unit Price, Disc%, Amount. Includes items like KNUCKLE-FRONT AXLE, LH and various suspension parts.

Estimate

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST.



**ESTIMATE**

Reg No : 199405410K

GST Reg No : MR-8500111-X

Invoice Name & Address	Owner Name & Vehicle Info
AIG Asia Pacific Insurance Pte. Ltd. MOTOR CLAIM DEPARTMENT 78 SHENTON WAY #09-16 AIG BUILDING SINGAPORE 079120 Contact No 64191000	Cust No/Name /RAKESH KUMAR BHARDWAJ Reg No/Reg Date SMQ8312D*ECB1/ 04/12/201 Date In/Mileage 14/01/2021/ 0 Chassis No KNACC81CVL5338365 Engine No G4LEKS562188 Make/Model KIA/NIRO 1.6 A SX SR ASY PE Colour/Trim C3U DEEP CERULEAN B/ WK SATURN BLACK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
LAX00000	Credit	15/01/2021/ 14:09	BLK	282 / Kevin Leong	27417

Description of Goods / Services	Qty	Unit Price	Disc%	Amount
M WHEEL ASSY-ALUMINIUM (Front RH & LH, Rear LH) - GR	3.00	629.00	20.00	1509.60
M SHAFT ASSY-DRIVE, LH - GR	1.00	751.00	20.00	600.80
M BOOT KIT-FR AXLE WHEEL SIDE	1.00	90.00	20.00	72.00
M BOOT KIT-FR AXLE DIFF SIDE, LH	1.00	78.00	20.00	62.40
M SHAFT ASSY-DRIVE, RH	1.00	1133.00	20.00	906.40
M TRANSMISSION ASSY-DCT - CUT	1.00	14258.00	20.00	11406.40
M ACTUATOR ASSY-CLUTCH(1) - GR	1.00	2356.00	20.00	1884.80
M CONDENSER ASSY-COOLER - OT	1.00	639.00	20.00	511.20
M RADIATOR ASSY-COOLER	1.00	768.00	20.00	614.40
M RADIATOR ASSY-INVERTER	1.00	492.00	20.00	393.60
M RADIATOR ASSY	1.00	29.00	20.00	23.20
M GUARD-AIR, LH	1.00	546.00	20.00	436.80
M BLOWER ASSY	1.00	296.00	20.00	236.80
M PANEL ASSY-UNDER COVER	1.00	1492.00	20.00	1193.60
M T/M CONTROL UNIT	1.00	1501.00	20.00	1200.80
M ELECTRONIC CONTROL UNIT	1.00	123.00	20.00	98.40
M GARNISH ASSY-FNDR SIDE, LH - MIS	1.00	123.00	20.00	98.40
M GARNISH ASSY-FNDR SIDE, RH	1.00	171.00	20.00	136.80
M MOULDING ASSY-FRT DR W/LINE, LH - MIS	1.00	113.00	20.00	90.40
M MOULDING ASSY-RR DR W/LINE, LH	1.00	144.00	20.00	115.20
M GARNISH ASSY-QTR SIDE, LH - MIS	1.00	201.00	20.00	160.80
M MOULDING ASSY-SIDE SILL, LH - CUT	1.00	201.00	20.00	160.80
M MOULDING ASSY-SIDE SILL, RH	1.00	201.00	20.00	160.80
M SENSOR ASSY-PRESS SIDE IMPACT - NEC	1.00	110.00	20.00	88.00
M SENSOR ASSY-SIDE IMPACT - NEC	1.00	83.00	20.00	66.40
M MODULE ASSY-AIR BAG CONTROL - NEC	1.00	860.00	20.00	688.00
M NIRO HYBRID EMBLEM - MIS	2.00	30.00	20.00	48.00

**Estimate**

Steve CLKK)  
 OO- Nm AnL  
 Excess -?  
 15/1/20, 4.90pm  
 P/P  
 By B/L sm  
 23 days

LKK Auto Consultants hence notify the Repairer of the following:  
 • To resurvey before/after spray painting

**Confirm & accepted by**  
 • Parts prices are subject to confirmation  
 • Third party survey is on a "Without Prejudice" basis  
 • No illegal modification(s) is allowed  
 • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Authorized signatory and company stamp

7% GST on	73996.80	73,996.80
Total Payable		5179.78
		79,176.58

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.