



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St.3 #02-24 S(529890)

Mobile: 9295 2204 Fax: 8722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

VEHICLE INSPECTION REPORT

Report No. : PAS/TP/0491219

Date of Report : 30/01/2020

To : Mr Pay Ah Yan

C/o. 53 Ubi Avenue 1 #01-33

Paya Ubi Industrial Park

Singapore 408934

Date of Assignment : 31/12/2019

Report requested by : Mr Pay Ah Yan

Date of Accident : 25/12/2019

Date of Inspection : 31/12/2019

Claim No. : Third Party Claim

Policy No. : -

PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No. : SLL7730A

Make & Model : Honda City

Date of Registration : 09/03/2017

Colour : Met. Maroon

Engine Capacity (cc) : 1497cc

Mileage (km) : Battery Flat

Chassis / Frame No. : MRHGM6660HP000598

Engine No. : L15Z14116779

TYRE CONDITION

Front LH : 5 mm

Make : Bridgestone

Front RH : 5 mm

Make : Bridgestone

Rear LH : 5 mm

Make : Bridgestone

Rear RH : 5 mm

Make : Bridgestone

Road wheels Type : Alloy

(The above represents the approximate remaining life of tyre treads)

PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork : Good

Paintwork : Good

Handbrake : Serviceable

Footbrake : Serviceable

Steering : Serviceable

Apparent Engine Modification : Nil

PLACE OF REPAIRER OFFICE/WORKSHOP

Location : M/s. My Car Consultant Pte Ltd

53, Ubi Avenue 1, #01-33, Paya Ubi Industrial Park, Singapore 408934

ASSESSMENT

Repairer's Estimate : \$ 6,466.64

Revised Amount : \$ 5,206.80

Less Excess : \$ -

Recommended Reserve : \$ 4,160.00 (Lump Sum)

Estimated Normal Period of Repairs : 8 Working Days

Disclaimer: The information contained in this report is intended for exclusive use of the addressees (including any attachments) solely in relation to the loss occurrence in which the assessed vehicle involved. It is confidential and may be protected by legal privilege. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party. If you are not the intended recipient, please contact us immediately to arrange for its return and you should not disseminate, distribute, copy any information contained herein or use of this communication is strictly prohibited.



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St.3 #02-24 S(529890)

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvos@hotmail.com

Business Reg. 201404434D

Vehicle No : SLL7730A

Report No. : PAS/TP/0491219

GENERAL REMARKS

WITHOUT PREJUDICE

THE ASSIGNMENT

The survey was conducted at M/s. My Car Consultant Pte Ltd, 53, Ubi Avenue 1, #01-33, Paya Ubi Industrial Park, Singapore 408934.

(Subsequent inspections have been conducted)

POINT OF IMPACT

At the rear portion.

DAMAGES

The boot lid, rear bumper, rear end panel, rear floor panel, rear chassis members, rear fenders, LH reflector, taillamps, etc.

Other parts were also found damaged. (See schedule for details)

ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$5,206.80.

CONCLUSION

The repairer has agreed to undertake the repairs at a lump sum of SGD \$4,160.00.

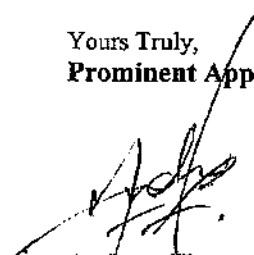
This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,

Prominent Appraiser Services Pte Ltd


Andrew How
Automobile Appraiser
MSAAA
Licensed Appraiser



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St.3 #02-24 S(529890)

Mobile: 9295 2204 Fax: 6722 9508 Email: pasves@hotmail.com

Business Reg. 201404434D

Vehicle No : SLL7730A

Report No. : PAS/TP/0491219

APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition	Repairer's Estimate (\$)	Our Assessment (\$)
1	1 pc	Boot lid / DD	Dented/Distorted	\$ 483.20	\$ 483.20 /
2	1 pc	Boot lid no.plate chrome garnish	Refit xsvc	\$ 100.20	\$ -
3	1 pc	Boot lid emblem (H) / Nec	Necessary	\$ 22.40	\$ 22.40 /
4	1 pc	Boot lid emblem (City) / Nec	Necessary	\$ 21.70	\$ 21.70 /
5	1 pc	Boot lid emblem (iVtec) / Nec	Necessary	\$ 18.40	\$ 18.40 /
6	2 pcs	Boot lid reflector R/L xsvc	LH Cracked	\$ 127.50	\$ 255.00
7	1 pc	Boot lid inner lining xsvc	Refit	\$ 142.30	\$ -
8	8 pcs	Boot lid inner lining clip xsvc	Necessary	\$ 3.00	\$ 24.00
9	1 pc	Boot lid lock / Jam	Bent/Jammed	\$ 110.70	\$ 110.70 /
10	1 pc	Boot lid lock striker xsvc	Bent	\$ 12.30	\$ 12.30 /
11	1 pc	Boot lid weatherstrip / CRU	Torn/Necessary	\$ 112.70	\$ 112.70 /
12	2 pcs	Taillamp R/L / CRA	Cracked	\$ 272.30	\$ 544.60
13	1 pc	Rr bumper / CRU	Dented	\$ 492.70	\$ 492.70 /
14	24 pcs	Rr bumper reverse sensor R/L / short	Dented/Damaged	\$ 152.30	2pcs \$ 304.60 250
15	6 pcs	Rr bumper clip / NEC	Necessary	\$ 3.20	\$ 19.20
16	2 pcs	Rr bumper retainer R/L / B R	Cracked/Necessary	\$ 22.10	\$ 44.20
17	1 pc	Rr end panel assy / DD	Dented	\$ 376.00	\$ 376.00 /
18	1 pc	Rr end panel garnish / CRU	Dented/Deformed	\$ 92.40	\$ 92.40 /
19	1 pc	Rr lock antenna xsvc	Dented/Damaged	\$ 169.20	\$ 169.20 x
20	1 pc	Rr warning buzzer xsvc	Dented/Damaged	\$ 82.70	\$ 82.70 x
21	1 pc	Rr spare tyre lid cover xsvc	Serviceable	\$ 100.20	\$ -
22	2 pcs	Rr fender R/L xsvc	Dented/Repair	(Refer labour no. 3, 5 & 6)	
23	1 pc	Rr floor panel xsvc	Dented/Repair	(Refer labour no. 3, 5 & 6)	
24	2 pcs	Rr chassis member R/L xsvc	Dented/Repair	(Refer labour no. 3, 5 & 6)	
				\$ 3,833.30	\$ 3,058.50 2,600.50
Less Discount : 20%				\$ 766.66	20% \$ 611.70 -20%
List Parts Sub-Total :				\$ 3,066.64	\$ 2,446.80 2,080.40
1	1 pc	Rr end panel sealant / NEC	Necessary	S/N \$ 50.00	\$ 40.00 /
Special Nett Sub-Total :				\$ 50.00	\$ 40.00
Parts Total :				\$ 3,116.64	\$ 2,486.80



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St.3 #02-24 S(529890)

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvos@hotmail.com

Business Reg. 201404434D

Vehicle No : SLL7730A

Report No. : PAS/TP/0491219

S/No.	Labour Descriptions	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	To transfer boot component parts to new boot.	\$ 100.00	\$ 70.00 ✓
2	To check rear electrical wiring system.	\$ 70.00	\$ 50.00 30
3	To remove and reinstall rear interior trims, garnishes, etc. for necessary repairs.	\$ 150.00	\$ 100.00 40
4	To remove, replace and/or transfer rear reverse sensors to new bumper. (Include reset/reprogram control unit)	\$ 150.00	\$ 140.00 30
5	To straighten, repair, realign on affected area and replace damaged parts.	\$ 1,400.00	\$ 1,100.00 900
6	To spray painting, blending on affected and adjacent area.	\$ 1,400.00	\$ 1,200.00 800
7	To spray anti-rust coating on new and affected panels.	\$ 80.00	\$ 60.00 40
Labour Total :		\$ 3,350.00	\$ 2,720.00 1,910
Total (Parts & Labour) :		\$ 6,466.64	\$ 5,206.80

For Lump Sum Repairs

The final adjusted Lump Sum contract amount is \$ 4,160.00

Under normal circumstances, the repairs should be completed within a reasonable period

of 8 Working Days. (Exclude waiting days of PRI, Sunday, Public Holiday and awaiting of shipment for spare parts)

64 Photographs were taken at the time of inspection.

N.B: By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall have the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.

Repair day - 5 days

415
\$ 3,200

2,080.40
40
1,910
4,030.40
20%
3,224.32

Note: The revised estimate has been adjusted from a visual inspection. Any discrepancies or unseen damages should be notified to the company within 7 days from the date hereof. Otherwise this revised amount shall be deemed as valid.