



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2104474

INV Date 25/06/2021

Reference CC4/LPC21001015/R1gs3q2

Code LPC2

### PROFESSIONAL SERVICE FEE

Vehicle No. SGM 3843M  
Insured Veh. SKN 3207Y  
Claim No. 20/21/21/VP05/024145  
Policy No. Z20VP05027990  
Accident Date 17/01/2021  
Inspection Date 22/01/2021

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (7%)</b>                | <b>28.00</b>  |
| <b>Grand Total</b>             | <b>428.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                         |                         |                 |                                                                |  |
|-------------------------------------------------------------------------------------------------------------------------------------------|-------------------------|-----------------|----------------------------------------------------------------|--|
| LONPAC INSURANCE BHD<br>300 BEACH ROAD<br>#17-04/07 THE CONCOURSE SINGAPORE 199555                                                        |                         |                 | Ref: CC4/LPC21001015/R1gs3q2<br>Date: 25/06/2021<br>Code: LPC2 |  |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                         |                         |                 |                                                                |  |
| Insured Veh.                                                                                                                              | SKN 3207Y               | Veh. Inspected  | SGM 3843M                                                      |  |
| Policy No.                                                                                                                                | Z20VP05027990           | Coverage (\$)   | 0.00                                                           |  |
| Claim No.                                                                                                                                 | 20/21/21/VP05/024145    | Excess (\$)     | 0.00                                                           |  |
| Assign From                                                                                                                               | GERALD                  | Assign Date     | 21/01/2021                                                     |  |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                             |                         |                 |                                                                |  |
| Make & Model                                                                                                                              | KIA FORTE               | c.c             | 1591                                                           |  |
| Engine No.                                                                                                                                | HIDDEN                  | Year of Reg.    | 2016                                                           |  |
| Chassis No.                                                                                                                               | KNAFX411MG5602738       | Colour          | WHITE                                                          |  |
| Odometer                                                                                                                                  | 60847 KM                | Steering        | IN ORDER                                                       |  |
| Brakes                                                                                                                                    | IN ORDER                | Modification    | SPORTS RIM                                                     |  |
| General                                                                                                                                   | FAIR                    |                 |                                                                |  |
| <b>3. Conditions of Tyres</b>                                                                                                             |                         |                 |                                                                |  |
|                                                                                                                                           | Size                    | Make            | Balance                                                        |  |
| R/H Front Tyre                                                                                                                            | 205/55 R16              | YOKOHAMA        | 6 mm                                                           |  |
| L/H Front Tyre                                                                                                                            | 205/55 R16              | YOKOHAMA        | 6 mm                                                           |  |
| R/H Rear Tyre                                                                                                                             | 205/55 R16              | YOKOHAMA        | 6 mm                                                           |  |
| L/H Rear Tyre                                                                                                                             | 205/55 R16              | YOKOHAMA        | 6 mm                                                           |  |
| <b>4. Description of Damages</b>                                                                                                          |                         |                 |                                                                |  |
| THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT & O/S FRONT PORTION.<br>DAMAGES SEE DETAILS.                                               |                         |                 |                                                                |  |
| <b>5. General Information</b>                                                                                                             |                         |                 |                                                                |  |
| Accident Date                                                                                                                             | 17/01/2021              | Inspection Date | 22/01/2021                                                     |  |
| Survey held at                                                                                                                            | 15 FAN YONG ROAD        |                 |                                                                |  |
| Repairer                                                                                                                                  | MOVA AUTOMOTIVE PTE LTD |                 |                                                                |  |
| <b>5a. Remarks</b>                                                                                                                        |                         |                 |                                                                |  |
| A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.<br>B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                         |                 |                                                                |  |
| <b>5b. Estimate Days of Repair</b>                                                                                                        |                         |                 |                                                                |  |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                       |                         |                 | 8 Working Days                                                 |  |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGM 3843M

| Qty | Description of Parts                    | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|-----------------------------------------|----------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b>      |                      |                           |                   |
| 2   | HEADLAMP ASSY RH & LH @\$2004.00        | CRACKED              | 4,008.00                  | 4,008.00          |
| 2   | HEADLAMP LOWER BRACKET RH & LH @\$56.00 | SERVICEABLE          | 112.00                    | -                 |
| 2   | FRONT FENDER RH & LH @\$341.00          | BENT                 | 682.00                    | 682.00            |
| 2   | FRONT FENDER COWLING RH & LH @\$85.00   | DEFORMED             | 170.00                    | 170.00            |
| 1   | FRONT FENDER INNER GARNISH RH           | NECESSARY            | 39.00                     | 39.00             |
| 2   | FRONT FENDER CLIPS @\$4.50              | NECESSARY            | 90.00                     | 90.00             |
| 1   | FRONT BUMPER                            | SCRATCHED            | 633.00                    | 633.00            |
| 2   | FRONT BUMPER RETAINER RH & LH @\$29.00  | SERVICEABLE          | 58.00                     | -                 |
| 10  | FRONT BUMPER CLIPS @\$4.80              | NECESSARY            | 48.00                     | 48.00             |
| 2   | FRONT KNUCKLE ARM RH & LH @\$364.00     | BENT                 | 728.00                    | 728.00            |
| 2   | FRONT KNUCKLE BEARING RH & LH @\$117.00 | NECESSARY            | 234.00                    | 234.00            |
| 2   | FRONT LOWER ARM RH & LH @\$342.00       | BENT                 | 684.00                    | 684.00            |
| 2   | FRONT SHOCK ABSORBER RH & LH @\$282.00  | SERVICEABLE          | 564.00                    | -                 |
| 1   | FRONT DOOR PILLAR RH                    | TO REPAIR SEE LABOUR | 1,313.00                  | -                 |
| 1   | FRONT DOOR RH                           | BENT                 | 1,543.00                  | 1,543.00          |
| 1   | FRONT DOOR STICKER RH                   | NECESSARY            | 79.20                     | 79.20             |
| 1   | FRONT DOOR HINGE TOP RH                 | BENT                 | 58.00                     | 58.00             |
| 1   | FRONT DOOR CHECKER RH                   | SERVICEABLE          | 49.00                     | -                 |
| 1   | FRONT DOOR HINGE BOTTOM RH              | SERVICEABLE          | 52.00                     | -                 |
| 1   | FRONT DOOR GLASS REGULATOR RH           | SERVICEABLE          | 292.00                    | -                 |
| 1   | FRONT DOOR GLASS REGULATOR MOTOR RH     | SERVICEABLE          | 295.00                    | -                 |
| 1   | FRONT DOOR SPEAKER RH                   | SERVICEABLE          | 250.00                    | -                 |
| 1   | FRONT DOOR TRIM BOARD RH                | SERVICEABLE          | 1,504.00                  | -                 |
| 1   | ROCKER PANEL RH (NPA)                   | TO REPAIR SEE LABOUR | -                         | -                 |
| 1   | FRONT DOOR LOCK RH                      | SERVICEABLE          | 227.00                    | -                 |
| 1   | FRONT DOOR WEATHERSTRIP RH (NPA)        | SERVICEABLE          | -                         | -                 |
| 1   | FRONT DOOR STEP GARNISH RH              | DEFORMED             | 84.00                     | 84.00             |
| 1   | FRONT DOOR PILLAR INNER TRIM RH (NPA)   | SERVICEABLE          | -                         | -                 |
| 1   | DASHBOARD ASSY (NPA)                    | SERVICEABLE          | -                         | -                 |

Report Ref No. CC4/LPC21001015/R1gs3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

| Qty                | Description of Parts                                                                                                                                                                                                       | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|--------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
| 1                  | FRONT DRIVER SHAFT RH (NPA)                                                                                                                                                                                                | SERVICEABLE   | -                         | -                 |
| 1                  | FRONT CROSS MEMBER (NPA)                                                                                                                                                                                                   | SERVICEABLE   | -                         | -                 |
| 1                  | STEERING RACK & PINION (NPA)                                                                                                                                                                                               | SERVICEABLE   | -                         | -                 |
| 1                  | FRONT SHOCK ABSORBER TOP MOUNTING RH (NPA)                                                                                                                                                                                 | SERVICEABLE   | -                         | -                 |
| 1                  | STEERING TIE ROD LH (ADDITIONAL)                                                                                                                                                                                           | SERVICEABLE   | 69.40                     | -                 |
| 1                  | BATTERY NEGATIVE CABLE (ADDITIONAL)                                                                                                                                                                                        | NOT NECESSARY | 64.40                     | -                 |
|                    | LESS 10% DISCOUNT                                                                                                                                                                                                          |               | -1,393.00                 | -908.02           |
|                    |                                                                                                                                                                                                                            |               | 12,537.00                 | 8,172.18          |
| 2                  | FRONT SPORT RIM RH & LH @\$875.00 (SN)                                                                                                                                                                                     | SCRATCHED     | 1,750.00                  | 500.00            |
|                    | LESS 10% DISCOUNT                                                                                                                                                                                                          |               | -175.00                   | -                 |
|                    |                                                                                                                                                                                                                            |               | 1,575.00                  | 500.00            |
|                    | <b>LABOUR</b>                                                                                                                                                                                                              |               |                           |                   |
|                    | TO CUT /WELD FRONT DOOR PILLAR RH ,KNOCK & STRAIGHTEN ROCKER PANEL RH ,HEADLAMP PANEL REMOVE & REPLACE ACCIDENT DAMAGED PARTS REALIGN ALL CONNECTION .INCLUSIVE OF THE REPAIR OF FRONT DOOR PILLAR RH AND ROCKER PANEL RH. |               | 1,000.00                  | 900.00            |
|                    | SPRAY PAINT FRONT BUMPER ,FRONT FENDER RH & LH ,FRONT DOOR PILLAR RH ,ROCKER PANEL RH,FRONT DOOR RH ,CENTER PILLAR RH (REARL COLOUR).                                                                                      |               | 1,400.00                  | 1,000.00          |
|                    | REMOVE & REPLACE FRONT WINDSCREEN GLASS & CHECK WATER LEAKAGE.                                                                                                                                                             | NOT NECESSARY | 120.00                    | -                 |
|                    | REMOVE & REPLACE FRONT CROSS MEMBER ,FRONT UNDER CARRIAGE SUSPENSION .                                                                                                                                                     |               | 350.00                    | 300.00            |
|                    | REMOVE & REPLACE DASHBOARD ASSY ,GLOVE BOX FRONT DOOR ,FRONT DOOR PILLAR INNER TRIM, FLOOR CARPET.                                                                                                                         |               | 300.00                    | 80.00             |
|                    | REMOVE & REPLACE FRONT DOOR TRIM BOARD ,MECHANISM & CHECK LOCKING SYSTEM.                                                                                                                                                  |               | 50.00                     | 50.00             |
|                    | COMPUTERIZE WHEEL ALIGNMENT.                                                                                                                                                                                               |               | 60.00                     | 60.00             |
|                    | RUST PROOF AFFECTED AREA.                                                                                                                                                                                                  |               | 100.00                    | 80.00             |
|                    | CHECK WIRING & FOCUS ALIGNMENT.                                                                                                                                                                                            |               | 40.00                     | 30.00             |
|                    |                                                                                                                                                                                                                            |               | 3,420.00                  | 2,500.00          |
| <b>GRAND TOTAL</b> |                                                                                                                                                                                                                            |               | <b>17,532.00</b>          | <b>11,172.18</b>  |

Report Ref No. CC4/LPC21001015/R1gs3q2



|                                                                                 |  |  |                 |
|---------------------------------------------------------------------------------|--|--|-----------------|
| <b>RECOMMENDED COST OF LUMP SUM REPAIRS<br/>(TO ITS PRE-ACCIDENT CONDITION)</b> |  |  | <b>8,900.00</b> |
|---------------------------------------------------------------------------------|--|--|-----------------|

Report Ref No. CC4/LPC21001015/R1gs3q2

**MOHAMMED RASUL BIN MOHD YUNUS**

**Automotive Assessor**

**HO LEONG CHUAN**

**Automotive Assessor**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGM 3843M

INSPECTION

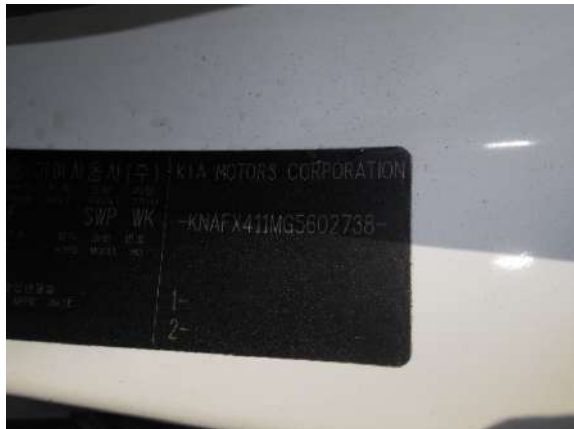



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

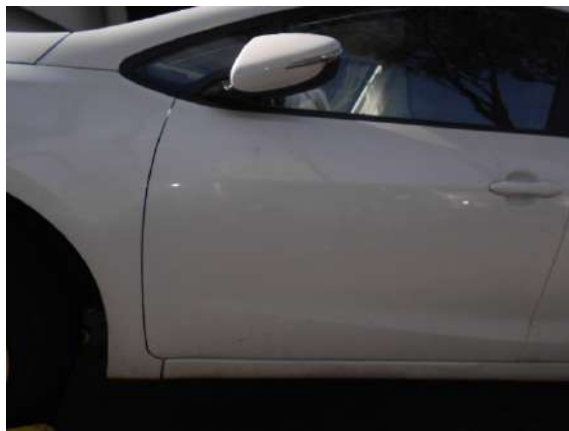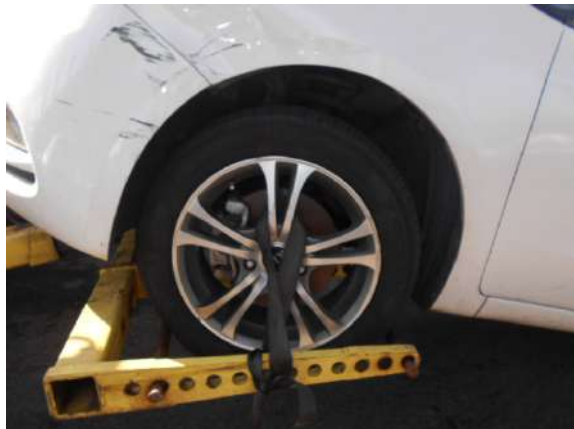





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

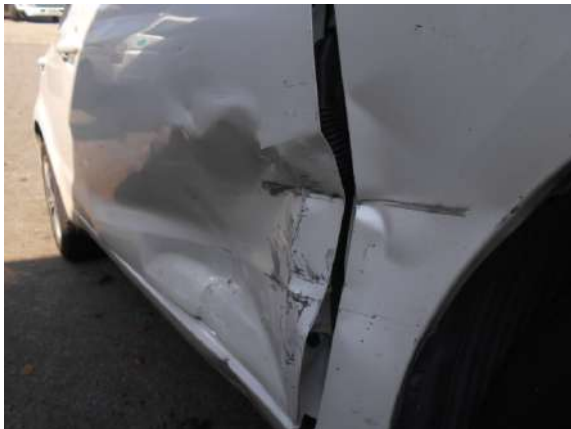





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SGM 3843M**

**RE-INSPECTION**





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

