

SUCCESS UNITED PTE LTD

2 Kaki Bukit Ave 2, #01-33 / #02-29

Kaki Bukit Autohub. Singapore 417921

Tel No. : 67461515 / 67471787 Fax No. : 67485015

Website : www.successunited.com.sg

Buss. Reg. No. : GST No. 200402570G

AIG Asia Pacific Insurance Pte Ltd

AIG Building

78 Shenton Way, #07-16

Singapore 079120

Attention : Motor Claim Department

Contact : 64191053 Fax No. : 68357416

Estimate : TP21-004

Date : 23/01/2021

Vehicle Num. : SJV8337S

Make/Model : Honda Freed-2008

Chassis/Eng# : GB31033688/L15A2334092

Accident Date : 22/01/2021

Claim No. :

Reference :

Policy No. : (08/08/2021)

S/N	Quantity	Particular	Unit Price	Amount S\$
-----	----------	------------	------------	------------

1.	1 pc	LIST ITEMS :		
2.	2 pcs	Frt Bumper Assy <i>Deformed</i>	19.21	625.10 ✓
3.	1 pc	Frt Bumper Side Holder L/R <i>new</i>		38.42 ✓
4.	2 pcs	Frt Bumper Tow Hook Cover <i>Deformed</i>		27.02 ✓
5.	1 pc	Headlamp Assy L/R <i>Not New</i>	698.20	1,396.40 x
6.	1 pc	Frt Grille Assy <i>crushed</i>		645.15 ✓ <i>385</i>
7.	1 pc	Frt Bumper Reinforcement <i>Best</i>		348.50 ✓
8.	1 pc	Radiator Support Panel Assy <i>Not New</i>		550.00 x
9.	1 pc	Radiator Assy <i>3 ALP</i>		1,530.60 x
10.	1 pc	Aircon Condenser <i>Not New</i>		795.60 x
11.	1 pc	Rear Boot Lid Honda Logo <i>Not New</i>		27.40 ✓
12.	1 pc	Rear Boot Lid 'Freed' Emblem <i>Not New</i>		55.71 ✓
13.	1 pc	Rear Boot Lid Outer Handle <i>Not New</i>		193.72 x
14.	2 pcs	Rear Boot Lid Weatherstrip <i>Not New</i>		139.80 ✓
15.	1 pc	Rear Boot Lid Damper L/R <i>Not New</i>	138.00	276.00 x
16.	1 pc	Rear Boot Lid Mechanism Lock <i>Damaged</i>		312.90 ✓ <i>265</i>
17.	1 pc	Third Brake Light <i>Not New</i>		210.90 x
18.	1 pc	Rear Wiper Motor <i>Not New</i>		312.00 x
19.	1 pc	Rear Wiper Arm <i>Not New</i>		85.00 ✓
20.	1 pc	Rear Wiper Blade <i>Not New</i>		75.00 ✓
21.	1 pc	Rear Boot Lid Inner Trim Board <i>crushed</i>		419.50 ✓ <i>298</i>
22.	1 pc	Rear End Panel <i>Dented</i>		523.10 ✓
23.	2 pcs	Rear End Panel Inner Top Garnish <i>Deformed</i>		98.10 ✓
24.	1 pc	Rear Lamp L/R <i>crushed</i>	518.00	1,036.00 ✓
25.	1 pc	Rear Bumper <i>Distorted</i>		590.47 ✓
26.	1 pc	Rear Bumper Tow Hook Cover <i>Deformed</i>		28.00 ✓
27.	2 pcs	Rear Floor Panel <i>Repair</i>		1,295.30 x
28.	1 pc	Rear Fender Inner Trim Garnish L/RH <i>Not New</i>	381.00	762.00 x
29.	1 pc	Rear No. Plate Lamp <i>Not New</i>		61.50 x
30.	1 pc	Rear Boot Handle Switch <i>Not New</i>		215.60 x
31.	1 pc	Rear Windscreen <i>Shattered</i>		1,280.00 ✓
		Rear Windscreen Moulding <i>new</i>		150.00 ✓

List TotalS\$:

20.00% Discount S\$:

14,104.79

2,820.96

11,283.83

CONTINUE / ...

SUCCESS UNITED PTE LTD

2 Kaki Bukit Ave 2, #01-33 / #02-29
 Kaki Bukit Autohub. Singapore 417921
 Tel No. : 67461515 / 67471787 Fax No. : 67485015
 Website : www.successunited.com.sg
 Buss. Reg. No. : GST No. 200402570G

AIG Asia Pacific Insurance Pte Ltd
 AIG Building
 78 Shenton Way, #07-16
 Singapore 079120
 Attention : Motor Claim Department
 Contact : 64191053 Fax No. : 68357416

Estimate : TP21-004

Date : 23/01/2021
 Vehicle Num. : SJV8337S
 Make/Model : Honda Freed-2008
 Chassis/Eng# : GB31033688/L15A2334092
 Accident Date : 22/01/2021
 Claim No. :
 Reference :
 Policy No. : (08/08/2021)

S/N	Quantity	Particular	Unit Price	Amount S\$
1.	1 set	SPECIAL NETT ITEMS :		
2.	2 set	Reverse Sensor <i>Damaged</i>		280.00 <i>200</i>
3.	1 pc	Frt & Rear No. Plate w/frame <i>Best.</i>	45.00	90.00 ✓
		Windscreen Sealant <i>Na</i>		40.00 ✓
		Special Nett Total S\$:		410.00
		LABOUR :		
		To remove, instal aircon parts, vacuum, refill gas.		250.00 ✕
		To remove, repair and replaced damaged bodyparts, realign bodyworks & where consistent to the accident	<i>2400</i>	1,800.00 <i>1200</i>
		To putty and respray painting on affected area.		1,600.00 <i>1200</i>
		Labour Total S\$:		3,650.00
<i>Admin ling.</i> <i>h/s 26/01/21</i> <i>10 Days.</i> <i>Supplementary : 1182.40</i> <i>total ✓ : 8772.89</i> <i>h/s - 7K.</i>				
Total S\$:				15,343.83
=====				

SUCCESS UNITED PTE LTD

2 Kaki Bukit Ave 2, #01-33 / #02-29

Kaki Bukit Autohub. Singapore 417921

Tel No. : 67461515 / 67471787 Fax No. : 67485015

Website : www.successunited.com.sg

Buss. Reg. No. : GST No. 200402570G

AIG Asia Pacific Insurance Pte Ltd

AIG Building

78 Shenton Way, #07-16

Singapore 079120

Attention : Motor Claim Department

Contact : 64191053 Fax No. : 68357416

Supplementary Estimate : TP21004S

Date : 23/01/2021

Vehicle Num. : SJV8337S

Make/Model : Honda Freed-2008

Chassis/Eng# : GB31033688/L15A2334092

Accident Date : 22/01/2021

Claim No. :

Reference :

Policy No. : (08/08/2021)

S/N	Quantity	Particular	Unit Price	Amount S\$
-----	----------	------------	------------	------------

1.	1 pc	LIST ITEMS :		
2.	2 pcs	Rear Boot Lid <i>Pushed</i>	1378	1,521.90 <i>1288</i>
		Headlamp Bracket L/R <i>Crash</i>	45.00	90.00
		List Total S\$:	1102.40	1,611.90
		20.00% Discount S\$:		322.38
				1,289.52

LABOUR :


To remove, replace & transfer rear boot lid components.

Labour Total S\$:

80 *80*

200.00 *80*

200.00

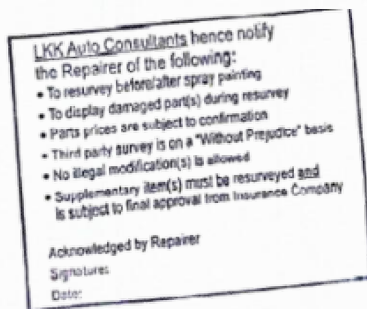

Supplementary 1182.40

Total S\$: 1,489.52
=====

SUCCESS UNITED PTE LTD