



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2102634

INV Date 15/04/2021

Reference CC4/LPC21001353/R1pa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBE 2995R

Insured Veh. XE 4716G

Claim No. 20/21/21/VC00/024183

Policy No. Z/20/VC00/106249

Accident Date 27/01/2021

Inspection Date 01/02/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21001353/R1pa3q2 Date: 15/04/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 4716G		Veh. Inspected	GBE 2995R
Policy No.	Z/20/VC00/106249		Coverage (\$)	0.00
Claim No.	20/21/21/VC00/024183		Excess (\$)	0.00
Assign From	KENNY		Assign Date	28/01/2021
2. Vehicle Particulars & Condition				
Make & Model	NISSAN NV200 1.5L MT		c.c	1461
Engine No.	HIDDEN		Year of Reg.	2015
Chassis No.	VSKYBAM20Z0110555		Colour	GREY
Odometer	158939 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	NIL
General	FAIR			
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	185/65 R14	FALKEN	6 mm
	L/H Front Tyre	185/65 R14	FALKEN	6 mm
	R/H Rear Tyre	185/65 R14	FALKEN	6 mm
	L/H Rear Tyre	185/65 R14	FALKEN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	27/01/2021	Inspection Date	01/02/2021
	Survey held at	WAH HONG MOTORS & CREDIT PTE LTD 38 TOH GUAN ROAD EAST #01-57 ENTERPRISE HUB SINGAPORE 608581		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 2995R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR DOOR LH (WCP)	BUCKLED	1,180.00	1,180.00
1	REAR DOOR WEATHERSTRIP LH (WCP)	CUT	85.00	85.00
1	REAR DOOR LH EMBLEM 'NV 200' (WCP)	NECESSARY	75.00	75.00
1	REAR DOOR LH LOGO BADGE (WCP)	NECESSARY	60.00	60.00
1	REAR DOOR RH (WCP)	BENT	950.00	950.00
1	REAR DOOR WEATHERSTRIP RH (WCP)	CUT	85.00	85.00
1	REAR DOOR RH EMBLEM 'DCI' (WCP)	NECESSARY	85.00	85.00
2	REAR DOOR LH HINGE UPPER AND LOWER @\$105.00 (WCP)	LOWER BENT	210.00	105.00
2	REAR DOOR RH HINGE UPPER AND LOWER @\$105.00 (WCP)	LOWER BENT	210.00	105.00
1	REAR DOOR LH CENTER GARNISH (WCP)	SERVICEABLE	210.00	-
1	REAR BUMPER (WCP)	DEFORMED	490.00	490.00
2	REAR BUMPER SIDE RETAINER LH/RH @\$30.00 (WCP)	N/S NECESSARY / O/S SERVICEABLE	60.00	30.00
2	TAIL LAMP RH/LH @\$140.00 (WCP)	N/S CRACKED / O/S SERVICEABLE	280.00	140.00
1	REAR DOOR LH TOP BRAKE LAMP (WCP)	SERVICEABLE	180.00	-
1	REAR DOOR LH LOCK (WCP)	BENT	105.00	105.00
1	END PANEL TOP GARNISH (WCP)	DEFORMED	75.00	75.00
1	REAR DOOR RH LOCK (WCP) (ADDITIONAL)	CUT	105.00	105.00
1	REAR BOOT LID WEATHERSTRIP (WCP) (ADDITIONAL)	CUT	85.00	85.00
2	REAR BOOT LID CATCH LH/RH @\$35.00 (WCP) (ADDITIONAL)	BENT	70.00	70.00
	COST PLUS 15%		690.00	574.50
			5,290.00	4,404.50
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER CLIPS (SN)	NECESSARY	35.00	35.00
1	70KM/H DECAL STICKER (SN)	NECESSARY	15.00	10.00
1	6 PAX DECAL STICKER (SN)	NECESSARY	15.00	10.00
1	CAR PLATE WITH HOLDER (SN)	SERVICEABLE	35.00	-
1	REAR REVERSE SENSOR (SN)	SERVICEABLE	200.00	-

Report Ref No. CC4/LPC21001353/R1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WIPER (SN)	SERVICEABLE	30.00	-
2	REAR WINDSCREEN SOLAR FILM LH/RH (SN)	NOT NECESSARY	300.00	-
			630.00	55.00
	LABOUR			
	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS ,PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACE THE DAMAGED PARTS AND COMPONENTS.		800.00	600.00
	TO SUPPLY PAINT MATERIALS ,EXPANDABLE ITEMS & PUTTY,RESPRAY PAINT ON PARTS REPLACED & REPAIRED .		600.00	600.00
	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS.		40.00	40.00
	TO REMOVE AND REFIX /REPLACE WIRING SYSTEM ,REVERSE SENSOR AT ACCIDENT DAMAGED AREA AND CHECK FOR ALL ELECTRICAL PROPER FUNCTION .		100.00	60.00
	TO CARRIED OUT REMOVE AND REFIX REAR WINDSCREEN RH .		100.00	60.00
	TO CARRIED OUT REMOVE AND REFIX REAR WINDSCREEN LH .		100.00	60.00
	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS ,PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACE THE DAMAGED PARTS AND COMPONENTS (BOTH REAR FENDER).		300.00	150.00
	TO SUPPLY PAINT MATERIALS ,EXPANDABLE ITEMS & PUTTY,RESPRAY PAINT ON PARTS REPLACED & REPAIRED (BOTH REAR FENDER).		400.00	200.00
			2,440.00	1,770.00
GRAND TOTAL			8,360.00	6,229.50
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,950.00

Report Ref No. CC4/LPC21001353/R1pa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 2995R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

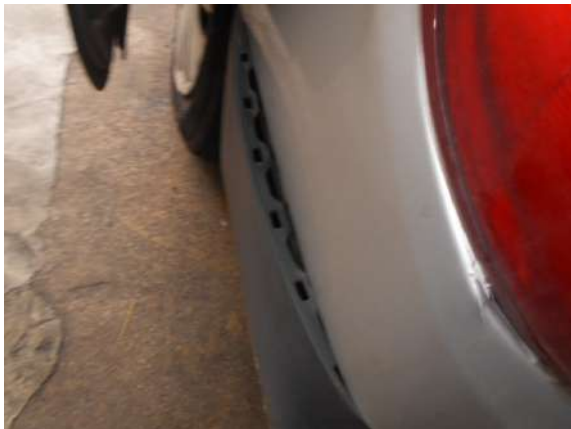



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 2995R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

