



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

| | | |
|-------------------------------------|-----------|------------------------|
| CHINA TAIPING INSURANCE (S) PTE LTD | INV No. | AC2103107 |
| 3 ANSON ROAD #16-00 | INV Date | 04/05/2021 |
| SPRINGLEAF TOWER | Reference | CC3/CTI21001375/Ges3q2 |
| SINGAPORE 079909 | Code | CTI |

PROFESSIONAL SERVICE FEE

| | |
|-----------------|--------------------|
| Vehicle No. | SHA 3053C |
| Insured Veh. | GBD 6864P |
| Claim No. | SNM21D200586/C02 |
| Policy No. | DMCVSNW00012402004 |
| Accident Date | 27/01/2021 |
| Inspection Date | 27/01/2021 |

| Description | Total |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00 |
| Subtotal | 400.00 |
| GST (7%) | 28.00 |
| Grand Total | 428.00 |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile | | | |
|----------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------|--------------------------------------------------------------|------------|
| CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909 | | Ref: CC3/CTI21001375/Ges3q2 Date: 04/05/2021 Code: CTI | |
| 1. Policy Particulars :- THIRD PARTY CLAIM | | | |
| Insured Veh. | GBD 6864P | Veh. Inspected | SHA 3053C |
| Policy No. | DMCVSNW00012402004 | Coverage (\$) | 0.00 |
| Claim No. | SNM21D200586/C02 | Excess (\$) | 0.00 |
| Assign From | | Assign Date | 27/01/2021 |
| 2. Vehicle Particulars & Condition | | | |
| Make & Model | TOYOTA PRIUS | c.c | 1798 |
| Engine No. | HIDDEN | Year of Reg. | 2019 |
| Chassis No. | JTDKB3FU503080618 | Colour | BLUE |
| Odometer | 223829 KM | Steering | IN ORDER |
| Brakes | IN ORDER | Modification | NIL |
| General | GOOD | | |
| 3. Conditions of Tyres | | | |
| | Size | Make | Balance |
| R/H Front Tyre | 195/65 R15 | WEST LAKE | 6 mm |
| L/H Front Tyre | 195/65 R15 | WEST LAKE | 6 mm |
| R/H Rear Tyre | 195/65 R15 | WEST LAKE | 6 mm |
| L/H Rear Tyre | 195/65 R15 | WEST LAKE | 6 mm |
| 4. Description of Damages | | | |
| THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS. | | | |
| 5. General Information | | | |
| Accident Date | 27/01/2021 | Inspection Date | 27/01/2021 |
| Survey held at | COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969 | | |
| 5a. Remarks | | | |
| A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. | | | |
| 5b. Estimate Days of Repair | | | |
| ESTIMATED NORMAL PERIOD FOR REPAIR: | | 3 Working Days | |



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHA 3053C

| Qty | Description of Parts | Condition | Estimate By Workshop (\$) | Our Adjusted (\$) |
|------------------------------------|-----------------------------------------------------------------|----------------------|---------------------------|-------------------|
| <u>REPLACEMENT OF PARTS</u> | | | | |
| 1 | GARNISH SUB-ASSY ,BACK DOOR OUTSIDE | CRACKED | 889.70 | 889.70 |
| 1 | REAR TRUNK LID COVER | TO REPAIR SEE LABOUR | 1,126.60 | - |
| 1 | REAR TRUNK LID GLASS W/MOULDING | NOT NECESSARY | 1,778.30 | - |
| 1 | REAR TRUNK LID GLASS BLACK | NOT NECESSARY | 1,569.70 | - |
| 1 | REAR TRUNK LID LOGO (PRIUS) | NECESSARY | 60.80 | 60.80 |
| 1 | REAR TRUNK LID LOGO (HYBRID) | NECESSARY | 52.40 | 52.40 |
| 1 | REAR TRUNK LID LOGO (TOYOTA STAR) | NECESSARY | 52.38 | 52.38 |
| 1 | REAR BUMPER | DEFORMED | 458.60 | 458.60 |
| 1 | REAR BUMPER UNDER COVER | SCRATCHED | 552.60 | 552.60 |
| 2 | REAR BUMPER SIDE RETAINER LH/RH @\$112.70 | O/S CUT | 225.40 | 112.70 |
| 1 | REAR BUMPER UNDER COVER CENTRE | NOT NECESSARY | 232.00 | - |
| 1 | REAR BUMPER TOWING COVER | SCRATCHED | 82.70 | 82.70 |
| 2 | REAR BUMPER REINFORCEMENT STAY LH/RH @\$139.60 | NOT NECESSARY | 279.20 | - |
| 1 | TAIL LAMP RH UPPER | NOT NECESSARY | 557.90 | - |
| 1 | TAIL LAMP RH LOWER | SCRATCHED | 548.50 | 548.40 |
| 10 | REAR BUMPER CLIPS | NECESSARY | 22.00 | 22.00 |
| 1 | REAR BUMPER REINFORCEMENT | NOT NECESSARY | 318.80 | - |
| | LESS 25% DISCOUNT | | -2,201.90 | -708.07 |
| | | | 6,605.68 | 2,124.21 |
| <u>SPECIAL NETT ITEMS</u> | | | | |
| 1 | REAR BUMPER MAT (SN) | DEFORMED | 50.00 | 50.00 |
| 1 | REAR NUMBER PLATE W/HOLDER (SN) | NOT NECESSARY | 55.00 | - |
| 1 | REAR TRUNK LID APPS STICKER (SN) | NECESSARY | 40.00 | 40.00 |
| 1 | REAR TRUNK LID COMOFRT & TEL NO.STICKER (SN) | NECESSARY | 60.00 | 60.00 |
| 1 | REAR BUMPER REVERSE SENSOR (SN) | DAMAGED | 135.70 | 135.70 |
| | | | 340.70 | 285.70 |
| <u>LABOUR</u> | | | | |
| | PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR TRUNK LID COVER . | | 900.00 | 700.00 |



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

| Qty | Description of Parts | Condition | Estimate By Workshop (\$) | Our Adjusted (\$) |
|------------------------------------|---------------------------------|---------------|---------------------------|-------------------|
| | SPRAY PAINTING CHARGE. | | 800.00 | 750.00 |
| | REMOVE/REFIX WINDSCREEN GLASS . | NOT NECESSARY | 120.00 | - |
| | WIRING CHARGE. | | 90.00 | 30.00 |
| | TUFF KOTE. | NOT NECESSARY | 120.00 | - |
| | REMOVE/REFIX REVERSE SENSOR . | | 90.00 | 40.00 |
| | | | 2,120.00 | 1,520.00 |
| GRAND TOTAL | | | 9,066.38 | 3,929.91 |
| RECOMMENDED COST OF REPAIRS | | | | 3,929.91 |

Report Ref No. CC3/CTI21001375/Ges3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 3053C

INSPECTION

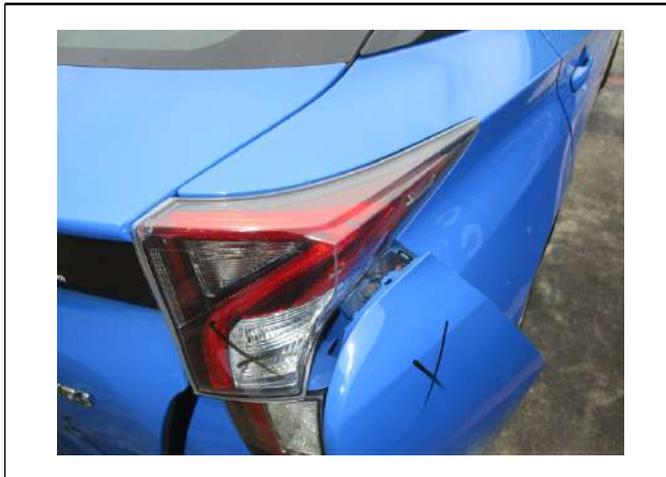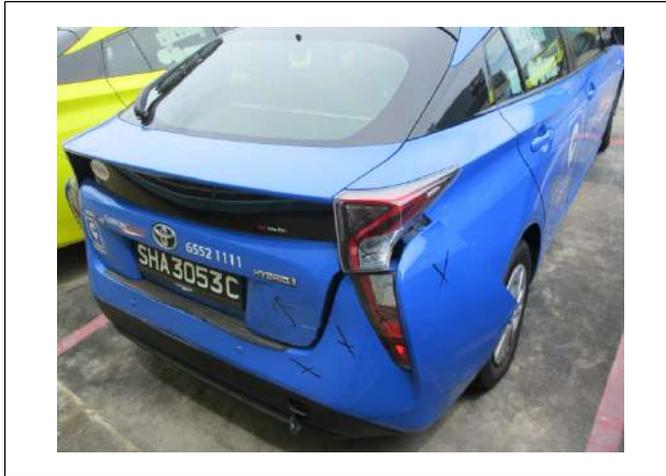



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

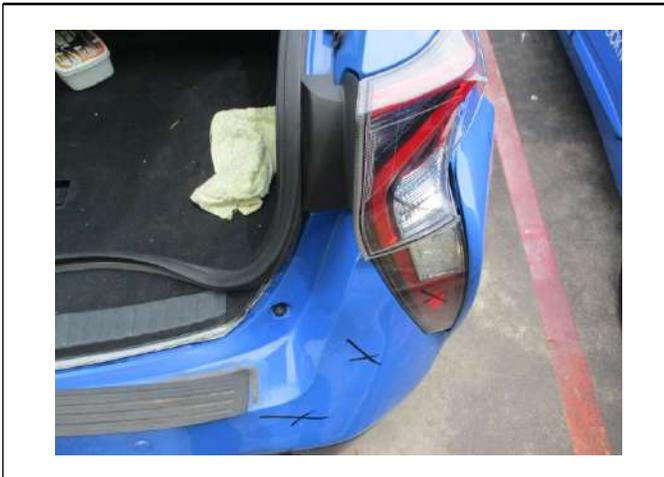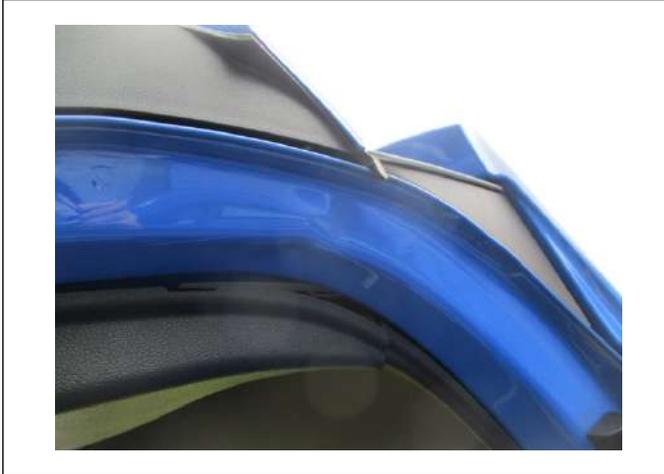



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

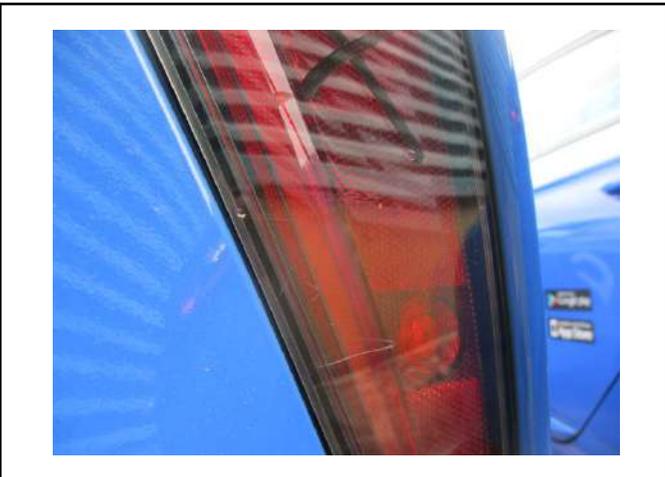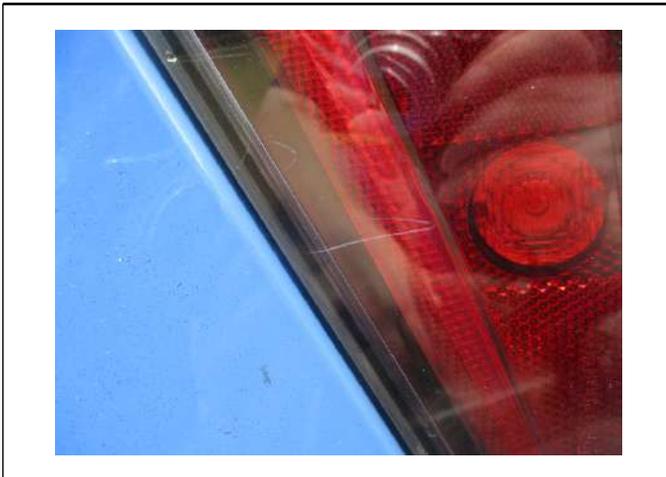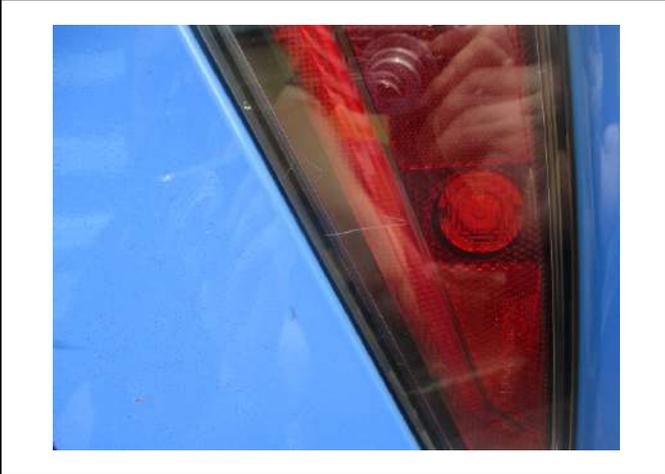








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

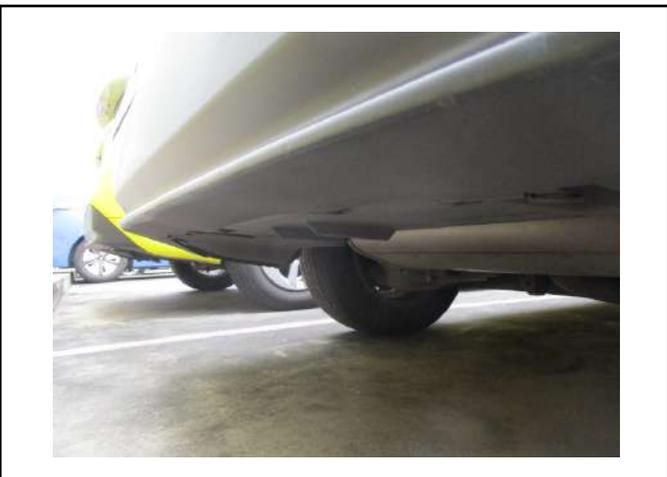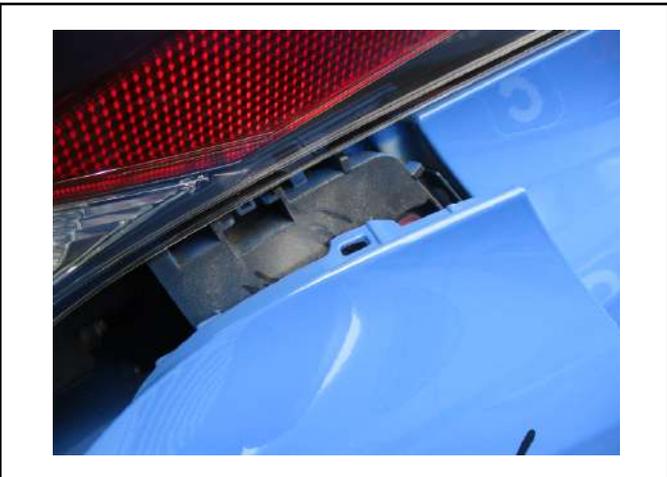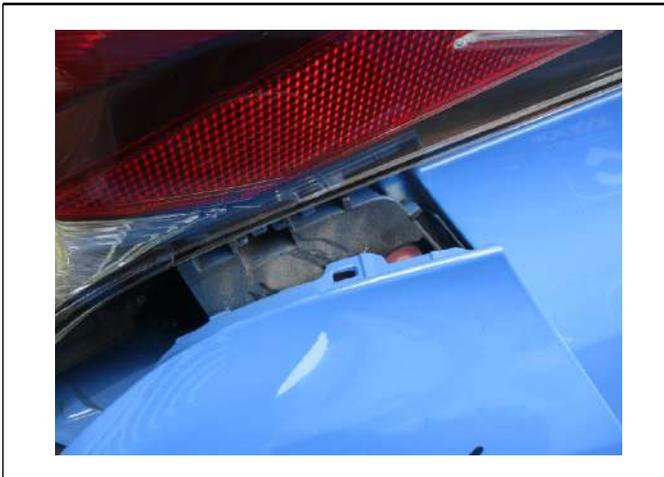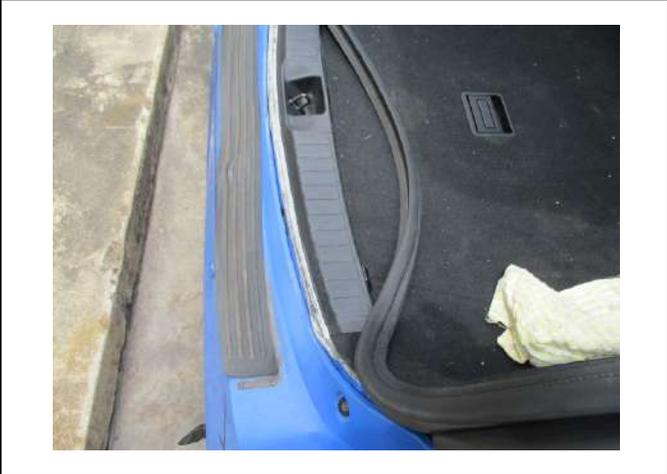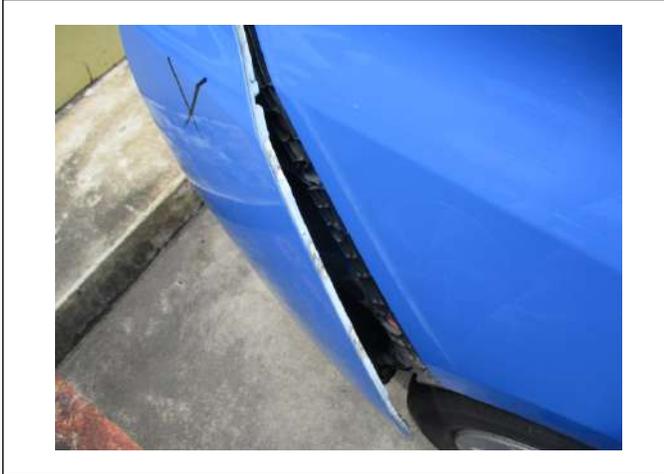




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

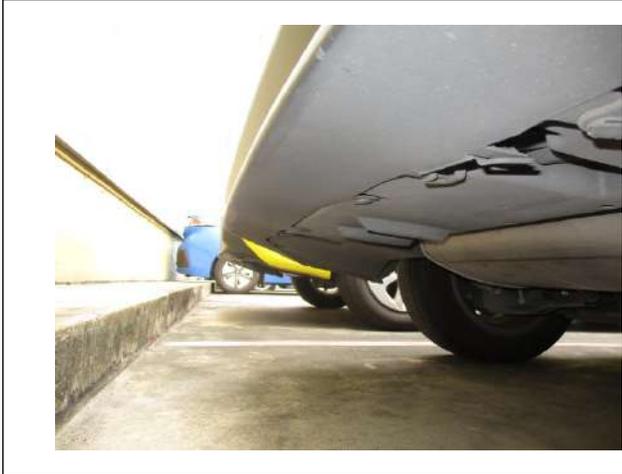



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 3053C

RE-INSPECTION

