


ASS. REC. BY: Tau Jiah REF: CS/CT12100413/Tiq, A3.

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. SNM21D200556/C02
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

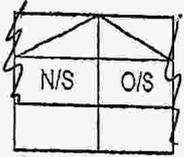

Bal. or Market Value: A63K
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: 7 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No
WP
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SLW5617A Yr Regn: 2018 / Feb
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Hyundai Elantra cc 1591
 Colour: Grey A/C: Insured / Std / NI / NA
 Sp. Reading: 128483 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: KM10841CMJU-630320
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or _____
 Brake: In order / Jammed / Leaked / Burnt or _____
 Mod: Nil / SRim / STD A/Rim or _____
 Tyre Size: F: 195/65R15
 R: 2

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or _____
 Front _____ Rear _____
 R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. _____ D.O.I. 2/2/21 5pm
 Survey held at AP Park

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
09/09/21	LS \$7000, 7 days. (Red \$18801.19, 73%)

Date/Time, File Pass to? : Prell. Report
 : Final Report
 1) 09/09 Typist

Days Of Repair: 7
 Resurvey No. of Trip: 2

Date/Time, File Return to? _____
 2) _____
 Rep. Format: MER-TP
 Lump Sum / L.R. / P. 7000

Add Fee: : Site Insp (\$ _____)
 : Interview (\$ _____)
 : Tech. Invs (\$ _____)
 : Weekend (\$ _____)

Survey Fee: _____
 Transportation: _____ \$ + RS. \$ _____
 Photos _____
 Others _____
 TOTAL _____

Estimation

Date _____
 Vehicle SLW 5617 A
 Make/Model HYUNDAI ELANTRA
 Chassis No. KMHD841CMJU630320

No.	Description	Unit	Unit Price	Amount
	Parts Replacment			
1	BONNET	1	\$ 1,925.50	\$ Ry 1,925.50
2	BONNET LOCK	1	\$ 141.30	\$ X un 141.30
3	BONNET LOCK CATCH	1	\$ 74.20	\$ X un 74.20
4	BONNET HINGE SET	2	\$ 68.70	\$ X un 137.40
5	HEADLAMP LH & RH	2	\$ 1198.10	\$ out 2396.20
6	HEADLAMP BRACKET LH	1		\$ un 34.00
7	FRONT BUMPER	1		\$ del 474.00
8	FRONT BUMPER FOG LAMP LH	1		\$ X Cra 265.00
9	FRONT BUMPER SIDE LAMP LH	1		\$ X Cra 174.00
10	FRONT BUMPER FOG LAMP GARNISH LH	1		\$ X un 1150.00
11	FRONT BUMPER INNER BRACKET LH	1		\$ X un 28.00
12	FRONT BUMPER RETAINER LH	1	\$ 65.10	\$ un 65.10
13	FRONT BUMPER REINFORCEMENT BAR	1	\$ 695.90	\$ X un 695.90
14	FRONT BUMPER BEAM	1		\$ X un -
15	FRONT BUMPER SPONGE	1	\$ 121.75	\$ un 121.75
16	FRONT BUMPER UNDERCOVER	1	\$ 289.80	\$ X un 289.80
17	FRONT FENDER L+R	2	RHXR. \$ 112.7	
18	FRONT FENDER COWLING L+R	2	85.70 each (171.40)	\$ LH-RH 351.30
19	FRONT SUPPORT PANEL	1	\$ 967.12	\$ X un 967.12
20	FRONT SUPPORT PANEL TOP GARNISH	1	\$ 86.25	\$ X un 86.25
21	WIPER WASHER TANK	1	\$ 151.87	\$ X un 151.87
22	A PILLAR LH	1		REPAIR
23	FRONT DOOR L+R	2	\$ 1,381.50	\$ Rx 2,763.00
24	FRONT DOOR SIDE MIRROR ASSY L+R	2	\$ 381.80	\$ LH-un 763.60
25	FRONT DOOR SIDE MIRROR COVER L+R	2	\$ 131.20	\$ LH-un RHX 262.40
26	FRONT DOOR LOCK LH	1	\$ 211.85	\$ X un 211.85
27	FRONT DOOR LOCK CATCH LH	1	\$ 42.50	\$ X un 42.50
28	FRONT DOOR WEATHERSTRIP LH	1	\$ 131.75	\$ X un 131.75
29	REAR DOOR L+R	2		REPAIR
30	REAR FENDER RH	1		REPAIR
31	REAR FENDER COWLING RH	1		REPAIR
32	TAIL LAMP RH	1	\$ 175.65	\$ X un 175.65
33	REAR BUMPER	1	\$ 1,094.70	\$ X un 1,094.70
34	REAR BUMPER RETAINER LH	1	\$ 810.90	\$ Ry 810.90
35	FRONT ABSORBER LH	1	\$ 72.95	\$ X un 72.95
36	FRONT LOWER ARM LH	1		\$ X un 372.00
37	FRONT KNUCKLE LH	1		\$ X un 215.00
				\$ bt 363.00

6099.35

17,059.9

38	FRONT KNUCKLE BEARING LH	1		\$ 7	195
39	FRONT BEARING HUB LH	1		\$ X	398.00 bt
40	FRONT RIM LH	1	\$ 691.50	\$ X	691.50
			Total	\$ 14,519.59	7,020.80
			Less 20%	\$	1,404.16
			Total	\$	5,616.64

5872.45
4697.96

7188.85
↓
5471.08

14,519.59

S/Nett Items					
1	FRONT BUMPER CLIPS	1	100	\$ 30.00	100.00
2	FRONT FENDER COWLING CLIPS	1	100	\$ 20.00	100.00
3	FRONT SUPPORT PANEL TOP GARNISH CLIPS	1	100	\$ X un	100.00
4	FRONT TYRE LH	1	800	\$ X un	800.00
			Total	\$	800.00

50

50

LABOUR					
1	PANEL BEATING ON AFFECTED AREAS	1	2800	\$ 1000	2,800.00
2	SPRAY PAINT ON AFFECTED AREAS	1	2600	\$ 1000	2,600.00
3	TO CHECK WIRING AND HEADLAMP FOCUS	1	150	\$ 30	150.00
4	TO CHECK WIRING AND FOG LAMP FUNCTION	1	150	\$ X un	150.00
5	TO CHECK WIRING AND SIDE LAMP FUNCTION	1	150	\$ X un	150.00
6	TO CHECK WIRING AND TAILLAMP FUNCTION	1	150	\$ X un	150.00
7	TO RNR FRONT DOOR SIDE MIRROR	1	300	\$ 40	300.00
8	TO RNR FRONT AND REAR DOOR MECHANISM	1	600	\$ X un	600.00
9	TO CHECK WHEEL ALIGNMENT AND ADJUST	1	250	\$ 80	250.00
10	TO RNR UNDERCARRIAGE	1	250	\$ 100 plus	250.00
11	TO CHECK WHEEL BALANCING	1	250	\$ 50	250.00
12	TO RNR INNER TRIM AND UPHOISTERY	1	400	\$ X un	400.00
13	TO CHECK WATER LEAK	1	150	\$ X un	150.00
14	TO PERFORM DIAGNOSTIC AND CLEAR FAULTS	1	600	\$ X un	600.00
15	TO PERFORM RUST PROOFING	1	400	\$ 50	400.00

1600

2950

Total Labour	\$	9,200.00
Parts Replacement Amount	\$	6,416.64
Total Amount	\$	15,616.64

2950

R = \$7161.85
20% = 15729.48
Q = \$60
L = 2950
P = 8429.48
-20% = 6800

Tauphin 17495749
WP' 2/2/21 @ 530pm
1/3 Resumy after repair
7 days
tauphin@lkhauto.com

24,519.59
4697.96
50
2950
8751.08
7697.96
↓
4586150
7 days #