

PROFORMA INVOICE



ATTENTION:
Secured Delivery

PI Number	P2011-1159
PI Date	27-Nov-2020
Vehicle No.	GBK 2901E
Accident Date	27-Oct-2020

S/No	Description	Unit Price	Quantity	Amount
1	Spare Parts and Labour for Accident Repair of Vehicle Nos. GBK 2901E	COR Lump Sum		\$ 7,100.00

Notes:

1) All payments must be made only in the form of cash or crossed cheque payable to "Team AutoPro Pte Ltd".

Total Amount	\$ 7,100.00
--------------	-------------

Authorized Signature



Invoice

To: Secured Delivery

Invoice No: 2020/INV/0163

CC: Team Autopro Pte Ltd

Your Reference:

160 Sin Ming Drive #02-12

Our Reference: 2020/0193

Sin Ming Auto City

Date: 16/11/2020

Singapore 575722

Description	Amount S\$
Particulars	
Vehicle No: GBK2901E	
Accident Date : 27/10/2020	
Date of Inspection: 28/10/2020	
Service:	
Assessment with report (inclusive of photographs and transport charges etc)	\$710
Total Amount:	\$710

Payment Details:

- 1) Cheque: Kindly make all cheques crossed and payable to **PRECISE APPRAISER PTE LTD**
- 2) Online Banking: **Maybank 041-9107653-9**



Precise Appraiser Pte Ltd

To: Secured Delivery

CC: Team Autopro Pte Ltd
160 Sin Ming Drive #02-12
Sin Ming Auto City
Singapore 575722

REFERENCES

Ref No	: 2020/0193	Date of Report	: 28/10/2020
Claim Type	: Third Party	Date of Request	: 28/10/2020
Third party vehicle	: GBK2901E	Date of Accident	: 27/10/2020
Insured Vehicle	:	Date of Inspection	: 28/10/2020
Your Reference No	: -		

DAMAGED VEHICAL PARTICULARS

Registration Plate No	: GBK2901E	Engine Modification	: NIL
Model / Make	: Nissan NV200	Pre-accident damage	: NIL
Colour	: Black	General Condition	: Good
Manufacturing Year	: 2019	General Paint Work	: Good
Engine No	: HR16159142D	Steering	: Serviceable
Engine Capacity	: 1600cc	Handbrake	: Serviceable
Chassis No	: VM20141252	Footbrake	: Serviceable
Odometer No	: 25216		
Transmission	: Manual		

TYRES CONDITION

Front Right		Rear Left	
Make	: Toyo	Make	: Toyo
Size	: 165/80 r14 4	Size	: 165/80 r14 4
Front Left		Rear Right	
Make	: Toyo	Make	: Toyo
Size	: 165/80 r14 4	Size	: 165/80 r14 4

The above millimetres represent the remaining life of tyre treads

VEHICAL REPAIR COST

<u>Descriptions</u>	<u>Repairer (S\$)</u>	<u>Difference (S\$)</u>	<u>Adjuster (S\$)</u>
Parts	8,497.79		5,995.04
Labour	4,300.00		2,860.00
Calculated Cost (S\$) :	12,797.79	3,942.75	8,855.04




Recommended Lump Sum Repair Cost (S\$)	: <u>7,100.00</u>
Estimate Repair Duration	: 8
Survey Inspection At	: Team Autopro Pte Ltd
Survey Inspection Address	: 160 Sin Ming Drive #02-12 Sin Ming Auto City Singapore 575722

DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **Rear Portion**.

Rear bumper, tailgate, rear rh fenders, rear end panel, floor board dented. Taillamp grazed/ crack, rear windscreen glass shattered etc.

Please see attached scheduled details.

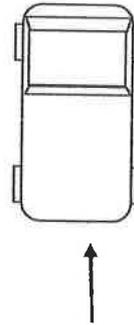

SPECIAL REMARKS

We have not authorised repair. Under normal circumstances, estimated **8** working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



Anthony
Automotive Appraiser
MSAAA

Disclaimer:

This survey was conducted by Precise Appraiser Pte Ltd without prejudice basis and we do not authorized repair. Report by Precise Appraiser Pte Ltd is deemed as confidential and provided for the use of clients and appointed agent. *We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle.* All findings and recommendations are listed accordingly and final decision of settlement to your good selves parts thereof accordingly and final. No liability shall be attached to Precise Appraiser Pte Ltd therefore.

Our Reference : 2020/0193

Your Reference:

Vehicle Number : GBK2901E

S/N	Qty	Description	Condition	Repairer Estimate (S\$)	Our Assessment (S\$)
		Parts			
1	1pcs	Tailgate	Dented	1,658.90	1,658.90
2	1pcs	Tailgate logo	Necessary	57.80	57.80
3	1pcs	Tailgate emblem 'NV200'	Necessary	66.40	66.40
4	1pcs	Tailgate emblem 'VANETTE'	Necessary	45.30	45.30
5	1pcs	Tailgate outer garnish	Holder Torn	194.50	194.50
6	1pcs	Tailgate inner lock	Dented	118.60	118.60
7	1pcs	Tailgate inner lock sticker	Serviceable	54.00	-
8	1pcs	Tailgate inner trim board	Serviceable	125.40	-
9	1pcs	Tailgate weatherstrip	Kinded	126.70	126.70
10	1pcs	Tailgate windscreen	Shattered	754.60	754.60
11	1pcs	Tailgate windscreen moulding	Necessary	198.60	198.60
12	1pcs	Rear bumper	Dented	483.80	483.80
13	2pcs	Rear bumper side bracket @79.2/pcs	Torn	158.40	158.40
14	1pcs	Rear bumper inner sponge	Crack	113.40	113.40
15	1pcs	Rear end panel	Dented	485.20	485.20
16	1pcs	Rear end panel top garnish	Deformed	96.20	96.20
17	1pcs	Rear body panel RH	Repair	1,472.30	-
18	1pcs	Rear body panel glass moulding RH	Serviceable	145.80	-
19	2pcs	Taillamp @398.6/pcs	Base Crack	797.20	797.20

Total	7,153.10	5,355.60
Less 10%	715.31	535.56
Parts Sub Total	6,437.79	4,820.04

Special Nett

20	1set	Sundries	Necessary	80.00	50.00
21	1set	Tailgate sealant	Necessary	100.00	60.00
22	1set	Tailgate outer garnish clips	Necessary	50.00	30.00
23	1set	Tailgate inner trim board clips	Necessary	50.00	30.00
24	1set	Tailgate windscreen sealant	Necessary	100.00	80.00
25	1set	Tailgate windscreen inner seal	Necessary	60.00	40.00
26	1pcs	Tailgate windscreen primer & cleaner	Necessary	80.00	50.00
27	1pcs	Tailgate windscreen solar film	Necessary	280.00	280.00
28	1pcs	Tailgate sticker '70km/h'	Necessary	40.00	25.00
29	1pcs	Tailgate sticker 'HELLO KITTY'	Necessary	40.00	30.00
30	1pcs	Tailgate spoiler sealant	Necessary	60.00	40.00
31	1set	Rear bumper clips	Necessary	50.00	30.00
32	1pcs	Rear end panel sealant	Necessary	100.00	60.00
33	1pcs	Rear end panel top garnish clips	Necessary	50.00	20.00
34	1pcs	Rear body panel sealant	Serviceable	100.00	-
35	1pcs	Rear body panel glass sealant	Serviceable	100.00	-
36	1pcs	Rear body panel glass inner seal	Serviceable	60.00	-
37	1set	Rear body panel glass primer & cleaner	Serviceable	80.00	-
38	1pcs	Rear number plate w/casing	Necessary	80.00	50.00
39	1set	Reverse sensor	Dented	500.00	300.00

Total	2,060.00	1,175.00
--------------	----------	----------

Labour			
1	R&R tailgate component	150.00	80.00
2	R&R tailgate windscreen	250.00	150.00
3	R&R reverse sensor	100.00	80.00
4	Check wiring	100.00	50.00
5	Upholstery	300.00	200.00
6	Panel beat	1,600.00	1,000.00
7	Spray painting	1,600.00	1,200.00
8	Rust proofing	200.00	100.00
	Labour Total	4,300.00	2,860.00
	Sub Total (labour and parts)	12,797.79	8,855.04

Adjustment / Recommendations

Note: For Lump Sum Repair

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or use of ex-stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements).


The final adjusted Lump Sum contract amount is **S\$7,100..**

Under normal circumstances, the repair period would be about **8** working days.



INSPECTION PHOTOS




INSPECTION PHOTOS

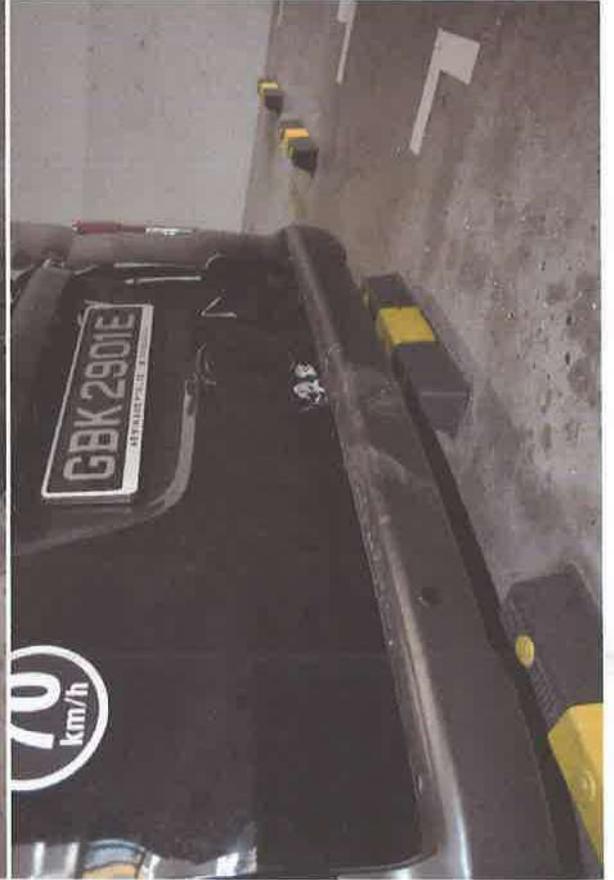


INSPECTION PHOTOS

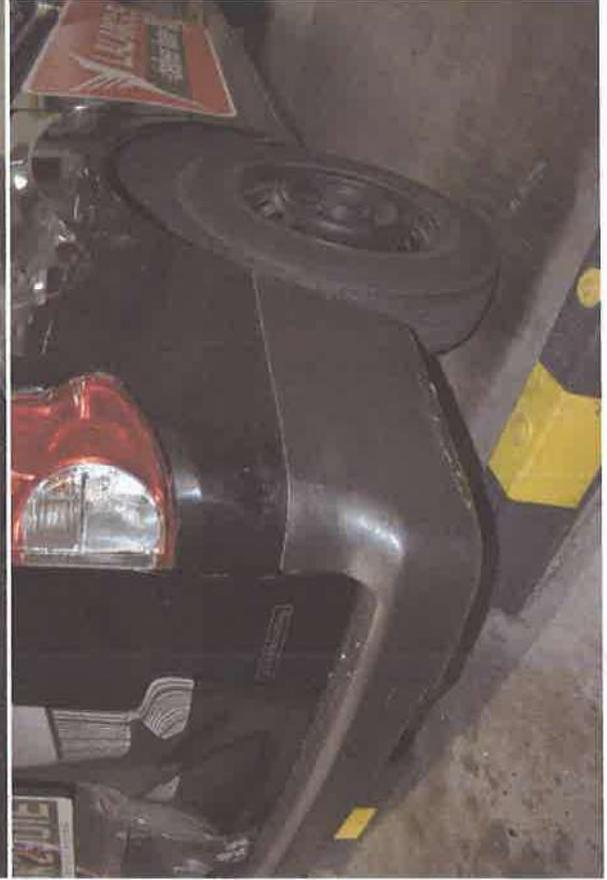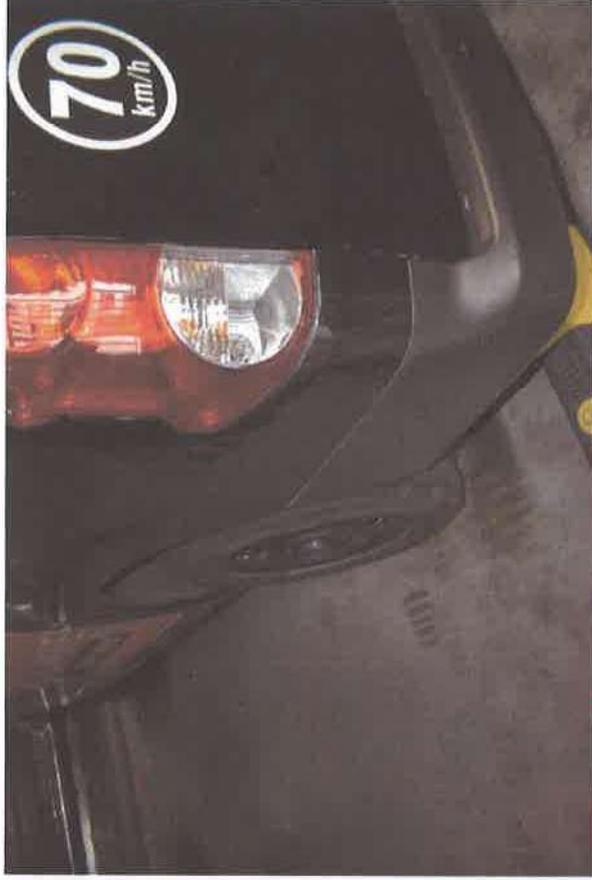

INSPECTION PHOTOS

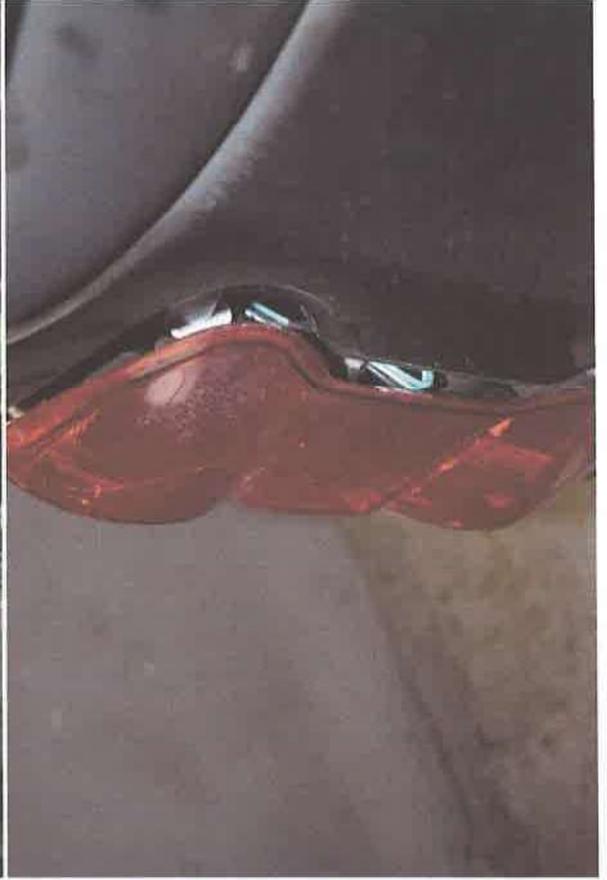

INSPECTION PHOTOS



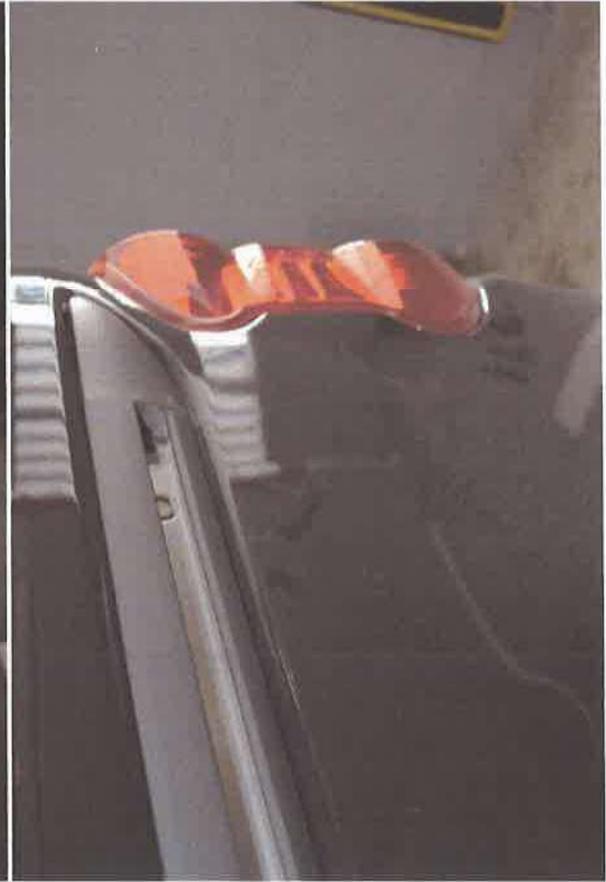


Our Ref: 2020/0193
Vehicle No.: GBK2901E


INSPECTION PHOTOS






RE-INSPECTION PHOTOS

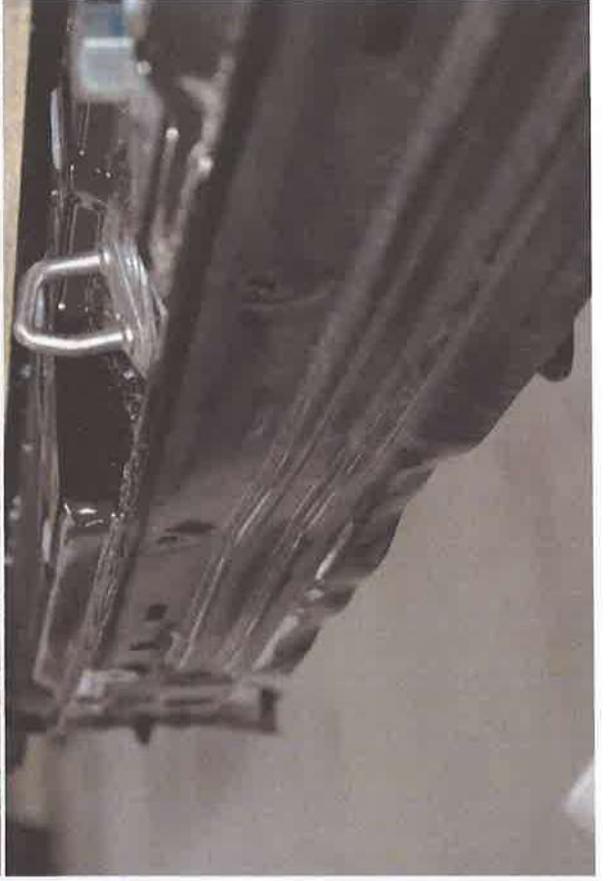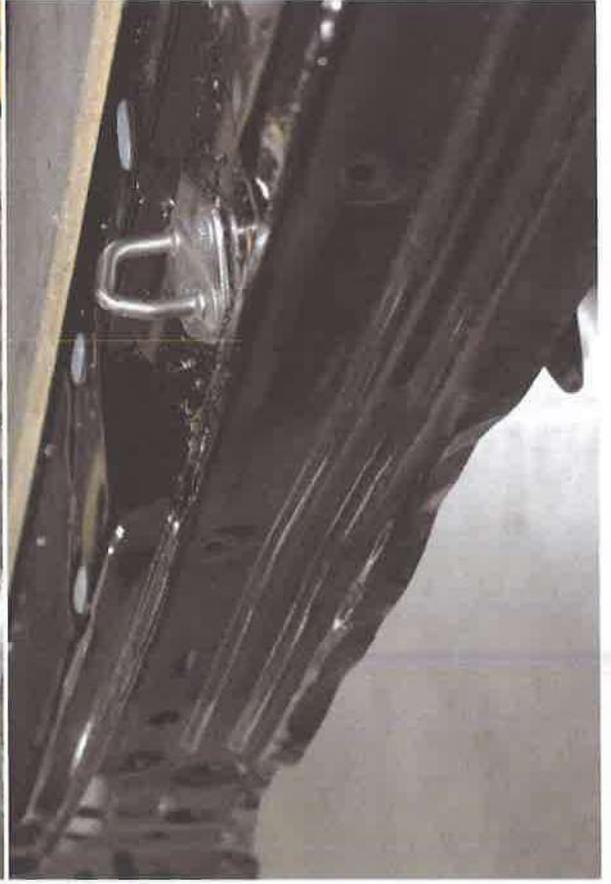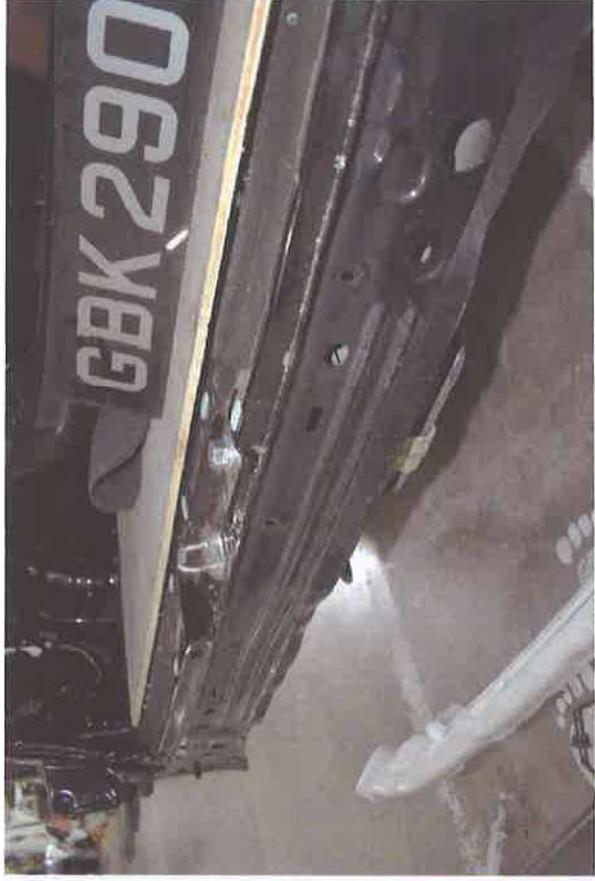



RE-INSPECTION PHOTOS

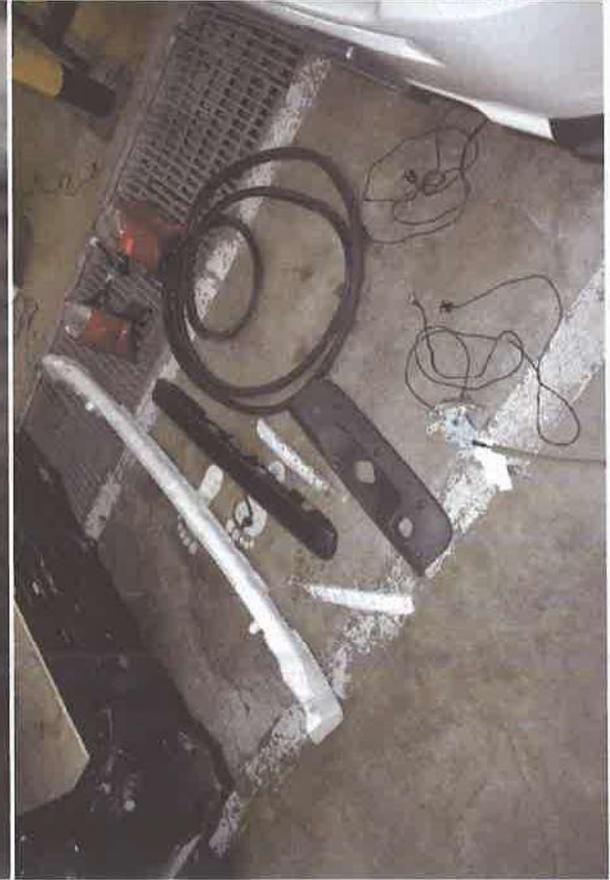



RE-INSPECTION PHOTOS

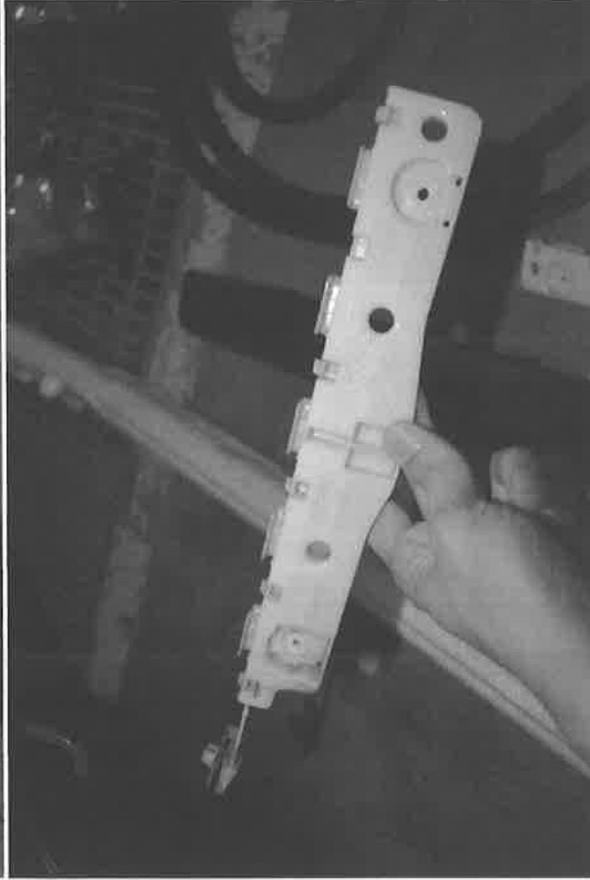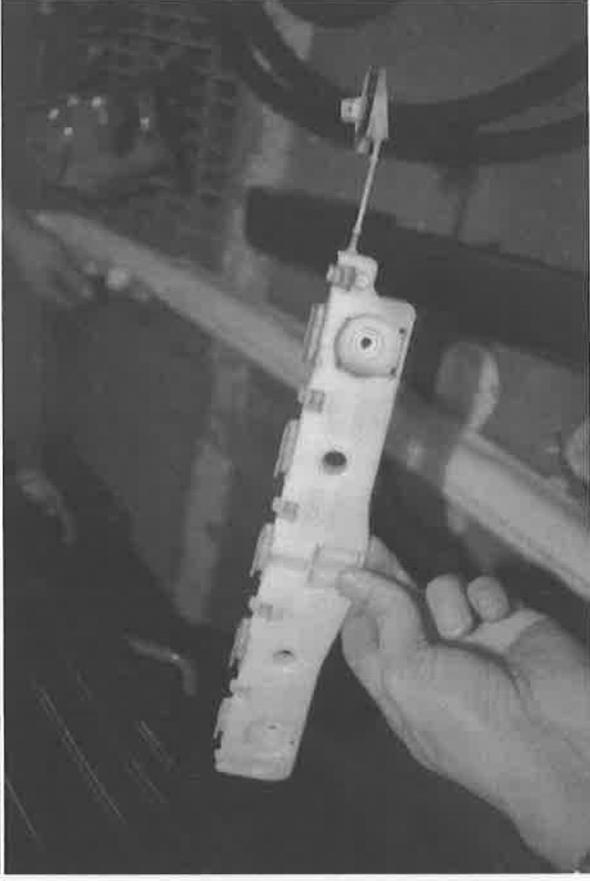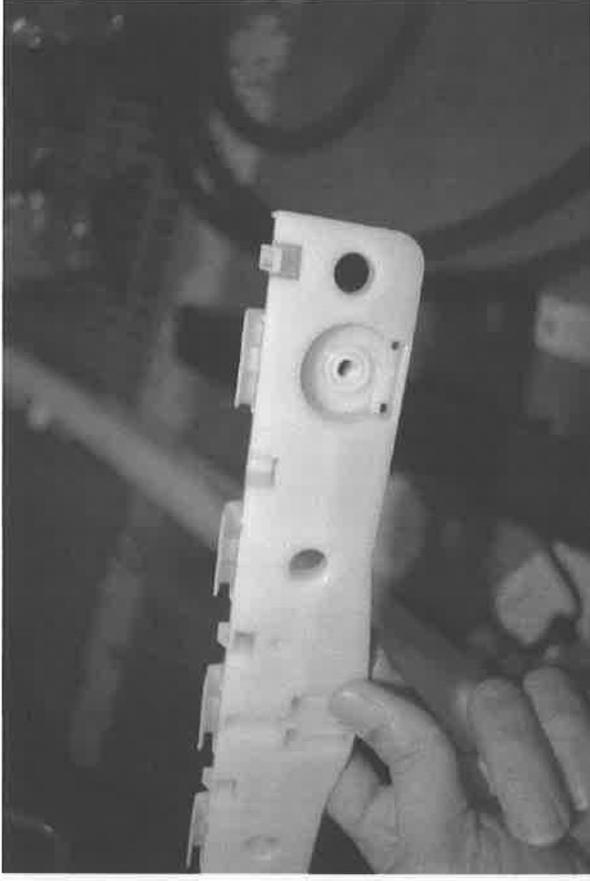



RE-INSPECTION PHOTOS

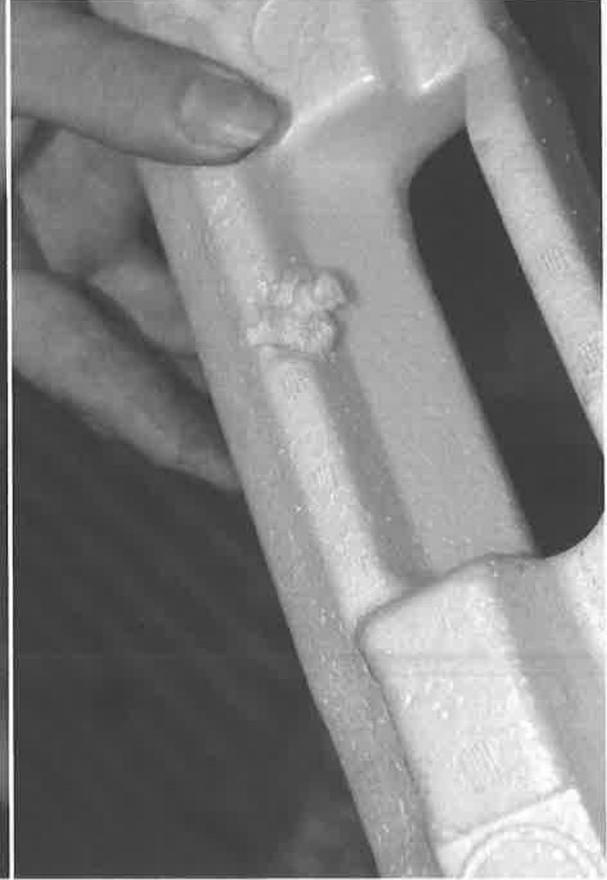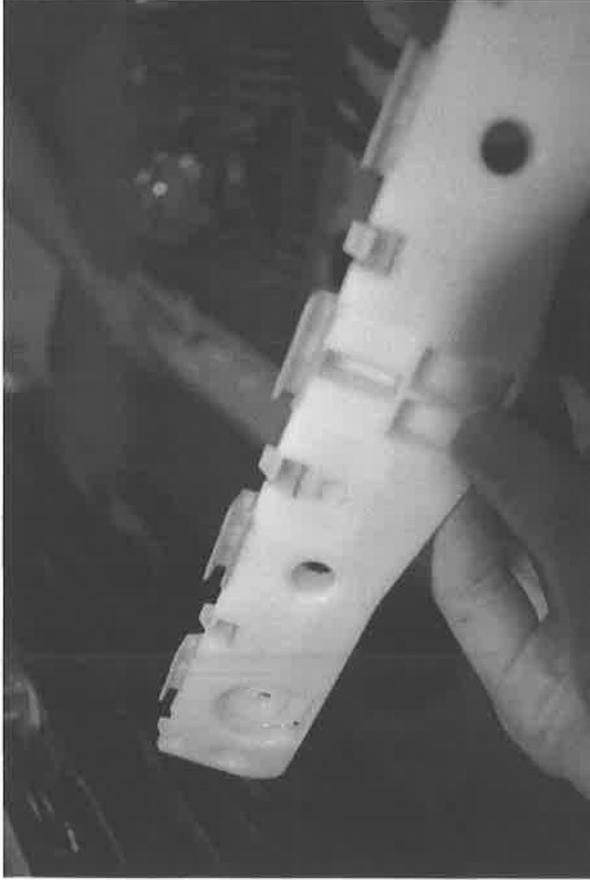

RE-INSPECTION PHOTOS

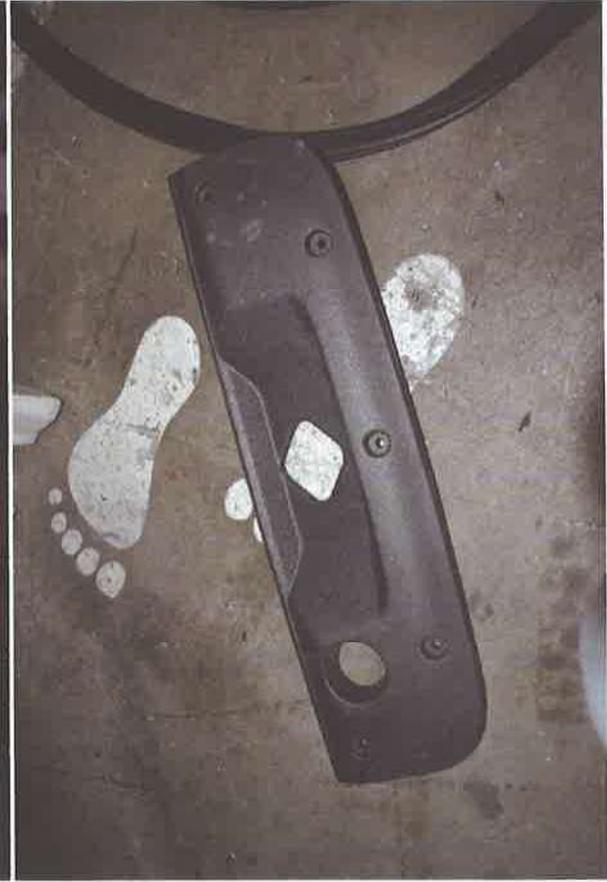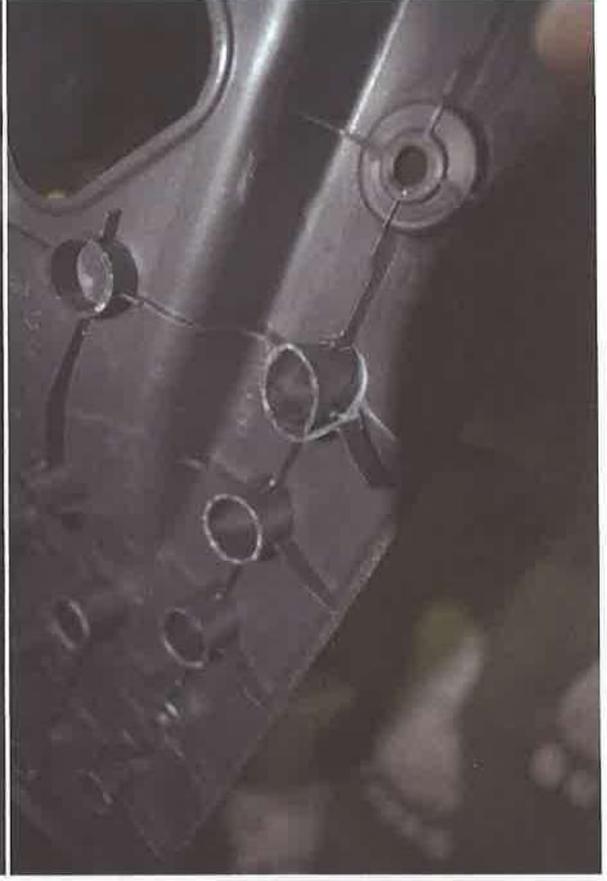


RE-INSPECTION PHOTOS

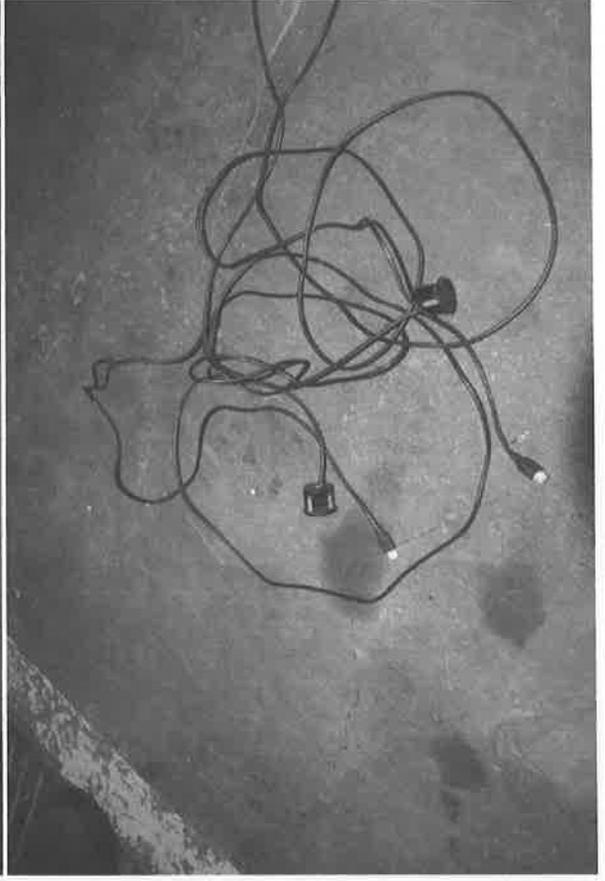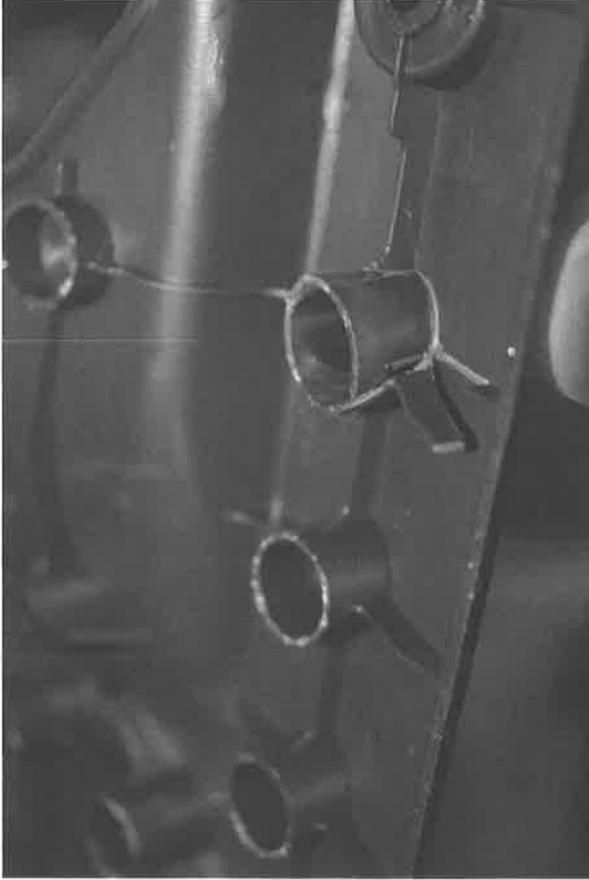

RE-INSPECTION PHOTOS



RE-INSPECTION PHOTOS


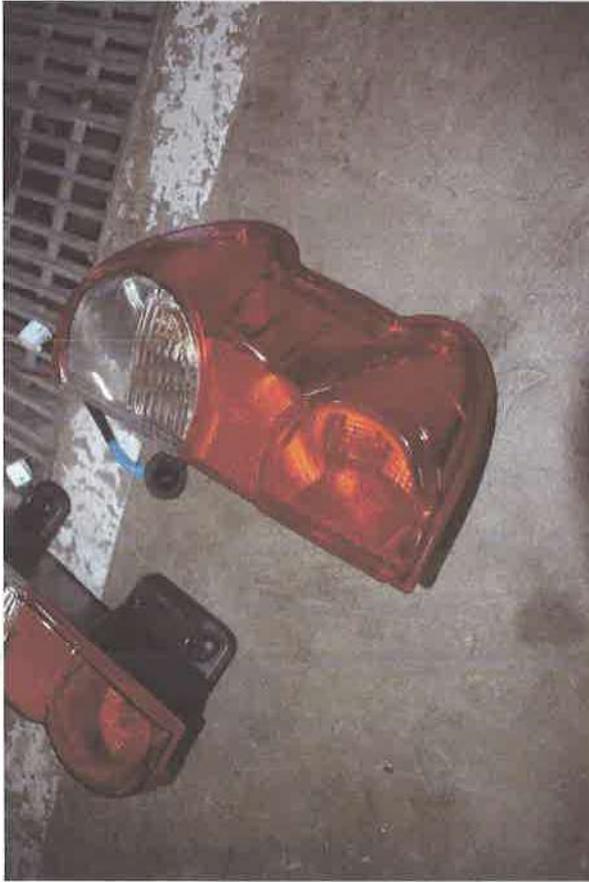


RE-INSPECTION PHOTOS



Our Ref: 2020/0193
Vehicle No.: GBK2901E

RE-INSPECTION PHOTOS

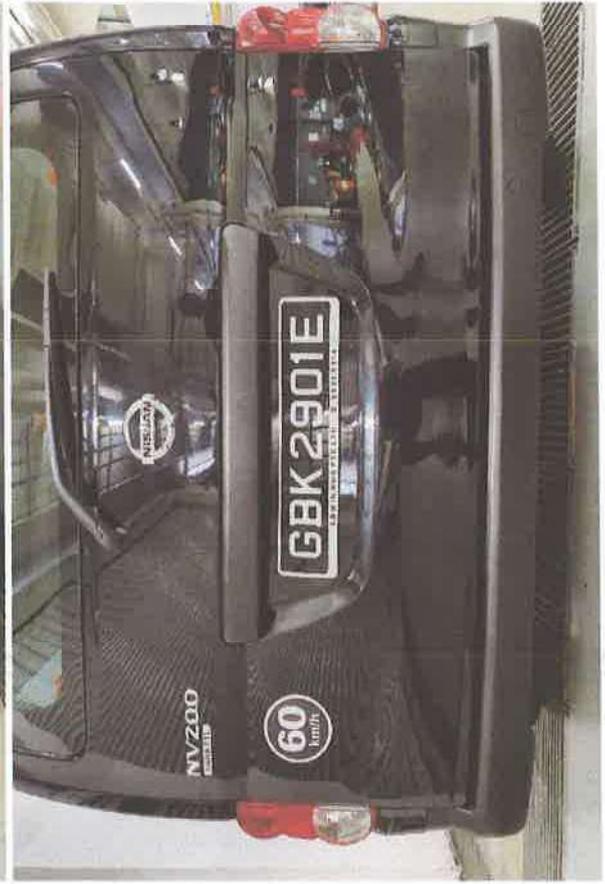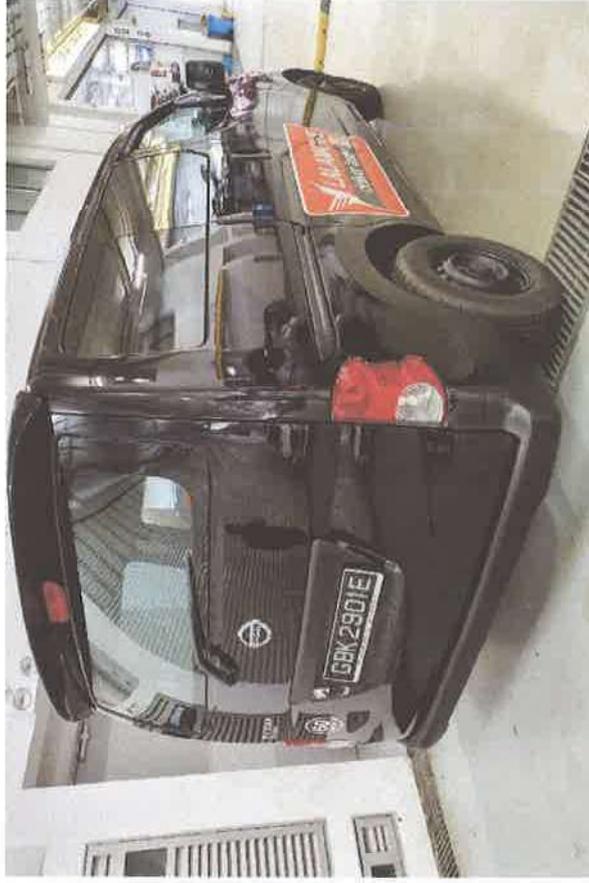

Enquire Vehicle Owner Details

Enquire Vehicle Owner Details (As At 27 Oct 2020 / 19:38:00)

Vehicle Owner Details

Owner ID Type:

Singapore NRIC

Owner ID:

S9214025C

Owner Name:

MUHAMMAD ARSHAD BIN YUSOPE

Registered Address Type:

HDB / HUDC

Registered Block/House No.:

910

Registered Street Name:

TAMPINES STREET 91

Registered Unit No.:

02 - 129

Registered Building Name:

-

Registered Postal Code:

520910

Vehicle Insurance Details

Vehicle No.:

FBA9656U

Make Description/Model:

HONDA / CB400

Insurance Company Name:

SOMPO INSURANCE SINGAPORE PTE. LTD.