


06/07/2002044 (Aed 3)

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)
 Remark: The veh had commenced its
 repair at the time of inspection.

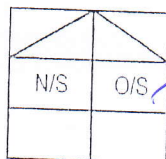

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 6 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SGB9023G Yr Regn: 2005 Dec
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or

Make: Toyota Wish C.C. 1794
 Colour: Blue A/C: Insured / Std / NI / NA
 Sp. Reading: 320512 T/Radio: Insured / Std / NI / NA

Eng/No: _____
 C/No: ZNE 100272351

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16
 R: 205/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

Front		Rear
R/Bal. <u>db</u>	mm	R/Bal. <u>db</u>
L/Bal. <u>db</u>	mm	L/Bal. <u>db</u>
D.O.A.		D.O.I. <u>09/02/21</u>

*Survey held at Adunwa

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

COE Expiry: 30/12/25

Date / Time Action / Instruction

TP Chua

MV: 341C
 PV: 2931C 29,239
 Nett: 47K 4,761

Date/Time, File Pass to?

☐ : Preli. Report
☐ : Final Report

Days Of Repair:

Resurvey No. of Trip:

Artd Fee: ☐ : Site Insp (\$) ☐
☐ : Interview (\$) ☐
☐ : Tech. Insp (\$) ☐
☐ : Material (\$) ☐

Survey Fee:

Transportation:

3 + PS \$1

Photo:

Other:

D-201

Report Format:

Temp. Sum / UP. In:

2044 (Ae)

ADVANCE AUTO GARAGE

10 KAKI BUKIT ROAD 2 #01-21 FIRST EAST CENTRE

SINGAPORE 417868

TEL: 90079247

TO	: CHINA TAIPING	DATE	: 9/2/2021
ATTENTION	: MOTOR INSURANCE CLAIM	JOB TYPE	: T/P CLAIM
ESTIMATE REPORT	:		
VEHICLE DETAILS			
VEHICLE NO	: SGB9023G		
VEHICLE MODEL	: TOYOTA WISH		Asker
CHASSIS NO	: ZNE100272351		
ACCIDENT DETAILS	DATE	:	
	TIME	:	
THIRD PARTY REQUESTOR / CONTACT	:	XAVIER / 90079247	

CLAIM DETAILS: PARTS

	ITEMS	QTY	UNIT PRICE	TOTAL
1	REAR BUMPER <i>Del'd</i>	1	\$ 492.50	\$ 492.50
2	REAR BUMPER SIDE HOLDER <i>pr</i>	2	\$ 58.10	\$ 116.20
3	REAR BUMPER IMPACT BRACKET <i>3 M new</i>	2	\$ 68.40	\$ 136.80
4	REAR BUMPER REFLECTOR	2	\$ 83.10	\$ 166.20
5	REAR END PANEL <i>Del'd</i>	1	\$ 581.10	\$ 581.10
6	REAR END PANEL INNER <i>Repair</i>	1	\$ 213.00	\$ 213.00
7	REAR END PANEL TOP GARNISH <i>Del'd</i>	1	\$ 326.20	\$ 326.20
8	TAILLAMP <i>Cracked</i>	2	\$ 417.90	\$ 835.80
9	TAILLAMP LOWER BRACKET <i>new</i>	2	\$ 42.50	\$ 85.00
10	TAILGATE <i>Del'd</i>	1	\$ 1,272.90	\$ 1,272.90
11	TAILGATE LOCK <i>Del'd</i>	1	\$ 497.00	\$ 497.00
12	TAILGATE WEATHERSTRIPE <i>lt</i>	1	\$ 276.10	\$ 276.10
13	TAILGATE OUTER CHROME MOULDING <i>new</i>	1	\$ 383.80	\$ 383.80
14	TAILGATE INNER TRIM BOARD <i>Cracked</i>	1	\$ 485.50	\$ 485.50
15	TAILGATE GLASS MOULDING <i>3 per</i>	1	\$ 140.60	\$ 140.60
16	TOYOTA LOGO	1	\$ 74.10	\$ 74.10
17	REAR FENDER INNER TRIM BOARD <i>new</i>	2	\$ 692.40	\$ 1,384.80
18	FLOOR PANEL TOP COVER <i>new</i>	1	\$ 535.70	\$ 535.70
19	REAR EXHAUST PIPE <i>new</i>	1	\$ 971.10	\$ 971.10
20	REAR EXHAUST PIPE MOUNTING <i>new</i>	1	\$ 28.50	\$ 28.50

TOTAL PRICE: \$ 9,002.90

LESS 25% \$ 2,250.72

SUB TOTAL PRICE: \$ 6,752.18

3098

3823-50

SPECIAL NETT ITEMS

	ITEMS	QTY	UNIT PRICE	TOTAL
1	REAR NUMBER PLATE <i>3 Not</i>	1	\$ 30.00	\$ 30.00
2	REAR NUMBER PLATE HOLDER <i>rw</i>	1	\$ 30.00	\$ 30.00
3	REAR BUMPER CLIPS <i>rw</i>	1 SET	\$ 50.00	\$ 50.00
4	REAR END PANEL TOP GARNISH CLIPS <i>rw</i>	1 SET	\$ 20.00	\$ 20.00
5	REAR END PANEL SEALANT <i>rw</i>	1 SET	\$ 60.00	\$ 60.00
6	REVERSE SENSOR <i>Don't</i>	1 SET	\$ 280.00	\$ 280.00
7	TAILLAMP SPONGE GASKET <i>rw</i>	2	\$ 20.00	\$ 40.00
8	TAILGATE OUTER CHROME MOULDING CLIPS <i>new</i>	1 SET	\$ 20.00	\$ 20.00
9	TAILGATE INNER TRIM BOARD CLIPS <i>rw</i>	1 SET	\$ 50.00	\$ 50.00
10	REAR FENDER INNER TRIM BOARD CLIPS <i>new</i>	2 SETS	\$ 30.00	\$ 60.00

11 Tailgate Glass Sealant *rw* 60. ✓ TOTAL : \$ 640.00

440

LABOUR

	JOB	PRICE	ADJUSTED COST	APPROVED
1	PANEL BEATING, REMOVE AND REFIT PARTS	\$ 1,200.00	<i>820</i>	
2	SPRAY PAINTING TO AFFECTED AREA	\$ 1,200.00	<i>820</i>	
3	WIRING CHECK	\$ 50.00	<i>30</i>	
4	TO APPLY TUFF COAT	\$ 150.00	<i>60</i>	
5	TO REMOVE REVERSE SENSOR	\$ 100.00	<i>50</i>	
6	TO REMOVE REAR CAMERA	\$ 100.00	<i>50</i>	
7	TO REMOVE UPHOLSTERY	\$ 150.00	<i>60</i>	
8	TO TRANSFER TAILGATE FITTINGS	\$ 150.00	<i>80</i>	
9	TO REMOVE TAILGATE GLASS	\$ 180.00	<i>120</i>	
10	TO REMOVE EXHAUST PIPE	\$ 150.00	<i>x</i>	

TOTAL: \$ 3,430.00

2050

ESTIMATE REPORT

TOTAL PARTS COST: \$ 7,392.18

TOTAL LABOUR COST: \$ 3,430.00

TOTAL REPAIR COST: \$ 10,822.18

total: 6313-50

L/S 4.7K (Nett Value)

06 Days

APPROVED DETAILS

SURVEYOR:

CONTACT:

FAX:

PART BY PART / LUMP SUM:

NO. OF DAYS:

4.7K

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer