



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

QBE INSURANCE (SINGAPORE) PTE LTD

INV No. AC2103231

1 RAFFLES QUAY #29-10 SOUTH TOWER  
SINGAPORE 048583

INV Date 10/05/2021  
Reference CC6/QBE21002093/Ues3q2  
Code QBE

### PROFESSIONAL SERVICE FEE

Vehicle No. GBE 9363T  
Insured Veh. SGC 1139D  
Claim No. VC014328  
Policy No. 8-V0020619-MVA-R001  
Accident Date 11/02/2021  
Inspection Date 15/02/2021

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (7%)</b>                | <b>28.00</b>  |
| <b>Grand Total</b>             | <b>428.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                      |                                                                                           |                 |                             |  |
|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------|-----------------|-----------------------------|--|
| QBE INSURANCE (SINGAPORE) PTE LTD<br>1 RAFFLES QUAY #29-10 SOUTH<br>TOWERSINGAPORE 048583                                              |                                                                                           |                 | Ref: CC6/QBE21002093/Ues3q2 |  |
|                                                                                                                                        |                                                                                           |                 | Date: 10/05/2021            |  |
|                                                                                                                                        |                                                                                           |                 | Code: QBE                   |  |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                      |                                                                                           |                 |                             |  |
| Insured Veh.                                                                                                                           | SGC 1139D                                                                                 | Veh. Inspected  | GBE 9363T                   |  |
| Policy No.                                                                                                                             | 8-V0020619-MVA-R001                                                                       | Coverage (\$)   | 0.00                        |  |
| Claim No.                                                                                                                              | VC014328                                                                                  | Excess (\$)     | 0.00                        |  |
| Assign From                                                                                                                            |                                                                                           | Assign Date     | 15/02/2021                  |  |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                          |                                                                                           |                 |                             |  |
| Make & Model                                                                                                                           | NISSAN NV200 (M)                                                                          | c.c             | 1461                        |  |
| Engine No.                                                                                                                             | HIDDEN                                                                                    | Year of Reg.    | 2016                        |  |
| Chassis No.                                                                                                                            | VSKYBAM20Z0124732                                                                         | Colour          | SILVER                      |  |
| Odometer                                                                                                                               | 156843 KM                                                                                 | Steering        | IN ORDER                    |  |
| Brakes                                                                                                                                 | IN ORDER                                                                                  | Modification    | NIL                         |  |
| General                                                                                                                                | FAIR                                                                                      |                 |                             |  |
| <b>3. Conditions of Tyres</b>                                                                                                          |                                                                                           |                 |                             |  |
|                                                                                                                                        | Size                                                                                      | Make            | Balance                     |  |
| R/H Front Tyre                                                                                                                         | 175/70 R14                                                                                | YOKOHAMA        | 6 mm                        |  |
| L/H Front Tyre                                                                                                                         | 175/70 R14                                                                                | YOKOHAMA        | 6 mm                        |  |
| R/H Rear Tyre                                                                                                                          | 175/70 R14                                                                                | YOKOHAMA        | 6 mm                        |  |
| L/H Rear Tyre                                                                                                                          | 175/70 R14                                                                                | YOKOHAMA        | 6 mm                        |  |
| <b>4. Description of Damages</b>                                                                                                       |                                                                                           |                 |                             |  |
| THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION.<br><br>DAMAGES SEE DETAILS.                                                 |                                                                                           |                 |                             |  |
| <b>5. General Information</b>                                                                                                          |                                                                                           |                 |                             |  |
| Accident Date                                                                                                                          | 11/02/2021                                                                                | Inspection Date | 15/02/2021                  |  |
| Survey held at                                                                                                                         | FASTECH AUTO PTE LTD<br>1 KAKI BUKIT AVENUE 6<br>#01-46/48/50 AUTOBAY<br>SINGAPORE 417883 |                 |                             |  |
| <b>5a. Remarks</b>                                                                                                                     |                                                                                           |                 |                             |  |
| A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                           |                 |                             |  |
| <b>5b. Estimate Days of Repair</b>                                                                                                     |                                                                                           |                 |                             |  |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                           |                 | <b>13 Working Days</b>      |  |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 9363T

| Qty | Description of Parts                      | Condition                | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|-------------------------------------------|--------------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b>        |                          |                           |                   |
| 1   | REAR TAILGATE N/S                         | BADLY DENTED             | 1,655.90                  | 1,336.00          |
| 1   | REAR TAILGATE GLASS N/S                   | CRACKED                  | 850.00                    | 792.00            |
| 1   | REAR TAILGATE O/S                         | BADLY DENTED             | 1,200.90                  | 910.90            |
| 1   | REAR TAILGATE GLASS O/S                   | DEEP CUT                 | 820.00                    | 650.00            |
| 2   | REAR TAILGATE TOP HINGES @\$145.00        | NOT NECESSARY            | 290.00                    | -                 |
| 2   | REAR TAILGATE BOTTOM HINGES @\$145.00     | NOT NECESSARY            | 290.00                    | -                 |
| 1   | REAR TAILGATE CENTRE RUBBER               | TORN                     | 101.00                    | 88.40             |
| 1   | REAR TAILGATE FRAME RUBBER                | DISTORTED                | 188.20                    | 188.20            |
| 2   | REAR TAILGATE TOP LOCKS @\$155.00         | NOT NECESSARY            | 310.00                    | -                 |
| 2   | REAR TAILGATE TOP LOCK CATCHS @\$65.00    | NOT NECESSARY            | 130.00                    | -                 |
| 2   | REAR TAILGATE BOTTOM LOCKS @\$150.00      | TWISTED                  | 300.00                    | 300.00            |
| 2   | REAR TAILGATE BOTTOM LOCK CATCHS @\$65.00 | TWISTED                  | 130.00                    | 130.00            |
| 1   | REAR TAILGATE INNER TRIM N/S              | DEFORMED /TORN           | 488.20                    | 282.00            |
| 1   | REAR TAILGATE INNER TRIM O/S              | DEFORMED / TORN          | 388.20                    | 245.00            |
| 1   | TAILGATE OUTER HANDLE N/S                 | BENT / CRACKED           | 299.00                    | 299.00            |
| 1   | TAILGATE REAR LOGO                        | NECESSARY                | 105.00                    | 79.90             |
| 1   | TAILGATE 'NV200' EMBLEM                   | NECESSARY                | 82.00                     | 82.00             |
| 1   | TAILGATE 'DCI' EMBLEM                     | NECESSARY                | 50.00                     | 50.00             |
| 2   | TAILLAMPS @\$350.00                       | CRACKED                  | 700.00                    | 608.00            |
| 2   | TAILLAMP HOUSING PANELS @\$485.00         | TO REPAIR SEE LABOUR     | 970.00                    | -                 |
| 1   | REAR BODY WEATHERSTRIP                    | TWISTED                  | 211.00                    | 211.00            |
| 1   | REAR BUMPER                               | DISTORTED                | 624.90                    | 624.90            |
| 2   | REAR BUMPER REFLECTORS @\$75.00           | N/S BROKEN / O/S CRACKED | 150.00                    | 122.00            |
| 1   | REAR BUMPER TOW COVER                     | NOT NECESSARY            | 28.00                     | -                 |
| 1   | REAR BUMPER SPONGE                        | TORN                     | 128.00                    | 128.00            |
| 2   | REAR BUMPER SIDE RETAINERS @\$55.00       | N/S BENT                 | 110.00                    | 42.90             |
| 1   | REAR END PANEL                            | BADLY DENTED             | 366.00                    | 212.40            |
| 1   | REAR END PANEL INNER MEMBER               | BADLY DENTED             | 610.80                    | 610.80            |
| 1   | REAR END PANEL TOP GARNISH                | DISTORTED                | 122.90                    | 122.90            |

Report Ref No. CC6/QBE21002093/Ues3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

| Qty | Description of Parts                     | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------------|----------------------|---------------------------|-------------------|
| 1   | REAR FLOOR PANEL                         | CRUMPLED / BUCKLED   | 2,100.20                  | 1,374.50          |
| 1   | REAR SPARE WHEEL CARRIER                 | SERVICEABLE          | 366.90                    | -                 |
| 1   | REAR SPARE WHEEL CARRIER BOLT            | NOT NECESSARY        | 105.00                    | -                 |
| 2   | REAR FENDERS @\$1850.00                  | TO REPAIR SEE LABOUR | 3,700.00                  | -                 |
| 2   | REAR FENDER INNER GARNISHS @\$250.00     | NOT NECESSARY        | 500.00                    | -                 |
| 2   | TAILLAMP INNER SIDE PANELS @\$295.00     | TO REPAIR SEE LABOUR | 590.00                    | -                 |
| 1   | REAR EXHAUST                             | NOT NECESSARY        | 482.50                    | -                 |
| 1   | REAR EXHAUST MOUNTING                    | NOT NECESSARY        | 45.00                     | -                 |
| 1   | BONNET                                   | BUCKLED              | 1,002.20                  | 1,002.20          |
| 2   | BONNET HINFES @\$103.00                  | BENT                 | 206.00                    | 130.40            |
| 1   | BONNET INNER INSULATOR                   | NOT NECESSARY        | 218.20                    | -                 |
| 1   | BONNET LOCK                              | TWISTED              | 199.80                    | 65.30             |
| 1   | FRONT GRILLE                             | CRACKED              | 650.50                    | 303.30            |
| 1   | FRONT GRILLE LOGO                        | NECESSARY            | 105.00                    | 64.90             |
| 1   | FRONT BUMPER                             | DISTORTED            | 855.20                    | 541.50            |
| 1   | FRONT BUMPER REINFORCEMENT               | BENT                 | 611.10                    | 611.10            |
| 2   | FRONT BUMPER BRACKETS @\$145.00          | NO SUCH PARTS        | 290.00                    | -                 |
| 1   | FRONT BUMPER SPONGE                      | TORN                 | 188.90                    | 188.90            |
| 2   | FRONT BUMPER SIDE RETAINERS @\$65.00     | BENT                 | 130.00                    | 90.00             |
| 2   | FRONT BUMPER TOP SIDE GARNISHS @\$450.00 | TORN                 | 900.00                    | 723.00            |
| 2   | FRONT BUMPER FOG LAMPS @\$350.00         | N/S CRACKED          | 700.00                    | 327.00            |
| 1   | INTER COOLER                             | PUNCTURE / CRACKED   | 2,520.00                  | 2,121.60          |
| 1   | INTER COOLER GARNISH                     | NOT NECESSARY        | 88.90                     | -                 |
| 1   | FRONT SUPPORT PANEL                      | BENT                 | 755.20                    | 745.10            |
| 1   | FRONT SUPPORT PANEL GARNISH              | DISTORTED            | 265.90                    | 255.20            |
| 2   | HEADLAMPS @\$950.00                      | CRACKED              | 1,900.00                  | 1,258.60          |
| 1   | HORN UNIT                                | CRACKED              | 185.00                    | 105.00            |
| 1   | AIR CON CONDENSER                        | BENT / PUNCTURE      | 885.90                    | 600.10            |
| 1   | AIR CON CONDENSER RUBBER BUSH            | NOT NECESSARY        | 20.00                     | -                 |
| 1   | AIR CON LIQUID PIPE                      | NOT NECESSARY        | 285.60                    | -                 |
| 1   | AIR CON SUCTION PIPE                     | NOT NECESSARY        | 351.80                    | -                 |

Report Ref No. CC6/QBE21002093/Ues3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

| Qty | Description of Parts                       | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|--------------------------------------------|----------------------|---------------------------|-------------------|
| 1   | AIR CON DISCHARGE PIPE                     | NOT NECESSARY        | 365.30                    | -                 |
| 2   | AIR CON SIDE GARNISHS @\$125.00            | DEFORMED / TORN      | 250.00                    | 250.00            |
| 1   | AIR CON COMPRESSOR                         | NOT NECESSARY        | 2,100.20                  | -                 |
| 1   | RADIATOR                                   | BENT /PUNCTURE       | 1,005.90                  | 786.10            |
| 1   | RADIATOR RUBBER BUSH                       | NOT NECESSARY        | 20.00                     | -                 |
| 1   | RADIATOR TOP HOSE                          | NOT NECESSARY        | 65.00                     | -                 |
| 1   | RADIATOR BOTTOM BUSH                       | NOT NECESSARY        | 65.00                     | -                 |
| 1   | RADIATOR SPARE TANK                        | NOT NECESSARY        | 194.60                    | -                 |
| 1   | RADIATOR FAN ASSY                          | NOT NECESSARY        | 988.20                    | -                 |
| 1   | BATTERY TRAY                               | NOT NECESSARY        | 108.90                    | -                 |
| 1   | ENGINE MOUNTING                            | NOT NECESSARY        | 450.00                    | -                 |
| 2   | FRONT FENDERS @\$688.00                    | TO REPAIR SEE LABOUR | 1,376.00                  | -                 |
| 2   | FRONT FENDER INNERSHIELDS @\$188.00        | NOT NECESSARY        | 376.00                    | -                 |
| 1   | AIR CLEANER ASSY                           | NOT NECESSARY        | 650.00                    | -                 |
| 1   | ALTERNATOR                                 | NOT NECESSARY        | 1,820.00                  | -                 |
|     | LESS 10% DISCOUNT                          |                      | -                         | -1,966.01         |
|     |                                            |                      | 42,739.90                 | 17,694.09         |
|     | <b><u>SPECIAL NETT ITEMS</u></b>           |                      |                           |                   |
| 1   | SET 70KM/H & 6 PAX STICKER (SN)            | NECESSARY            | 20.00                     | 20.00             |
| 2   | REAR TAILGATE GLASS SEALANT (SN)           | NECESSARY            | 100.00                    | 80.00             |
| 1   | SET REAR T THERMO KING STICKER (SN)        | NOT NECESSARY        | 100.00                    | -                 |
| 1   | REAR LICENCE PLATE (SN)                    | BENT                 | 50.00                     | 40.00             |
| 1   | SET REAR BUMPER REVERSE SENSOR (SN)        | SHORTED              | 280.00                    | 200.00            |
| 1   | SET REAR BUMPER CLIPS (SN)                 | NECESSARY            | 50.00                     | 40.00             |
| 1   | REAR END PANEL SEALANT (SN)                | NECESSARY            | 50.00                     | 50.00             |
| 1   | SET REAR TAILGATE INNER TRIM CLIPS (SN)    | NECESSARY            | 50.00                     | 50.00             |
| 2   | REAR FLOOR PANEL TOP BOARDS @\$900.00 (SN) | CRACKED              | 1,800.00                  | 1,000.00          |
| 1   | FRONT LICENCE PLATE (SN)                   | BENT                 | 50.00                     | 40.00             |
| 1   | SET FRONT BUMPER CLIPS (SN)                | NECESSARY            | 50.00                     | 40.00             |
|     |                                            |                      | 2,600.00                  | 1,560.00          |
|     | <b><u>LABOUR</u></b>                       |                      |                           |                   |
|     | TO CHECK WIRING .                          |                      | 80.00                     | 30.00             |

Report Ref No. CC6/QBE21002093/Ues3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

| Qty                                                                         | Description of Parts                                                                                                                                   | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
|                                                                             | TO DISMANTLE & REPLACED REVERSE SENSOR .                                                                                                               |               | 80.00                     | 50.00             |
|                                                                             | TO DISMANTLE & REPLACED REAR BOTH TAILGATE GLASS .                                                                                                     |               | 220.00                    | 200.00            |
|                                                                             | TO DISMANTLE & REFIX TAILGATE MECHANISM .                                                                                                              |               | 150.00                    | 100.00            |
|                                                                             | TO DISMANTLE & REFIX REAR EXHAUST .                                                                                                                    | NOT NECESSARY | 100.00                    | -                 |
|                                                                             | TO MOUNT VEHICLE ON CAR O-LINER .                                                                                                                      | NOT NECESSARY | 380.00                    | -                 |
|                                                                             | TO REFILL AIR CON GAS.                                                                                                                                 |               | 120.00                    | 100.00            |
|                                                                             | TO DISMANTLE & REPLACED INTER COOLER .                                                                                                                 |               | 100.00                    | 40.00             |
|                                                                             | TO SPRAY RUST PROOFING .                                                                                                                               |               | 200.00                    | 150.00            |
|                                                                             | LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF TAILLAMP HOUSING PANELS,REAR FENDERS,TAILLAMP INNER SIDE PANELS AND REAR FENDERS. |               | 3,800.00                  | 2,400.00          |
|                                                                             | TO PUTTY & SPRAY PAINTING .                                                                                                                            |               | 2,800.00                  | 1,600.00          |
|                                                                             |                                                                                                                                                        |               | 8,030.00                  | 4,670.00          |
| <b>GRAND TOTAL</b>                                                          |                                                                                                                                                        |               | <b>53,369.90</b>          | <b>23,924.09</b>  |
| <b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b> |                                                                                                                                                        |               |                           | <b>19,000.00</b>  |

Report Ref No. CC6/QBE21002093/Ues3q2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. GBE 9363T

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

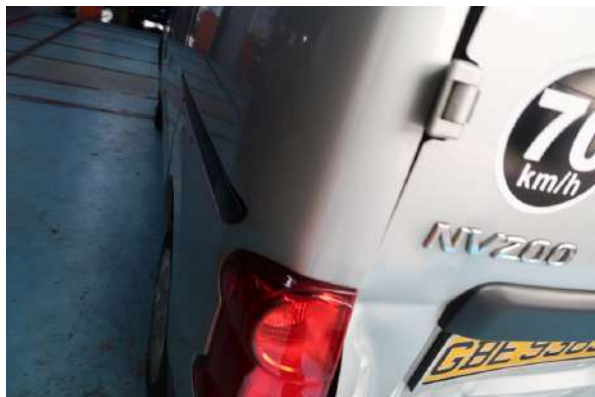



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. GBE 9363T

### RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

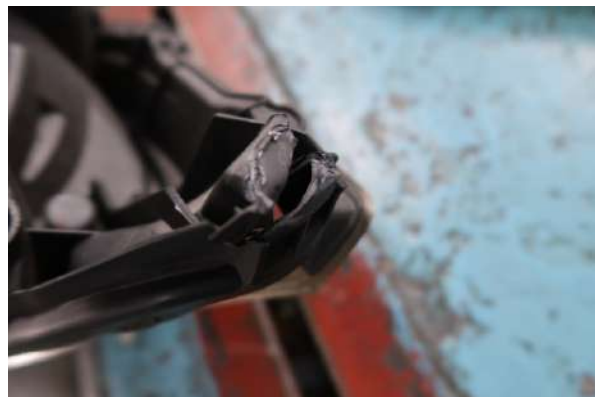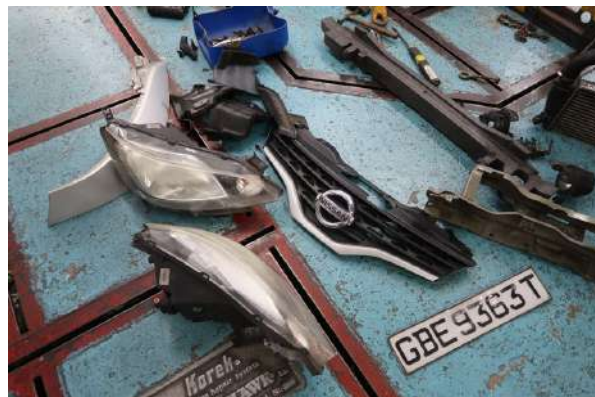



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

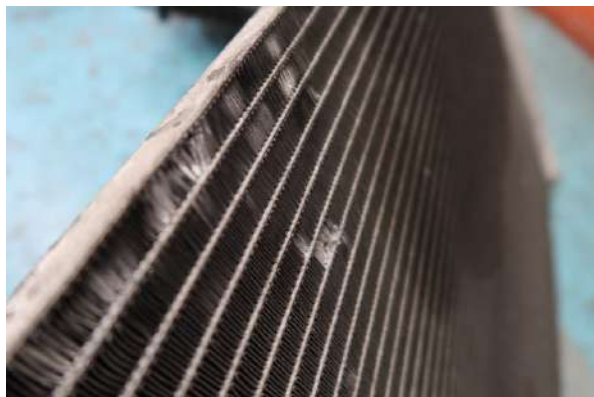



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 9363T

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

