



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2101698

INV Date 17/03/2021

Reference CC3/EQI21002477/Kvf3q2

Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SHF 680K
Insured Veh. FBK 926Y
Claim No. DM21HO00259-JG
Policy No. DMMPHQ20-000264
Accident Date 17/02/2021
Inspection Date 22/02/2021

Description	Total
Survey Inspection	160.00
Digital Photographs	
Transportation	
Subtotal	160.00
GST (7%)	11.20
Grand Total	171.20

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX SINGAPORE 069110

Ref: CC3/EQI21002477/Kvf3q2

Date: 17/03/2021

Code: EQI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	FBK 926Y	Veh. Inspected	SHF 680K
Policy No.	DMMPHQ20-000264	Coverage (\$)	0.00
Claim No.	DM21HO00259-JG	Excess (\$)	0.00
Assign From		Assign Date	22/02/2021

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2020
Chassis No.	JTDKB3FUX03092232	Colour	M.P.WHITE / RED
Odometer	38501 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	SAILUN	9 mm
L/H Front Tyre	195/65 R15	SAILUN	9 mm
R/H Rear Tyre	195/65 R15	DUNLOP	6 mm
L/H Rear Tyre	195/65 R15	DUNLOP	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	17/02/2021	Inspection Date	22/02/2021
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **2 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 680K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	COVER,REAR BUMPER	BUCKLED / DENTED	485.60	485.60
1	REINFORCEMENT SUB-ASSY,REAR BUMPER	TO REPAIR SEE LABOUR	332.70	-
1	GUARD,REAR BUMPER,CENTER	DENTED / CUT	374.50	374.50
1	SEAL,REAR BUMPER SIDE,RH	SERVICEABLE	118.30	-
1	RETAINER,REAR BUMPER SIDE,RH	SERVICEABLE	132.60	-
1	LENS & BODY,REAR COMBINATION LAMP,RH	SERVICEABLE	339.60	-
1	LENS & BODY,REAR COMBINATION LAMP,NO.2 RH	SERVICEABLE	261.00	-
	LESS 25% DISCOUNT		-511.07	-215.02
			1,533.23	645.08
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER SIDE CLIP (SN)	NOT NECESSARY	60.00	-
1	REAR FENDER LINER CLIP (SN)	NOT NECESSARY	65.00	-
1	TAIL LAMP CLIP (SN)	NOT NECESSARY	70.00	-
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	85.00	50.00
1	REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	75.00	-
			1,055.00	50.00
<u>LABOUR</u>				
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.	NOT NECESSARY	240.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF REINFORCEMENT SUB-ASSY,REAR BUMPER.		1,600.00	200.00
	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	380.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		1,600.00	220.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	50.00
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	10.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIT OF REAR FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			5,100.00	480.00
	GRAND TOTAL		7,688.23	1,175.08
RECOMMENDED COST OF REPAIRS				1,175.08

Report Ref No. CC3/EQI21002477/Kvf3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 17/02/2021 13:16 (SGT)
Date of Accident 17/02/2021 08:43 (SGT)
Exact Location of Accident Bukit Timah Rd, Singapore
Additional Location Information BUKIT TIMAH RD FILTER TO SIXTH AVE
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SHF680K

INSURED/POLICYHOLDER

Is company? Yes
Name Of Registered Owner TRANS-CAB SERVICES PTE LTD
Company Reg No 2XXXXX878K
Email Address claims@transcab.com.sg
Mobile Phone No (Phone) +65-62866666
Alternative Phone No (Office) +65-62866666

VEHICLE PARTICULARS

Manufacturer Toyota
Model Prius
Variant -
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? No - Reporting only
Vehicle Category Taxi

INSURANCE COMPANY

Name of Insurance Company Axa
Type of Coverage ThirdParty
Fleet Policy Yes
Policy Number VFX/P2413997
Cover Note Number NA

DRIVER

Name of Driver CHEE SZE CHEN ,DELON
NRIC No SXXXX551I
Date Of Birth 21/05/1972
Occupation Outdoor

Date Of Driving Pass	03/04/1995
Driving experience	25 YEARS AND 10 MONTHS
Gender	Male
Mobile Number	(Phone) +65-98793135
Alt. Phone Number	-
Email Address	claims@transcab.com.sg
Address	HDB Rivervale Arc, 178B Rivervale Crescent 542178#08-441
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicules?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

PASSENGER 1

Name	PASSENGER 1
Gender	Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

My vehicle was on the extreme left lane queuing to filter left. While queuing, suddenly I felt an impact from behind and saw a bike had already hit onto my vehicle rear right side portion.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	FBK926Y
Vehicle Manufacturer	Yamaha
Vehicle Model	TMAX 530 CVT
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Motorcycle

ACCIDENT STATEMENT (2000 characters)

My vehicle was on the extreme left lane queuing to filter left. While queuing, suddenly I felt an impact from behind and saw a bike had already hit onto my vehicle rear right side portion.

Taxi Voucher No.:

DECLARATION

We declare that the above particulars & information provided above are true in every aspect

VERIFIED BY AJAX MARS REPORTING OFFICER -
AIZAM BIN ATAN

MARS Officer



Registered Owner or Driver's Signature

Job Complete Date/Time

17 February 2021 at 10:30 AM

Date/Time:

17 February 2021 at 10:30 AM



LKK Auto Consultants Pte Ltd





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHF 680K

INSPECTION

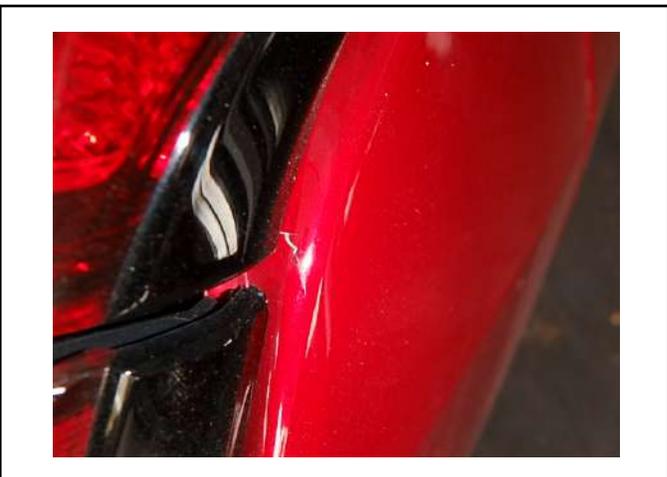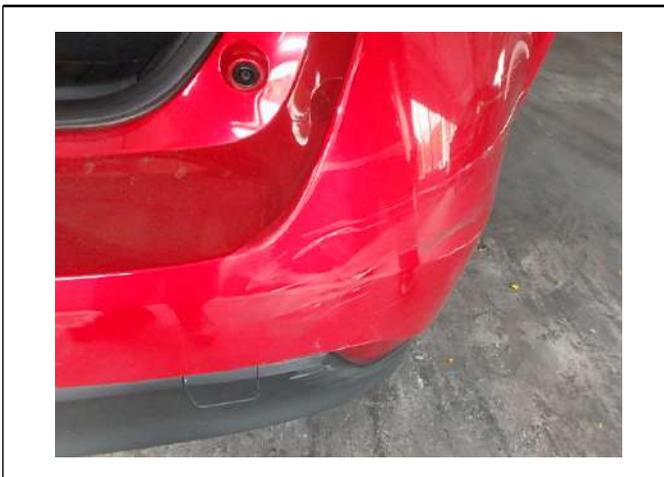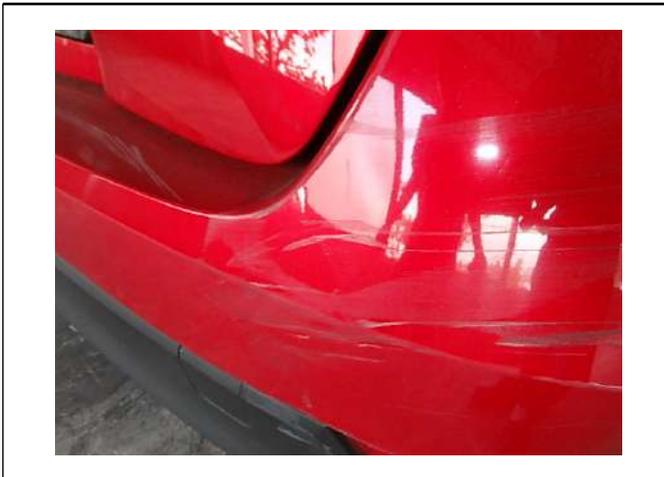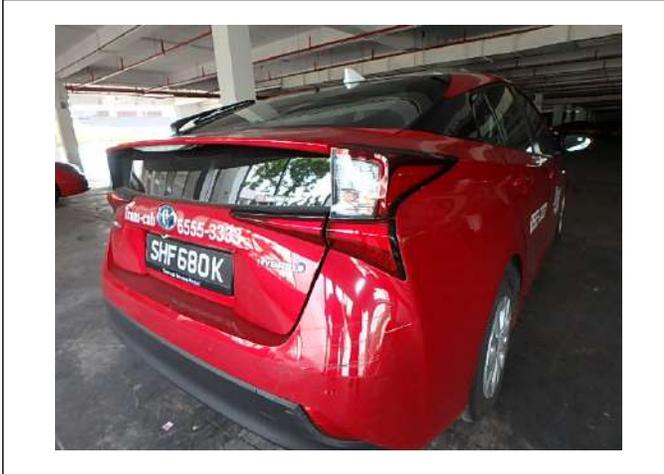



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

