



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvos@hotmail.com

Business Reg. 201404434D

VEHICLE INSPECTION REPORT

Report No. : PAS/TP/0320221

Date of Report : 05/03/2021

To : M/s. Forte Auto Leasing Pte Ltd
C/o. 53, Ubi Ave 1, #05-44
Paya Ubi Industrial Park
Singapore 408934

Date of Assignment : 23/02/2021
Report requested by : M/s. Forte Auto Leasing Pte Ltd
Date of Accident : 21/02/2021
Date of Inspection : 23/02/2021
Claim No. : Third Party Claim
Policy No. : -

PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No. : SLX8567K
Make & Model : Toyota Prius (Hybrid)
Date of Registration : 13/04/2018
Colour : Met. Silver

Engine Capacity (cc) : 1797cc
Mileage (km) : 130678km
Chassis / Frame No. : ZVW518042486
Engine No. : 22R8329130

TYRE CONDITION

Front LH : 7 mm
Make : Sailun

Front RH : 7 mm
Make : Sailun

Rear LH : 7 mm
Make : Nexen

Rear RH : 7 mm
Make : Nexen

Road wheels Type : Alloy

(The above represents the approximate remaining life of tyre treads)

PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork : Good
Paintwork : Good
Handbrake : Serviceable
Footbrake : Serviceable
Steering : Serviceable
Apparent Engine Modification : Nil

PLACE OF REPAIRER OFFICE/WORKSHOP

Location : M/s. Neo Automotive Pte Ltd
53, Ubi Ave 1, #05-44, Paya Ubi Industrial Park, Singapore 408934

ASSESSMENT

Repairer's Estimate : \$ 8,537.53
Revised Amount : \$ 6,938.28
Less Excess : \$ -
Recommended Reserve : \$ 5,550.00 (Lump Sum)

Estimated Normal Period of Repairs : 7 Working Days

Disclaimer: The information contained in this report is intended for exclusive use of the addressee (including any attachments) solely in relation to the loss occurrence in which the assessed vehicle involved. It is confidential and may be protected by legal privilege. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party. If you are not the intended recipient, please contact us immediately to arrange for its return and you should not disseminate, distribute, copy any information contained herein or use of this communication is strictly prohibited.



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 888259 Singapore 919191.

Mobile: 9295 2204 Fax: 8722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SLX8567K

Report No. : PAS/TP/0320221

GENERAL REMARKS

WITHOUT PREJUDICE

THE ASSIGNMENT

The survey was conducted at M/s. Neo Automotive Pte Ltd, 53, Ubi Ave 1, #05-44, Paya Ubi Industrial Park, Singapore 408934.

(Subsequent inspections have been conducted)

POINT OF IMPACT

At the rear portion.

DAMAGES

The tailgate, rear bumper, rear end panel, rear floor panel, rear chassis members, rear fenders, etc.

Other parts were also found damaged. (See schedule for details)

ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$6,938.28.

CONCLUSION

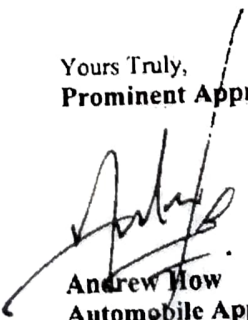
The repairer has agreed to undertake the repairs at a lump sum of SGD \$5,550.00.

This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,
Prominent Appraiser Services Pte Ltd


Andrew How
Automobile Appraiser
MSAAA
Licensed Appraiser



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvos@hotmail.com

Business Reg. 201404434D

Vehicle No : SLX8567K

Report No. : PAS/TP/0320221

APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	1 pc	Tailgate <i>X Repair</i>	Dented/Distorted	\$ 1,641.50	\$ 1,641.50 <i>X</i>
2	1 pc	Tailgate no.plate garnish <i>/</i>	Dented/Cracked	\$ 891.20	\$ 891.20 <i>/</i>
3	1 pc	Tailgate emblem (Logo) <i>/</i>	Necessary	\$ 46.30	\$ 46.30 <i>/</i>
4	1 pc	Tailgate emblem (Prius) <i>/</i>	Necessary	\$ 52.30	\$ 52.30 <i>/</i>
5	1 pc	Tailgate emblem (Hybrid) <i>/</i>	Necessary	\$ 52.90	\$ 52.90 <i>/</i>
6	1 pc	Tailgate inner mid trim <i>X SVC</i>	Refit	\$ 218.50	\$ -
7	1 pc	Tailgate inner trim <i>/</i>	Dented/Deformed	\$ 251.50	\$ 251.50 <i>/</i>
8	1 pc	Tailgate lock assy <i>/</i>	Dented/Damaged	\$ 452.10	\$ 452.10 <i>/</i>
9	1 pc	Tailgate weatherstrip <i>/</i>	Torn/Necessary	\$ 360.70	\$ 360.70 <i>/</i>
10	1 pc	Taillamp RH <i>X SVC</i>	Refit	\$ 433.70	\$ -
11	1 pc	Rr bumper <i>/</i>	Dented/Deformed	\$ 423.90	\$ 423.90 <i>/</i>
12	1 pc	Rr bumper center guard <i>/</i>	Dented/Deformed	\$ 558.30	\$ 558.30 <i>/</i>
13	1 pc	Rr bumper tow cover <i>/</i>	Broken/Dislodged/Missing	\$ 21.00	\$ 21.00 <i>/</i>
14	1 pc	Rr bumper tow bracket <i>/</i>	Dented	\$ 82.60	\$ 82.60 <i>/</i>
15	2 pcs	Rr bumper side extension R/L <i>X SVC</i>	Refit	\$ 300.00	\$ -
16	1 pc	Rr bumper side lamp RH <i>X SVC</i>	Refit	\$ 486.80	\$ -
17	6 pcs	Rr bumper clip <i>/</i>	Necessary	\$ 22.80	\$ 22.80 <i>/</i>
18	2 pcs	Rr bumper retainer R/L <i>X SVC</i>	Cracked/Necessary	\$ 223.00	\$ 223.00 <i>X</i>
19	1 pc	Rr bumper reinforcement <i>X SVC</i>	Dented	\$ 318.80	\$ 318.80 <i>X</i>
20	1 pc	Rr end panel <i>X Repair</i>	Dented/Distorted	\$ 629.80	\$ 629.80 <i>X</i>
21	1 pc	Rr end panel trim <i>/</i>	Dented/Deformed	\$ 122.80	\$ 122.80 <i>/</i>
22	1 pc	Rr lock antenna <i>/</i>	Dented/Damaged	\$ 86.20	\$ 86.20 <i>/</i>
23	2 pcs	Rr fender R/L	Dented/Repair	(Refer labour no. 4, 6 & 7)	
24	1 pc	Rr floor panel	Dented/Repair	(Refer labour no. 4, 6 & 7)	
25	2 pcs	Rr chassis member R/L	Dented/Repair	(Refer labour no. 4, 6 & 7)	
				\$ 7,676.70	\$ 6,237.70 <i>3924.6</i>
Less Discount : 25%				\$ 1,919.18	25% \$ 1,559.43
List Parts Sub-Total :				\$ 5,757.53	\$ 4,678.28 <i>2568.45</i>
1	1 pc	Rr windscreen sealant <i>/</i>	Necessary	S/N \$ 50.00	\$ 40.00 <i>/</i>
2	1 set	Rr reverse sensor <i>X SVC</i>	Dented/Damaged	S/N \$ 200.00	\$ 200.00 <i>X</i>
3	1 pc	Rr end panel sealant <i>X SVC</i>	Necessary	S/N \$ 50.00	\$ 40.00 <i>X</i>
Special Nett Sub-Total :				\$ 300.00	\$ 280.00
Parts Total :				\$ 6,057.53	\$ 4,958.28



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers
Correspondence Mail Address: My Mail Box 886259 Singapore 919191.
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SLX8567K

Report No. : PAS/TP/0320221

S/No:	Labour Descriptions	Repairer's Estimate(S\$)	Our Assessment (S\$)
1	To remove and reinstall electrical wiring system for necessary repairs. To check rear electrical wiring system.	\$ 30.00	\$ 20.00 ✓
2	To transfer tailgate component parts to new tailgate.	\$ 100.00	\$ 80.00 60
3	To transfer rear windscreen to new tailgate.	\$ 120.00	\$ 120.00 X
4	To remove and reinstall rear interior trims, garnishes, etc. for necessary repairs.	\$ 100.00	\$ 80.00 60
5	To remove, replace and reinstall rear reverse sensors & control unit.	\$ 50.00	\$ 50.00 ✓
6	To straighten, repair, realign on affected area and replace damaged parts.	\$ 1,000.00	\$ 770.00 500
7	To spray painting, blending on affected and adjacent area.	\$ 1,000.00	\$ 800.00 700
8	To spray anti-rust coating on new and affected panels.	\$ 80.00	\$ 60.00 X
Labour Total :		\$ 2,480.00	\$ 1,980.00
Total (Parts & Labour) :		\$ 8,537.53	\$ 6,938.28

3998.45

20% 3200

For Lump Sum Repairs

The final adjusted Lump Sum contract amount is \$ 5,550.00

Under normal circumstances, the repairs should be completed within a reasonable period of 7 Working Days. (Exclude waiting days of PRJ, Sunday, Public Holiday and awaiting of shipment for spare parts)

58 Photographs were taken at the time of inspection.

N.B: By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall has the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.

4800