

ASS. REC. BY:

REF:

CS/CT1 21002874/Tigfs

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

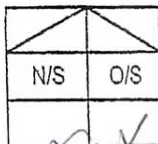
Policy No. DMCVSNA00014902001Claims No. SNM21D201166C02

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 814K.

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 11 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: 6BC3/66X Yr Regn: 2011 Nov

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Nissan Urvan 3.0 c.c. 2953Colour 8/1er A/C: Insured / Std / NI / NASp. Reading 265595 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JN1MG 2E25Z*0760523

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/R15R: 21

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. _____ D.O.I. 3/3/21Survey held at Yifkeng

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Repair limit 911K

29/03/21@12.41pm revised to Pauline Tham via Merimen.

Taufikh finalised LS \$10600, 11 days (Red \$29884.83, 74%)

Date/Time, File Pass to?

☐

: Preli. Report

1) 04/08 Typist

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 11Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS SI

Photos

Others

TOTAL

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Weekend (\$Report Format: MER-TPLump Sum / LS / T 10600

YI HENG MOTOR WORKSHOP

BLK 1, KAKI BUKIT AVENUE 6
#02-19 AUTOBAY, SINGAPORE 417883
TEL: 6 5090052 FAX: 6 7479402

02/03/2021

OUR REF NO. GBC 3166X

HUP HING TRANSPORT SERVICE
196, PANDAN LOOP
SINGAPORE 128384

ESTIMATE BILL FOR VEHICLE NO. GBC 3166X

MODEL : NISSAN URVAN

NETT ITEM

1) REAR WINDSCREEN		\$ 960.00	cnr
2) REAR WIPER BLADE		\$ 38.10	nt
3) REAR WIPER ARM		\$ 93.60	ht
4) REAR WIPER ARM MOTOR		\$ 273.00	x
5) TAILGATE		\$ 1,863.62	ht
6) TAILGATE LOGO		\$ 48.20	na
7) TAILGATE STICKER "URVAN"		\$ 48.60	na
8) TAILGATE STICKER "3.0DTI COMMONRAIL"		\$ 58.00	na
9) TAILGATE DAMPER	2PCS @\$382.00	\$ 764.00	xy
10) TAILGATE OUTER GARNISH		\$ 483.70	x
11) TAILGATE STOPPER	2PCS @\$15.40	\$ 30.80	na
12) TAILGATE SIDE GUIDE	2PCS @\$121.30	\$ 242.60	x
13) TAILGATE WEATHERSTRIPE		\$ 267.60	de
14) TAILGATE LOCK ACTUATOR		\$ 347.00	?
15) REAR BUMPER		\$ 683.80	de
16) REAR BUMPER CLIPS	10PCS @\$6.90	\$ 69.00	na
17) REAR BUMPER SIDE ATTACHEMENT	2PCS @\$68.00	\$ 136.00	LHX, RH-de
18) REAR STEP PANEL		\$ 482.00	? plus
19) END PANEL OUTER		\$ 673.10	bt
20) END PANEL INNER		\$ 528.30	? plus
21) END PANEL SIDE EXTENSION (RH)		\$ 289.00	?
22) REAR FLOOR PANEL		\$ 1,982.00	xy

23) REAR FLOOR SIDE EXTENSION PANEL (RH)		\$ 349.10	BA
24) SPARE TYRE CARRIER		\$ 423.80	X
25) SPARE TYRE CHAIN MECHANISM		\$ 148.00	X
26) TAIL LAMP	2PCS @\$294.15	\$ 588.30	LH? RH over
27) TAIL LAMP CLIPS	4PCS @\$6.90	\$ 27.60	LH? RH over
28) TAIL LAMP BASE PANEL (INNER) - photo	2PCS @\$319.10	\$ 638.20	LH x, RH 62
29) TAIL LAMP BASE PANEL (OUTER) - photo	2PCS @\$211.00	\$ 422.00	LH x, RH 62
30) REAR FENDER	2PCS @\$1,877.90	\$ 3,755.80	LH x RH-buc
31) REAR FENDER RAIL GUIDE (RH)		\$ 310.80	?
32) REAR FENDER RAIL GUIDE COVER (RH)		\$ 81.80	?
33) REAR FENDER INNER FRAME PANEL (RH)		\$ 1,586.00	RH
34) REAR FENDER INNER FRAME TOP COVER (RH)		\$ 57.00	de
35) REAR FENDER WHEEL HOUSING PANEL (RH)		\$ 679.00	RH
36) DIESEL TANK DOOR (RH)		\$ 112.00	?
37) DIESEL TANK NECK HOSE (RH)		\$ 142.80	?
38) DIESEL TANK HOSE PANEL (RH)		\$ 179.00	?
39) DIESEL TANK HOSE RUBBER		\$ 96.40	?
40) DIESEL TANK LOCK CABLE		\$ 214.80	X
41) ROOF LINING		\$ 837.00	X
42) REAR AXLE ASSEMBLY (RH)		\$ 8,754.00	X
43) REAR LEAF SPRING ASSEMBLY (RH)		\$ 365.40	X
44) REAR LEAF SPRING BUSH	4PCS @\$25.00	\$ 100.00	X
45) REAR CHASSIS MEMBER	2PCS @\$876.10	\$ 1,752.20	X R
		\$ 31,983.02	
LESS DISCOUNT - 10%		\$ 3,198.30	\$ 28,784.72

SPECIAL NETT ITEM

1) REAR WINDSCREEN GUM	\$ 60.00	40 ney
2) REAR WINDSCREEN INNER SEAL	\$ 60.00	ne-80
3) TAIL GATE STICKER " 70KM/H"	\$ 25.00	ne
4) TAIL GATE STICKER "11 PAX"	\$ 25.00	ne
5) TAIL GATE INNER BOARD	\$ 396.90	@ ? photo

6) TAIL GATE INNER BOARD SCREW	15PCS @\$6.90	\$ 103.50	3000
7) REAR LICENCE PLATE		\$ 55.00	X
8) REVERSE SENSOR WITH CONTROL UNIT		\$ 380.00	2000
9) REAR FENDER INNER BOARD (RH)		\$ 381.00	ana
10) REAR FENDER INNER BOARD SCREW	20PCS @\$6.90	\$ 138.00	na
11) END PANEL SEALANT		\$ 60.00	40 ve
12) REAR FLOOR PANEL SEALANT		\$ 60.00	X
13) REAR FENDER SEALANT		\$ 60.00	40ve
14) AXLE OIL		\$ 80.00	X
		\$ 1,884.40	
LABOUR CHARGE			
1) TO CHECK WIRING SYSTEM		\$ 80.00	30
2) TO APPLY UNDERSEALING ON AFFECTED AREAS		\$ 120.00	40.
3) TO MOUNT VEHICLE ON CAR O-LINER		\$ 380.00	200? photo
4) TO REMOVE/REFIX REAR WINDSCREEN		\$ 280.00	120.
5) TO CONDUCT 4 WHEEL ALIGNMENT		\$ 120.00	X
6) TO REMOVE & REFIX TAILGATE ASSY, FIXING & REALIGNMENT		\$ 280.00	60.
7) TO REMOVE & REFIX REVERSE SENSOR WITH CONTROL UNIT		\$ 120.00	30.
8) TO REMOVE & REFIX REAR EXHAUST SILENCER		\$ 180.00	80? photo
9) TO REMOVE & REFIX SPARE TYRE CARRIER		\$ 180.00	X
10) TO REMOVE & REFIX REAR UNDERCARRIAGE ASSY		\$ 480.00	X
11) TO REMOVE & REFIX DIESEL TANK ASSY, HOSE, BRACKET ETC		\$ 180.00	? photo 80.
12) TO REMOVE & REFIX SLIDING DOOR (RH), FIXING & REALIGNMENT TO FACILITATE REPAIR		\$ 220.00	* photo 80.
13) TO REMOVE AND REFIX CUSHION, FLOOR BOARD, ROOF LINNING, TRIM, GARNISH, UPHOLSTERY, STORAGE COMPARTMENT ETC		\$ 380.00	80.
14) TO REPLACE NEW PARTS, CUT, WELD, KNOCK ETC		\$ 3,520.00	1400.
15) TO RESPRAY ON AFFECTED AREAS		\$ 1,980.00	1200
		\$ 8,500.00	

GRAND TOTAL : \$ 39,169.12

Tanym 97495449
 WP' 3/3/21 @ 1515
 1/5 Resurvey after repair
 Tanym & Khambh. to m
 10-11 days

* To check repair limit

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Business
Owner ID:	300X

Vehicle Details

Vehicle No.:	GBC3166X
Vehicle to be Exported:	Yes
Intended Deregistration Date:	27 Feb 2021
Vehicle Make:	NISSAN
Vehicle Model:	URVAN 3.0 5DR 5MT ABS A/B 2WD SWB
Primary Colour:	Silver
Manufacturing Year:	2011
Engine No.:	ZD30297894K
Chassis No.:	JN1MG2E25Z0760523
Maximum Power Output:	-
Open Market Value:	\$29,797.00
Original Registration Date:	25 Nov 2011
First Registration Date:	25 Nov 2011
Transfer Count:	1
Actual ARF Paid:	\$1,490.00

Intended PARF Rebate Details

PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00

Intended COE Rebate Details

COE Expiry Date:	24 Nov 2021
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
QP Paid:	\$32,801.00
COE Rebate Amount:	\$2,440.00
Total Rebate Amount:	\$2,440.00

The information contained herein is correct as at 27 Feb 2021

OK