



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2104234

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/06/2021
Reference CC6/CTI21003117/Aes3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBJ 4394K
Insured Veh. GBJ 5281X
Claim No. SNM21D201272/C02
Policy No. DMCVSNA00048312000
Accident Date 03/03/2021
Inspection Date 04/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC6/CTI21003117/Aes3q2	
			Date: 15/06/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBJ 5281X		Veh. Inspected	GBJ 4394K
Policy No.	DMCVSNA00048312000		Coverage (\$)	0.00
Claim No.	SNM21D201272/C02		Excess (\$)	0.00
Assign From			Assign Date	04/03/2021
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE		c.c	2982
Engine No.	HIDDEN		Year of Reg.	2019
Chassis No.	JTFHT02P500248885		Colour	SILVER
Odometer	83024 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	NIL
General	GOOD			
3. Conditions of Tyres				
		Size	Make	Balance
R/H Front Tyre		195 R15C	BRIDGESTONE	6 mm
L/H Front Tyre		195 R15C	BRIDGESTONE	6 mm
R/H Rear Tyre		195 R15C	BRIDGESTONE	6 mm
L/H Rear Tyre		195 R15C	BRIDGESTONE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	03/03/2021		Inspection Date	04/03/2021
Survey held at	CN MOTORS PTE LTD 1 KAKI BUKIT AVENUE 6 BLK C #01-41 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
	A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBJ 4394K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT LID	DISTORTED	1,712.45	1,712.45
2	REAR BOOT LID HINGE @\$171.70	NOT NECESSARY	343.40	-
2	REAR BOOT LID SHOCK ABSORBER @\$374.45	NOT NECESSARY	748.90	-
1	REAR BOOT LID TOYOTA HIACE STICKER	NECESSARY	57.60	57.60
1	REAR BOOT LID EMBLEM LOGO	NECESSARY	41.10	41.10
1	REAR BOOT LID CENTRE MOULDING	DEFORMED	281.90	281.90
2	REAR BOOT LID NUMBER PLATE LAMP @\$67.80	NOT NECESSARY	135.60	-
1	REAR BOOT LID INNER LOCK	JAMMED	374.25	374.25
1	REAR BOOT LID INNER POWER LOCK	DAMAGED	276.20	276.20
1	REAR BOOT LID INNER TRIMBOARD	TORN	581.10	165.30
10	REAR BOOT LID INNER TRIMBOARD CLIP @\$6.50	NECESSARY	65.00	20.00
1	REAR BOOT LID INNER TRIMBOARD HANDLE	NOT NECESSARY	186.45	-
1	REAR BOOT LID WEATHERSTRIP	CUT	381.90	289.00
1	REAR BOOT LID WINDSCREEN	CUT	1,355.00	1,015.00
1	REAR BOOT LID WINDSCREEN SEAL	NECESSARY	105.00	105.00
2	REAR TAIL LAMP @\$371.50	CRACKED	743.00	743.00
2	REAR TAIL LAMP PANEL @\$355.80	TO REPAIR SEE LABOUR	711.60	-
2	REAR TAIL LAMP LOWER COVER @\$182.10	DEFORMED	364.20	158.00
2	REAR TAIL LAMP LOWER COVER RETAINER @\$171.45	NOT NECESSARY	342.90	-
4	REAR TAIL LAMP CLIP @\$8.00	NECESSARY	32.00	32.00
2	REAR FENDER @\$1989.90	TO REPAIR SEE LABOUR	3,979.80	-
2	REAR FENDER AIR DUCT @\$172.45	O/S DEFORMED	344.90	65.00
1	REAR BUMPER	DISTORTED	374.45	374.45
10	REAR BUMPER CLIP @\$6.50	NECESSARY	65.00	30.00
2	REAR BUMPER SIDE RETAINER @\$131.35	NECESSARY	262.70	262.70
1	REAR END PANEL OUTER	DENTED	581.10	581.10
1	REAR END PANEL INNER	DENTED	591.25	591.25
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,850.00	-
1	REAR FLOOR PANEL TOP MOULDING	BENT	174.10	174.10

Report Ref No. CC6/CTI21003117/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
8	REAR FLOOR PANEL TOP MOULDING CLIP @\$6.50	NECESSARY	52.00	20.00
1	REAR FLOOR PANEL CARPET	NOT NECESSARY	750.00	-
1	REAR FLOOR PANEL PLYWOOD	NOT NECESSARY	550.00	-
1	REAR SPARE TYRE BRACKET	BENT	172.10	172.10
1	REAR EXHAUST	BENT	1,712.85	725.00
1	REAR CENTRE EXHAUST	NOT NECESSARY	1,829.10	-
2	REAR EXHAUST MOUNTING @\$65.00	NOT NECESSARY	130.00	-
2	REAR END PANEL SIDE EXTENSION @\$214.65 (ADDITIONAL)	O/S DENTED	429.30	214.65
4	REAR END PANEL LOWER BRACKET @\$35.00 (ADDITIONAL)	BENT	140.00	100.00
	LESS 25% DISCOUNT		-	-2,145.29
			22,828.20	6,435.86
	<u>SPECIAL NETT ITEMS</u>			
1	REAR PLYWOOD BOX (SN)	CRACKED	2,000.00	400.00
1	REAR BOOT LID 70KM/H STICKER (SN)	NECESSARY	20.00	10.00
1	REAR BOOT LID 4 PAX STICKER (SN)	NECESSARY	20.00	10.00
1	REAR BOOT LID NUMBER PLATE (SN)	BENT	50.00	30.00
1	REAR BOOT LID REVERSE CAMERA (SN)	DAMAGED	680.00	380.00
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	350.00	200.00
			3,120.00	1,030.00
	<u>LABOUR</u>			
	TO REMOVE & REFIT PLYWOOD BOX .		500.00	120.00
	TO REMOVE & REFIT TRIMBOARD AND CUSHION .		800.00	60.00
	TO REMOVE & REFIT REVERSE SENSOR .		100.00	50.00
	TO REMOVE & REFIT REAR WINDSCREEN .		120.00	120.00
	GUM .		50.00	50.00
	TO CHECK WIRING.		100.00	30.00
	TUFF KOTE.		150.00	80.00
	TOWING .	NOT NECESSARY	150.00	-
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR TAIL LAMP PANEL,REAR FENDER AND REAR FLOOR PANEL .		2,500.00	1,400.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPRAY PAINTING .		2,200.00	1,300.00
			6,670.00	3,210.00
GRAND TOTAL			32,618.20	10,675.86
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,500.00

Report Ref No. CC6/CTI21003117/Aes3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBJ 4394K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

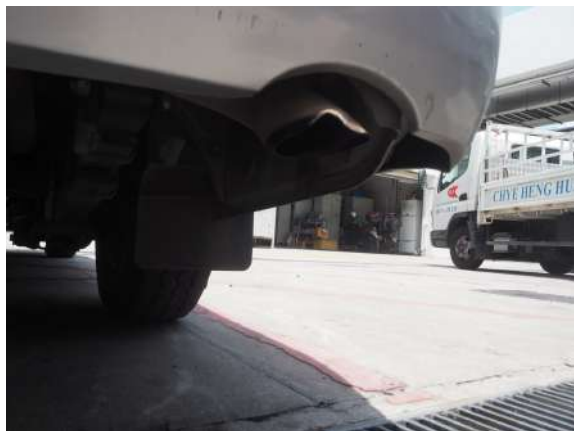



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBJ 4394K

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

