



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2105078

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 19/07/2021
Reference CC4/LPC21003216/Ugs3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SGV 9543S
Insured Veh. SGQ 1587U
Claim No. 21/21/21/VP05/024299
Policy No. Z21VP05028320
Accident Date 04/03/2021
Inspection Date 11/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21003216/Ugs3q2 Date: 19/07/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SGQ 1587U	Veh. Inspected	SGV 9543S	
Policy No.	Z21VP05028320	Coverage (\$)	0.00	
Claim No.	21/21/21/VP05/024299	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	11/03/2021	
2. Vehicle Particulars & Condition				
Make & Model	HONDA STREAM (A)	c.c	1799	
Engine No.	HIDDEN	Year of Reg.	2007	
Chassis No.	RN61030791	Colour	BLUE	
Odometer	291409 KM	Steering	AFFECTED	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	DUNLOP	6 mm	
L/H Front Tyre	205/55 R16	DUNLOP	6 mm	
R/H Rear Tyre	205/55 R16	DUNLOP	6 mm	
L/H Rear Tyre	205/55 R16	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT & N/S FRONT PORTION. THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/03/2021	Inspection Date	11/03/2021	
Survey held at	CAR CITY AUTO CENTRE PTE LTD BLK 9006 TAMPINES ST 93 #01-198 SINGAPORE 528840			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGV 9543S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT DOOR LH	BADLY DENTED	910.40	910.40
2	FRONT DOOR LH HINGE (TOP & BOTTOM) @\$39.40	NOT NECESSARY	78.80	-
1	FRONT DOOR LH CHECKER	NOT NECESSARY	35.00	-
1	SIDE SKIRTING PANEL LH	TO REPAIR SEE LABOUR	570.00	-
2	FRONT FENDER LH & RH @\$496.40	BADLY DENTED	992.80	992.80
2	FRONT FENDER LH & RH SIDE SIGNAL LAMP @\$29.80	CRACKED	59.60	59.60
2	FRONT FENDER COWLING RH & LH @\$81.50	TORN	163.00	163.00
1	FRONT FENDER TOP GARNISH LH	NOT NECESSARY	29.27	-
1	FRONT BUMPER	DISTORTED	635.40	635.40
1	FRONT BUMPER BRACKET LH	NOT NECESSARY	38.50	-
1	FRONT BUMPER SIDE RETAINER LH	BENT	24.70	24.70
2	FRONT HEADLIGHT RH & LH @\$710.00	O/S CRACKED	1,420.00	650.00
2	FRONT HEADLIGHTBRACKET RH & LH @\$39.27	NOT NECESSARY	78.54	-
2	FRONT SHOCK ABSORBER RH & LH @\$350.00	NOT NECESSARY	700.00	-
2	FRONT LOWER ARM LH & RH @\$333.52	SERVICEABLE	667.04	-
2	FRONT KNUCKLE ARM LH & RH @\$470.20	NOT NECESSARY	940.40	-
2	FRONT KNUCKLE ARM BEARING RH & LH @\$145.50	NOT NECESSARY	291.00	-
2	FRONT STABILIZER LINK @\$120.50	NOT NECESSARY	241.00	-
2	FRONT DRIVESHAFT RH & LH @\$905.77	NOT NECESSARY	1,811.54	-
1	FRONT STEERING RACK & PINION	SERVICEABLE	1,679.00	-
2	FRONT RACK END RH & LH @\$24.00	NOT NECESSARY	48.00	-
2	FRONT TIE ROD RH& LH @\$180.60	NOT NECESSARY	361.20	-
	LESS 20% DISCOUNT		-2,355.04	-687.18
			9,420.15	2,748.72
	<u>SPECIAL NETT ITEMS</u>			
1	DOOR VISOR (SN)	NECESSARY	70.00	50.00
1	FRONT TYRE RH 205/55R16 (50%) (SN)	PUNCTURE	180.00	90.00
2	FRONT SPORT RIM RH & LH @\$280.00 (SN)	DENTED / BENT	560.00	500.00
20	CLIPS @\$3.90 (SN)	NECESSARY	78.00	40.00

Report Ref No. CC4/LPC21003216/Ugs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BODY SEALANT (SN)	NOT NECESSARY	60.00	-
			948.00	680.00
	LABOUR			
	LABOUR .INCLUSIVE OF THE REPAIR OF SIDE SKIRTING PANEL LH .		1,200.00	800.00
	SPRAY PAINTING .		1,600.00	1,100.00
	TO REMOVE & REFIT UNDERCARRIAGE.	NOT NECESSARY	500.00	-
	TO CHECK WIRING & LIGHTING SYSTEM.		80.00	20.00
	ALIGNMENT.		80.00	80.00
	TOWING FEE.		50.00	50.00
	LABOUR TO APPLY BODY SEALANT ON JOINTS.	NOT NECESSARY	60.00	-
	LABOUR TO REMOVE /REFIT GARNISH TO FACILITATE REPAIR.	NOT NECESSARY	60.00	-
	TO APPLY ANTI-RUST.		80.00	80.00
	TO TRANSFER FRONT DOOR PARTS.		100.00	60.00
			3,810.00	2,190.00
GRAND TOTAL			14,178.15	5,618.72
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,800.00

Report Ref No. CC4/LPC21003216/Ugs3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGV 9543S

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

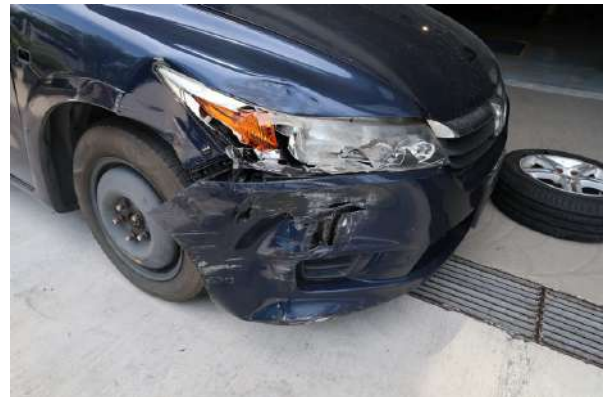



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGV 9543S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGV 9543S

RE-INSPECTION

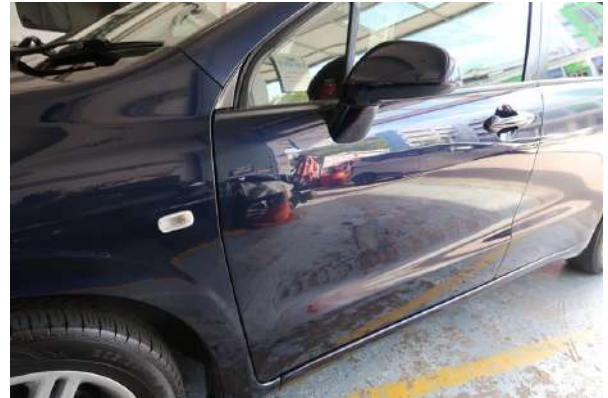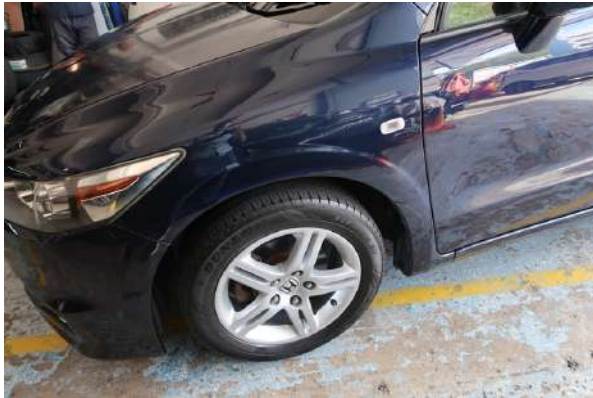



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

