



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2107717
3 ANSON ROAD #16-00	INV Date	09/11/2021
SPRINGLEAF TOWER	Reference	CC3/CTI21003575/Kes3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SHB 7784U
Insured Veh.	PC 7183D
Claim No.	SNM21D201574/C02
Policy No.	DMB1SNA00010152000
Accident Date	18/12/2020
Inspection Date	15/03/2021

Description	Total
Survey Inspection	350.00
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC3/CTI21003575/Kes3q2 Date: 09/11/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	PC 7183D	Veh. Inspected	SHB 7784U
Policy No.	DMB1SNA00010152000	Coverage (\$)	0.00
Claim No.	SNM21D201574/C02	Excess (\$)	0.00
Assign From		Assign Date	15/03/2021
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JTDKB3FU003077318	Colour	M . P. WHITE / RED
Odometer	305197 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	SAILUN	8 mm
L/H Front Tyre	195/65 R15	SAILUN	8 mm
R/H Rear Tyre	195/65 R15	SAILUN	8 mm
L/H Rear Tyre	195/65 R15	SAILUN	8 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	18/12/2020	Inspection Date	15/03/2021
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 7784U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	COVER ,REAR BUMPER	TO REPAIR SEE LABOUR	442.60	-
1	COVER ,REAR BUMPER ,LOWER	SERVICEABLE	15.40	-
1	RETAINER ,REAR BUMPER SIDE ,RH	SERVICEABLE	117.70	-
1	SEAL ,REAR BUMPER SIDE,RH	SERVICEABLE	88.50	-
1	PANEL SUB-ASSY ,QUARTER ,RH	TO REPAIR SEE LABOUR	871.50	-
	LESS 25% DISCOUNT		-383.93	-
			1,151.77	-
<u>SPECIAL NETT ITEMS</u>				
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NOT NECESSARY	95.00	-
1	REAR BUMPER PROTECTOR (SN)	NOT NECESSARY	180.00	-
1	SET REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	85.00	-
1	TYRE (SN)	SERVICEABLE	350.00	-
1	RIM (SN)	SERVICEABLE	1,879.40	-
			3,289.40	-
<u>LABOUR</u>				
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF COVER ,REAR BUMPER AND PANEL SUB-ASSY ,QUARTER ,RH .		2,200.00	300.00
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TAILGATE FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	180.00	-
	TO REMOVE AND REFIT ELECTRICAL WIRING ,BATTERY AND OTHER NECESSARY ITEMS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	480.00	-
	TO TRANSFER OF FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	480.00	-

Report Ref No. CC3/CTI21003575/Kes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO DISMANTLE AND REFIT AIRCON ASSY AND ATTACHMENT ,VACUUM AND CHARGE-IN-GAS.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH ,TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS .	NOT NECESSARY	250.00	-
	TOWING FEES.	NOT NECESSARY	150.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		2,200.00	440.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.	NOT NECESSARY	170.00	-
	TO TRANSFER OF LUGGAGE FLOOR PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	220.00	-
	TO REPLACE ,REFIX AND TOP UP COOLANT FOR RADIATOR .	NOT NECESSARY	170.00	-
	TO LIFT-UP /OUT ENGINE WITH GEAR BOX AND REFIT .	NOT NECESSARY	440.00	-
	TO REMOVE AND REFIT RADIATOR SUPPORT CROSS - MEMBER AND OTHER NECESSARY ITEMS TO ENABLE BODYWORK REPAIR.	NOT NECESSARY	380.00	-
	TO CONDUCT AND PERFORM A COMPREHENSIVE VEHICLE DIAGNOSTIC CHECK AND RESET VEHICLE WARNING INDICATORS.	NOT NECESSARY	380.00	-
			9,990.00	740.00
	GRAND TOTAL		14,431.17	740.00
RECOMMENDED COST OF REPAIRS				740.00

Report Ref No. CC3/CT121003575/Kes3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 7784U

INSPECTION

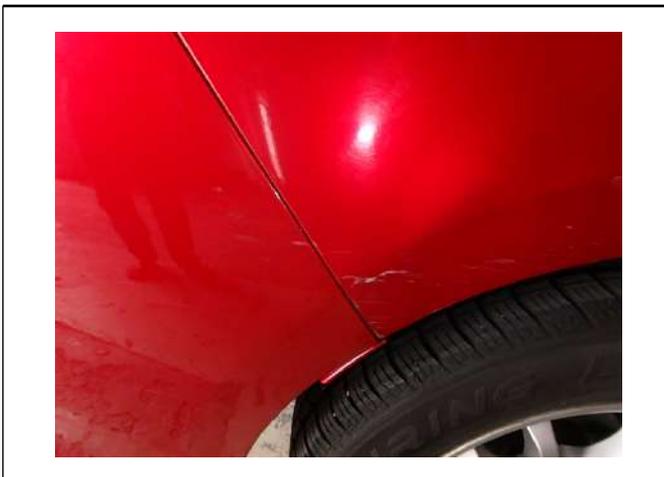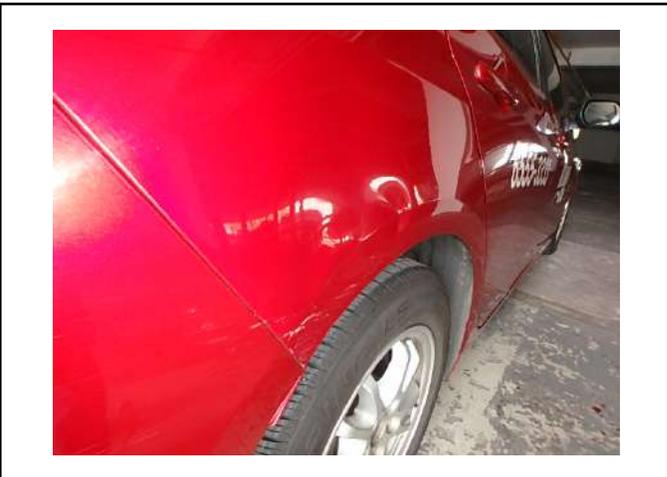



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

