

ASS. REC. BY: Sun Pin.

REF:

CS/CTI21003826/Qtfj.**ASSIGNMENT**

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SGA12C Yr Regn: 27/09/2013Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Volkswagen Golf GTI 20.0c 1984Colour: Silver A/C: Insured / Std / NI / NASp. Reading: 76139 T/Radio: Insured / Std / NI / NAEng/No: -C/No: WVWZZZ44ZEW055330Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt or _____Brake: Inorder / Jammed / Leaked / Burnt or _____Modi: Nil / S/Rim / STD A/Rim or _____Tyre Size: F: 235/35 R19R: 235/35 R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Goodyear.

Front

R/Bal. 6 mm / R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 20/03/2021 D.O.I. 25/03/2021Survey held at Auto Insure.Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or _____

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MV: 55,000PV: 42,089NV: 12,911

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

S + PS. SI

Photos

Others

TOTAL

Report Format: _____

Lump Sum / L.B. / C. _____

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	22/03/2021 10:19 (SGT)
Date of Accident	20/03/2021 12:00 (SGT)
Exact Location of Accident	Pioneer Rd, Singapore
Additional Location Information	ALONG PIONEER RD NEAR LAMP POST 213
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGA12C
-----------------------------------	--------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	JUAN QIRONG(YUAN QIRONG)
NRIC No	SXXXX474E
Email Address	juanqirong@gmail.com
Mobile Phone No	(Phone) +65-96215669
Alternative Phone No	+65-96215669

VEHICLE PARTICULARS

Manufacturer	Volkswagen
Model	Golf
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1984

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMPCSNW00193882000
Cover Note Number	-

DRIVER

Name of Driver	JUAN QIRONG(YUAN QIRONG)
NRIC No	SXXXX474E

Birth	09/12/1987
Location	Indoor
Date Of Driving Pass	26/02/2008
Driving experience	13 YEARS AND 1 MONTH
Gender	Male
Mobile Number	(Phone) +65-96215669
Alt. Phone Number	+65-96215669
Email Address	juanqirong@gmail.com
Address	62 CHESTNUT AVE #03-07
Address complement	-
Postcode	679518
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Change/cross lane
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

ON 20/3/2021 AT ABOUT 1200HRS. I WAS TRAVELLING ALONG PIONEER RD. I WAS TRAVELLING STRAIGHT ALONG THE SAID ROAD WHEN SUDDENLY I FELT AN IMPACT ON MY REAR RIGHT SIDE AND REALISED THAT VEHICLE B HAD CUT INTO MY LANE AND HIT ONTO MY VEHICLE.

ATTACHMENT(S)


Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	XE5948Y
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	NAGARAJAN RAGHU
Passport No/FIN	-1

SKETCH PLAN

Along Pioneer Rd near Lamp post #13

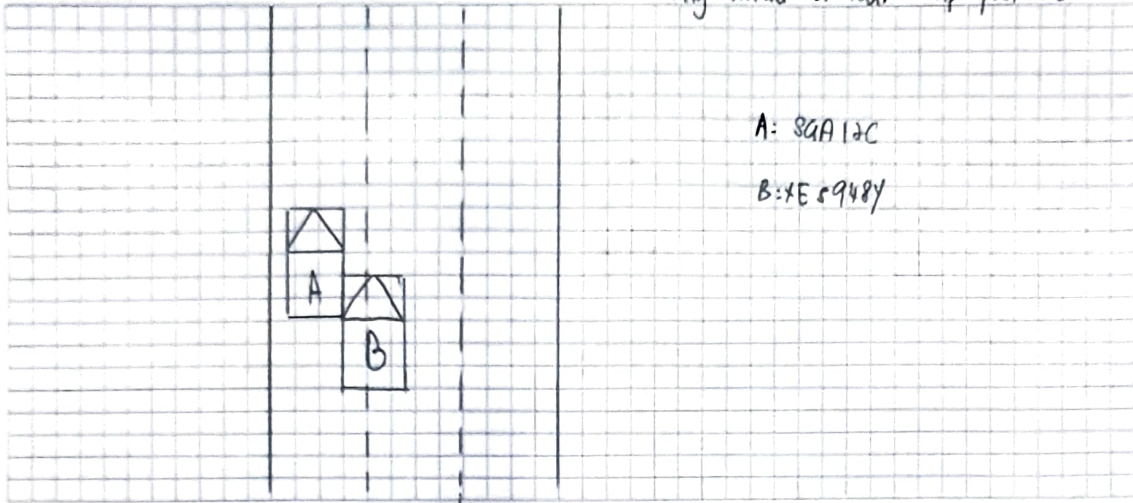

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On ~~road~~ at about 000hrs. I was traveling along Pioneer Rd. I was travelling straight along the said road when suddenly I felt an impact on my rear right side and realised that vehicle B had cut into my lane and hit onto my vehicle.


DECLARATION

I/We declare the foregoing particulars are true in every respect.


 Policyholder's Signature

Date & Time: 20/3/21

 Driver's Signature
 (If driver is not the policyholder)
 Date & Time:


 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

GLARVIC SketchPlanForm_V3

Inquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	474E
Vehicle Details	
Vehicle No.:	SGA12C
Vehicle to be Exported:	No
Intended Deregistration Date:	24 Mar 2021
Vehicle Make:	VOLKSWAGEN
Vehicle Model:	GOLF GTI 2.0 TSI 5G19TY
Primary Colour:	Silver
Manufacturing Year:	2013
Engine No.:	CHH010045
Chassis No.:	WVWZZZAUZEW055330
Maximum Power Output:	162.0 kW (217 bhp)
Open Market Value:	\$33,669.00
Original Registration Date:	27 Sep 2013
First Registration Date:	27 Sep 2013
Transfer Count:	4
Actual ARF Paid:	\$34,137.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Sep 2023
PARF Rebate Amount:	\$20,482.00
Intended COE Rebate Details	
COE Expiry Date:	26 Sep 2023
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$86,239.00
COE Rebate Amount:	\$21,607.00
Total Rebate Amount:	\$42,089.00

The information contained herein is correct as at 24 Mar 2021

OK

Auto Insure Pte. Ltd
Marsiling Lane
739145



Insurer Reference: SGA12C
Repairer Reference: M1874 / SGA12C
Date calculated: 24/03/2021 2:41 PM

Full Report
Registration: SGA12C
Printed: 24/03/2021 2:41 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Min Seng Chong	Currency:	SGD
Claim Reference:	SGA12C	Date of Incident:	20/03/21
Estimated Repair Time:	9	Hire Car Start:	
Actual Repair Days:	9	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	VW
Model:	GOLF (5G)
Sub Model:	GTI
Model Sheet Number:	06 B1 04
Registration:	SGA12C
VIN number:	WVWZZZAUZEW055330
Odometer:	76139

Model Specs

FROM 05.2013	SPEAK CONTROL	OCCUPANT PROTECT SYS	WHEELS 7.5J X 18 ALU
TYRES 225/40 R18..Y	BLUE MOTION TECHNO	CHROME PACKAGE	CLIMATRONIC
D/MIRROR W/AMBIENT	XENON HEADLAMP/LED	LIGHT-/RAIN SENSOR	FRT/RR ELECT WINDOWS
KEYLESS ENTRY	REAR SPOILER	AUTO DIPPING MIRROR	8 SPEAKER
MULTIMEDIA SYSTEM	NAVI "DISCOVER PRO"	FOG LAMPS	LIGHT SWITCHING AUTO
HEADLAMP WASHERS	PARK ASSISTENT	LEATHER TRIM	HEATED FRONT SEATS
STRG WHEEL LEATHER	DOOR TRIM IMIT LEATH	ANTI-THEFT ALARM	STOP-START SYSTEM
MULTI FUNC INDICATOR	R/F ELECTRIC SEAT	INTER LIGHT AMBIENCE	FRONT CENTRE ARMREST
REAR CENTRE ARMREST	SMOKER EQUIPMENT	ALTERNATOR 140A	HD COOLING
1984CCM 162KW	6 SPEED DSG	DYNAMIC STEERING	SELECT DRIVE
ADAPTIVE SUSPENSION	SPACE SAVER SP-WHEEL	ELECT LUMBAR ADJUST	RR DUAL EXHAUST PIPE
PANORAMA SUNROOF	5-DOOR	CRUISE CONTROL	TWO COAT METALLIC
FRONT BRAKE 312 X 25			

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☒

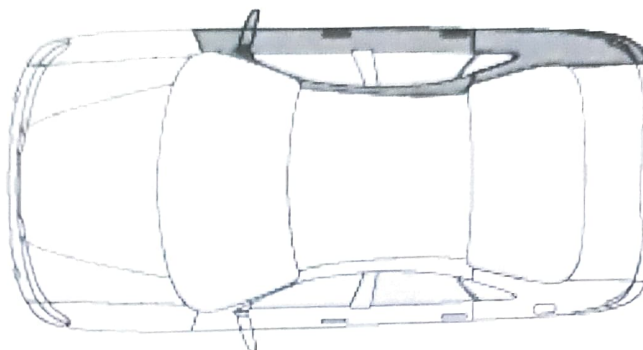

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
44 95 03 00	ALIGN VEHICLE FRONT AND REAR (BEFORE REPAIRS) INCLUDES: CAMBER AND TOE CHECK , BRKT AND SENSOR REMOVE AND REFIT WITHOUT ADJUSTMENTS		10.0	42.00
57 11 19 00	R + R R/F DOOR HANDLE INCLUDES: R + R LOCK CYLINDER		3.0	12.60
58 51 19 00	R + R RIGHT REAR DOOR		3.0	12.60
58 51 55 53	RENEW RIGHT REAR DOOR (DOOR REMOVED) INCLUDES: R + R ALL PARTS		20.0	84.00
63 69 55 63	RENEW REAR BUMPER COVER (REMOVED) INCLUDES: R + R NUMBER PLATE LAMPS AND PARKING AID SENSORS		7.0	29.40
63 69 41 50	REPAIR REAR BUMPER COVER (COMPOSITE WORK) (4 BRACKET STUCK)		3.0	12.60
63 69 43 60	DRILL REAR BUMPER COVER (COMPOSITE WORK) (DRILL 6 HOLES)		5.0	21.00
63 69 41 60	REPAIR REAR BUMPER COVER (COMPOSITE WORK) (BOND 2 BRACKET)		2.0	8.40
53 55 53 00	R/SIDE SECTION (REMOVAL OF PARTS) INCLUDES: REMOVE TAILLAMPS, BUMPER COVER, WHEELHOUSE LINER, SIDE TRIM, SEAT CUSHION, SEAT BACKREST, INNER SILL MOULDING, LOCK PLATE, C-PILLAR TRIM, BOOT COVER, SEAT BELT, BOOT COVER GUIDES		11.0	46.20

Code	Description	WU	Price SGD
	AND BOOT TRIM		
53 55 55 00	RENEW RIGHT SIDE PANEL	74.0	310.80
53 55 59 00	ASSEMBLE R/SIDE PANEL PARTS	16.0	67.20
	INCLUDES: DISMANTLED PARTS FIT IF NECESS		
	RENEW, LIGHT CHECK		
53 56 55 50)	RENEW R/LOWER SIDE PANEL (COMP WORK)	25.0	105.00
47 41 19 50)	DETACH + REFIT R/R BRAKE CALIPER	1.0	4.20
46 15 19 50)	R + R RIGHT REAR BRAKE CALIPER CARRIER	1.0	4.20
42 93 19 50)	DETACH + REFIT RIGHT REAR SHOCK ABSORBER	1.0	4.20
42 93 19 50)	R + R RIGHT REAR SHOCK ABSORBER	2.0	8.40
42 11 19 50)	R + R R/R LOWER CONTROL ARM	2.0	8.40
	(WHEEL AND COIL SPRING REMOVED)		
	(CONTROL ARM DETACHED)		
42 35 19 50)	R + R R/R UPPER CONTROL ARM	1.0	4.20
	(WHEEL AND COIL SPRING REMOVED)		
	(CONTROL ARM DETACHED)		
42 11 19 52)	R + R R/R CONTROL ARM	2.0	8.40
42 52 19 50)	R + R R/R WHEEL BEARING HOUSING	7.0	29.40
	(WHEEL REMOVED)		
	INCLUDES: R + R COIL SPRING,		
	DETACH + REFIT BRAKE CALIPER, CONTROL		
	ARM AND COUPLING ROD		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR		
01 50 00 ZAX	GFS / GUIDED FUNCTION	2.0	8.40
	(READ AND DELETE ERROR MEMORY		
	AFTER REPAIR)		
44 12 55 50)	RENEW R/R WHEEL (WHEEL REMOVED)	2.0	8.40
44 05 93 55	BALANCE R/R WHEEL (WHEEL REMOVED)	1.0	4.20
44 95 03 00	ALIGN FRONT AND REAR VEHICLE	10.0	42.00
	INCLUDES: CHECK TOE AND CAMBER,		
	R + R BRACKET AND ALIGNMENT SENSOR		
	DOES NOT INCLUDE: ADJUSTMENT		
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT	2.0	8.40
	(COMPOSITE WORK)		
	(FRONT AND REAR VEHICLE ALIGNMENT)		
44 93 15 50	REAR WHEEL TOE ALIGNMENT	2.0	8.40
	(COMPOSITE WORK)		
	(VEHICLE FRONT AND REAR ALIGNMENT)		
1482	RIGHT FRONT DOOR REPAIR	20.0*	84.00
4102	R/R INNER SIDE PANEL REPAIR	30.0*	126.00
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	24.10	241.0
	Alignment		1,012.20
	Measuring Work	2.40	24.0
	Total of Labour		100.80
			1,113.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	R/R DOOR NEW PART PAINTING	13.0
	R/SIDE PANEL NEW PART PAINTING	24.0
	R/F DOOR OUT HANDLE NEW PART PAINT K1R	3.0

nt Work
ode

SYSTEM AZT

Time Basis 10 WU/h

Description - TWO COAT METALLIC

WU Price SGD

REAR COVER BUMPER NEW PART PAINT K1R	12.0
R/R OUTER SENSOR NEW PART PAINT K1R	3.0
RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0
R/R INNER SIDE PANEL SURFACE PAINT	5.0

Paint Material Per Part

Code	Description	Price SGD
1782	R/R DOOR NEW PART PAINTING	33.54
3482	R/SIDE PANEL NEW PART PAINTING	30.80
1562	R/F DOOR OUT HANDLE NEW PART PAINT K1R	0.98
2583	REAR COVER BUMPER NEW PART PAINT K1R	56.09
2780	R/R OUTER SENSOR NEW PART PAINT K1R	0.49
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	33.18
4102	R/R INNER SIDE PANEL SURFACE PAINT	5.98

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		84.0	
Preparation Main Work Metal	2.10	21.0	88.20
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	11.00	110.0

Material Cost - Paint

	Price SGD
New Part Painting	64.34
New Part Painting - Plastic K1R	57.56
Repair Painting	33.18
Surface-/Blend Paint	5.98
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	188.16

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
2799	2-COMP ADHESIVE SENS	180 KU2 A1	Original	0.00
2798	APPLICATOR	D 009 500 25	Original	0.00
2787	L/R CTR SENSOR BRKT	5G0 919 491	Original	22.00
2789	L/R INN SENSOR BRKT	5G0 919 491 A	Original	22.00
2795	L/R OUT SENSOR BRKT	5G0 998 492	Original	17.00
		GRU		
2797	PLASTIC PRIMER	D 822 150 A1	Original	0.00
1562	R/F DOOR OUT HANDLE	5G0 837 206 Q	Original	290.00
		GRU		
9384	R/R AXLE STEERING	5Q0 505 224 D	Original	240.00
2620	R/R BUMPER GUIDE	5G6 807 394	Original	25.00
2788	R/R CTR SENSOR BRKT	5G0 919 491	Original	22.00
1782	R/R DOOR	5G4 833 056 AD	Original	960.00

	Description	Part Number	Part Source	Price SGD
2790	R/R INN SENSOR BRKT	5G0 919 492 A	Original / NUC	22.00
2786	R/R LWR CONTROL ARM	5Q0 505 311 J	Original / NUC	145.00
2782	R/R OUTER LAMP	5G0 945 096 M	Original / NUC	145.00
2780	R/R OUTER SENSOR	5Q0 919 275 B	Original / M13	105.00
		GRU		
2796	R/R OUT SENSOR BRKT	5G0 998 492	Original / NUC	17.00
		GRU		
9202	R/RR SHOCK ABSORBER	5Q0 513 045 AJ	Original / ?	505.00
9388	R/R UPP CONTROL ARM	5Q0 505 323 D	Original / ?	150.00
9552	R/R WHEEL	5G0 601 025 AS	Original / Cyt	865.00
		FZZ		
9306	R/R WHEEL BRG HSG	5Q0 505 436 F	Original / Tum	380.00
9182	R/R WHEEL HUB/BRG	5Q0 598 611	Original / NUC	330.00
3482	R/SIDE PANEL	5G4 809 844	Original / CNU	780.00
2583	REAR COVER BUMPER	5G6 807 417 AP	Original / CNU	660.00
		GRU		
f: OEM Parts				0.00
n: Non-OEM Parts				5,702.00
u: Used parts				5,702.00
Savings				
Subtotal				
Total				

Extras

Code	Description	Price SGD
1000	REAR BUMPER CLIPS REAR / NUC	50.00*30
1001	TOWING CHARGES / NUC	80.00*
1002	REAR WHEEL TYRE LH REAR / BR	220.00*
Total Extras		350.00

Final Calculation

	SGD	SGD
Parts	5,702.00	
Total Parts		5,702.00
Labour Time Base 10 WU/h		
Total 241.0 WU X 42.00 SGD/h	1,012.20	
Alignment		
Measuring Work	100.80	
Total of Labour		1,113.00
Total Of Extras		350.00
Paint Work Time Base 10 WU/h		
Labour Cost 110.0 WU X 42.00 SGD/h	462.00	
Material Cost	188.16	
Total Paint Including Material		650.16
Repair Cost Excludes GST		7,815.16
GST (+7.00%)		547.06
Repair Cost Included GST		8,362.22

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Repair day -7~~8~~ days

L/S

After paint photo

Sm Pin(Lik)

25/03/2021

TP without prejudice

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: