



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD  
#17-00 TOWER BLOCK  
MND COMPLEX  
SINGAPORE 069110

INV No. AC2102879

INV Date 26/04/2021

Reference CC3/EQI21003927/Kqf3e2

Code EQI

### PROFESSIONAL SERVICE FEE

Vehicle No. SHD 636A

Insured Veh. FBS 935D

Claim No. DM21HO00457-JG

Policy No.

Accident Date 19/03/2021

Inspection Date 23/03/2021

Description	Total
Survey Inspection	300.00
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>300.00</b>
<b>GST (7%)</b>	<b>21.00</b>
<b>Grand Total</b>	<b>321.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**KHM**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Ref: CC3/EQI21003927/Kqf3e2 Date: 26/04/2021  Code: EQI	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>			
Insured Veh.	FBS 935D	Veh. Inspected	SHD 636A
Policy No.		Coverage (\$)	0.00
Claim No.	DM21HO00457-JG	Excess (\$)	0.00
Assign From		Assign Date	23/03/2021
<b>2. Vehicle Particulars &amp; Condition</b>			
Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	VF1ABL15AUC283390	Colour	METALLIC WHITE / RED
Odometer	440044 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
<b>3. Conditions of Tyres</b>			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	SAILUN	6 mm
L/H Front Tyre	215/60 R16	SAILUN	6 mm
R/H Rear Tyre	215/60 R16	SAILUN	8 mm
L/H Rear Tyre	215/60 R16	SAILUN	8 mm
<b>4. Description of Damages</b>			
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.			
<b>5. General Information</b>			
Accident Date	19/03/2021	Inspection Date	23/03/2021
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
<b>5a. Remarks</b>			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
<b>5b. Estimate Days of Repair</b>			
ESTIMATED NORMAL PERIOD FOR REPAIR:		8 Working Days	



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 636A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	DOOR PANEL FRT RH	BENT	2,844.66	2,844.66
1	DOOR WEATHERSTRIP FRT RH	SERVICEABLE	410.27	-
1	DOOR HINGE UPPER FRT RH	TO REPAIR SEE LABOUR	261.28	-
1	DOOR HINGE LOWER FRT RH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR REGULATOR FRT RH	SERVICEABLE	505.19	-
1	DOOR REGULATOR MOTOR FRT RH	SERVICEABLE	796.46	-
1	DOOR HANDLE OUTER FRT RH	SERVICEABLE	477.76	-
1	DOOR HANDLE MODULE FRT RH	SERVICEABLE	133.60	-
1	DOOR PANEL REAR RH	BENT	2,844.66	1,458.00
1	DOOR HINGE UPPER REAR RH	TO REPAIR SEE LABOUR	241.60	-
1	DOOR HINGE LOWER REAR RH	DISTORTED	169.90	169.90
1	DOOR REGULATOR REAR RH	DISTORTED	450.60	450.60
1	DOOR REGULATOR MOTOR REAR RH	JAMMED	758.10	758.10
1	DOOR HANDLE OUTER REAR RH	SERVICEABLE	42.10	-
1	DOOR HANDLE MODULE REAR RH	SERVICEABLE	133.40	-
1	DOOR GLASS REAR RH	SHATTERED	364.70	364.70
1	DOOR 1/4 GLASS REAR RH	SHATTERED	229.20	229.20
1	DOOR MOULDING REAR RH	DENTED	100.50	100.50
1	DOOR FINISHER REAR RH	SERVICEABLE	230.30	-
1	DOOR SEAL REAR RH	SERVICEABLE	119.80	-
1	DOOR FINISHER INNER REAR RH	SERVICEABLE	183.70	-
1	DOOR GLASS RUNNER SEAL REAR RH	CUT	116.10	116.10
1	DOOR WAIST SEAL OUTER REAR RH	SERVICEABLE	99.40	-
1	BUMPER COVER REAR	TO REPAIR SEE LABOUR	561.70	-
1	BUMPER LOWER REAR	SERVICEABLE	411.90	-
1	FENDER PANEL REAR RH	BENT	1,933.20	1,933.20
1	WHEELARCH REAR RH	SERVICEABLE	275.40	-
1	TAILLAMP RH	CRACKED	401.40	401.40

Report Ref No. CC3/EQI21003927/Kqf3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ROCKER PANEL OUTER RH	BENT	1,184.99	1,184.99
	LESS 10% DISCOUNT		-1,658.24	-1,001.14
			14,924.18	9,010.21
1	DOOR WEATHERSTRIP REAR RH (SN) (\$311.60) (50%)	CUT	311.60	155.80
	LESS 10% DISCOUNT		-31.16	-
			280.44	155.80
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR BUMPER CLIP (SN)	NOT NECESSARY	65.00	-
1	SET FENDER SCREW (SN)	NOT NECESSARY	60.00	-
1	TYRE (SN)	SERVICEABLE	300.00	-
1	RIM (SN)	SERVICEABLE	350.00	-
1	DOOR FINISHER CLIP (SN)	NOT NECESSARY	60.00	-
1	DOOR MOULDING CLIP (SN)	NOT NECESSARY	60.00	-
1	DOOR STICKER TRANSCAB (SN)	NECESSARY	100.00	60.00
1	DOOR STICKER TEL NO. (SN)	NECESSARY	100.00	60.00
1	DOOR STICKER CLASSIC (SN)	NECESSARY	100.00	15.00
2	WINDSCREEN SEALANT (SN)	NECESSARY	150.00	40.00
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	130.00	30.00
			1,675.00	205.00
	<b><u>LABOUR</u></b>			
	TOWING FEES.		170.00	50.00
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.		300.00	120.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIT REAR W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.		300.00	120.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHERS, TO ENABLE REPAIR.		380.00	100.00

Report Ref No. CC3/EQI21003927/Kqf3e2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF DOOR HINGE UPPER FRT RH, DOOR HINGE LOWER FRT RH, DOOR HINGE UPPER REAR RH AND BUMPER COVER REAR.		1,400.00	1,200.00
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		240.00	120.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		1,400.00	1,100.00
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
			4,750.00	2,830.00
GRAND TOTAL			21,629.62	12,201.01
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,750.00

Report Ref No. CC3/EQI21003927/Kqf3e2

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission ..... 20/03/2021 01:09 (SGT)  
Date of Accident ..... 19/03/2021 15:40 (SGT)  
Exact Location of Accident ..... Indus Rd, Singapore  
Additional Location Information ..... JUNCTION OF INDUS ROAD AND GANGES AVENUE  
Country/State of Loss ..... Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number ..... SHD636A

### INSURED/POLICYHOLDER

Is company? ..... Yes  
Name Of Registered Owner ..... TRANS-CAB SERVICES PTE LTD  
Company Reg No ..... 2XXXXX878K  
Email Address ..... claims@transcab.com.sg  
Mobile Phone No ..... (Phone) +65-62866666  
Alternative Phone No ..... (Office) +65-62866666

### VEHICLE PARTICULARS

Manufacturer ..... Renault  
Model ..... Latitude  
Variant .....  
Exact purpose for which vehicle was being used at time of accident ..... Private hire  
Are you claiming under your own insurance policy for repair to your vehicle? ..... No - Claiming third party  
Vehicle Category ..... Taxi  
Transmission ..... Auto  
CC ..... 1998

### INSURANCE COMPANY

Name of Insurance Company ..... AXA Insurance Pte Ltd  
Type of Coverage ..... ThirdParty  
Fleet Policy ..... Yes  
Policy Number ..... VFX/P2413997  
Cover Note Number ..... -

### DRIVER

Name of Driver ..... BALBIR SINGH S/O KATAR SINGH  
NRIC No ..... SXXXX499I



Date Of Birth	13/07/1961
Occupation	Outdoor
Date Of Driving Pass	27/01/1993
Driving experience	28 YEARS AND 2 MONTHS
Gender	Male
Mobile Number	(Phone) +65-97928906
Alt. Phone Number	-
Email Address	claims@transcab.com.sg
Address	712 Clementi West Street 2
Address complement	#03-185
Postcode	120712
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Cross Junction
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### PASSENGER 1

Name	PASSENGER 1
Gender	Male

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Bukit Merah West Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18003779999
Alt. Police Station Phone No	(Fax) +65-63773923
Police Station Address	500 Bukit Merah View #01-01 Singapore 159682
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT: T/20210320/2025 LODGED AT BUKIT MERAH WEST N P C

#### ATTACHMENT(S)


Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	SD CARD WITH TRAFFIC POLICE
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	FBS935D
-----------------------------	---------



# SKETCH PLAN

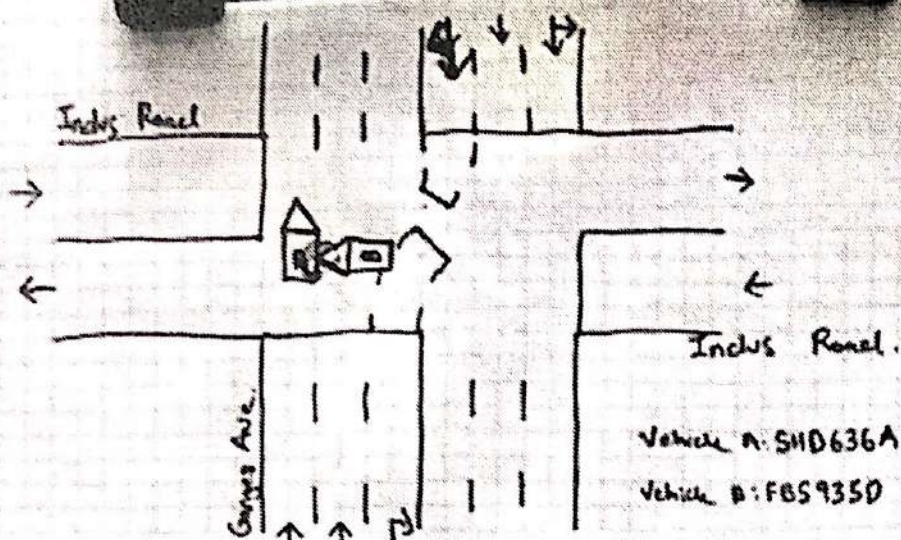

## DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO ATTACHED STATEMENT.

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

VERIFY BY AJAX MARS (ARC)  
REPORTING OFFICER  
MOHAMED SAIFULLAH S/O SYED MASOOD  
Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:





**SINGAPORE  
POLICE FORCE**



T/20210320/2025

1 of 3

Police Station Of Origin:  
Bukit Merah West N.P.C  
500 Bukit Merah View #01-01 SINGAPORE  
159682  
Tel No: 1800-3779999

Report No: T/20210320/2025

**REPORT OF A TRAFFIC ACCIDENT**

Date/Time Report Made: 20/03/2021 10:53	Vide Report No : E/20210319/0075	Station Diary No.: 12
--	-------------------------------------	--------------------------

Name of Informant: BALBIR SINGH S/O KATAR SINGH		Address: APT BLK 712 CLEMENTI WEST STREET 2 #03-185 SINGAPORE 120712	
ID Type / ID No.: NRIC NO / S1479499I		Contact No.:	Mobile: 97028008
Nationality: SINGAPORE CITIZEN		Email:	
Sex: Male	Age: 59	Date of Birth: 13/07/1961	Type of Informant: Driver
Race: Sikh	Language: English		Institution / School Name:
Occupation: Taxi Driver	Driving Licence Information: Class: 3		Date of Expiry:

**General Information of the Accident**

Type of Accident:	Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 19/03/2021 15:30	Type of Location: X-Junction
Location: GANGES AVENUE				
Weather: Clear	Road Surface: Dry		Road Speed Limit:	
Traffic Flow:	Traffic Control: Traffic Light - Working		Traffic Volume: Moderate	
Type of Collision:			Anyone conveyed by ambulance: Yes	

Vehicle No.	Vehicle Type	Make	Model	Color	Condition	No of Passengers
FBS935D	Motorcycle			Black	Slightly Damaged	0
SHD636A	Car	RENAULT		Red	Seriously Damaged	1

Any Pedestrian Involved: No

No. of Pedestrians Injured: NIL

Use of Pedestrian Crossing: NA





**SINGAPORE  
POLICE FORCE**



T/20210320/2025

2 of 3

Police Station Of Origin:  
Sukit Merah West N.P.C  
500 Sukit Merah View #01-01 SINGAPORE  
159682  
Tel No: 1800-3779999

Report No. T/20210320/2025

**CONTINUATION OF REPORT**

Name	BALBIR SINGH S/O KATAR SINGH	ID No.	S14794991
Related Vehicle	SHD636A (Car)	Contact No.	97928906
Hospital/Clinic	CHUNG & EE MEDICAL CLINIC	Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL
Date Treatment	20/03/2021	Date Discharge	NIL
No. of Days granted Medical Leave	05	Degree of Injury	Slight

**Brief Details.**

On 19/03/2021 at about 3.30pm, I was driving my vehicle bearing registration no. SHD635A (V1) along Ganges Ave/Indus Rd Junction going towards Alexandra Rd. The traffic light was green and I proceeded forward. Suddenly in the middle of the junction, there was a motorcycle bearing registration no. FBS935D (V2) came from the right had collided onto the right side of my vehicle and subsequently he fell down. I then came out and assisted the motorcyclist together with a passer by who saw the accident and subsequently called for ambulance.

The damages to my vehicle were dents on the right side passenger door and shattered window. V2 had some slight damage.





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SHD 636A

### INSPECTION







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

