



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2104294

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 16/06/2021
Reference CC4/FCI21004071/Ues3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMT 34T
Insured Veh. GBF 6882B
Claim No. D21000986MFCV/2
Policy No. D-20095487MFCV
Accident Date 27/03/2021
Inspection Date 01/04/2021

Description	Total
Survey Inspection	633.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Less: Discount	-53.00
Subtotal	580.00
GST (7%)	40.60
Grand Total	620.60

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI21004071/Ues3q2	
			Date: 16/06/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBF 6882B	Veh. Inspected	SMT 34T
	Policy No.	D-20095487MFCV	Coverage (\$)	0.00
	Claim No.	D21000986MFCV/2	Excess (\$)	0.00
	Assign From	RACHELWU	Assign Date	30/03/2021
2. Vehicle Particulars & Condition				
	Make & Model	PORSCHE PANAMERA (A)	c.c	2995
	Engine No.	HIDDEN	Year of Reg.	2020
	Chassis No.	WP0ZZZ97ZLL103603	Colour	GREY
	Odometer	8047 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	275/35Z R21	PIRELLI	6 mm
	L/H Front Tyre	275/35Z R21	PIRELLI	6 mm
	R/H Rear Tyre	315/30Z R21 (D)	PIRELLI	6 mm
	L/H Rear Tyre	315/30Z R21 (D)	PIRELLI	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	27/03/2021	Inspection Date	01/04/2021
	Survey held at	SPECIALISTS MOTOR PTE LTD BLK 3018A UBI ROAD 1 #01-24-26 SINGAPORE 408711		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMT 34T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT COVER	DENTED /BENT	4,485.00	4,303.00
1	REAR BOOT COVER SPOILER	NOT NECESSARY	1,125.00	-
1	REAR BOOT WINDSCREEN WITH MOULDING	NOT NECESSARY	2,220.00	-
1	REAR BOOT EMBLEM 'PORSCHE'	NECESSARY	260.00	225.00
1	REAR BUMPER FASCIA	DENTED	2,700.00	2,663.33
1	SET REAR BUMPER CLIPS	NECESSARY	40.00	40.00
2	REAR BUMPER SIDE RETAINER L&RH @\$78.00	NOT NECESSARY	156.00	-
1	REAR BUMPER TOWING COVER	DEFORMED	57.00	57.00
1	REAR BUMPER REINFORCEMENT BEAM	TO REPAIR SEE LABOUR	1,200.00	-
1	REAR BUMPER LOWER LIP	DISTORTED	1,200.00	1,162.75
2	REAR BUMPER LOWER LIP PARKING SENSOR L&RH @ \$270.00	SERVICEABLE	540.00	-
1	REAR BUMPER REFLECTOR RH	CRACKED	87.00	73.90
1	EXHAUST SILENCER RH	TO REPAIR SEE LABOUR	3,300.00	-
1	EXHAUST MUFFLER CHROME RH	BENT	870.00	700.00
	LESS 10% DISCOUNT		-	-922.50
			18,240.00	8,302.48
<u>SPECIAL NETT ITEMS</u>				
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
			40.00	40.00
<u>LABOUR</u>				
	REMOVE & REFIX REAR WINDSCREEN GLASS .		250.00	150.00
	REMOVE & REFIX REAR BOT INNER FURNISHER ,GARNISH ,TRIMMING,TRUNK LID BOARD ,REAR BOOT CENTRAL LOCKING ,MECHANISM LOCK ,ALL AFFECTED PARTS & ETC.		350.00	200.00
	REMOVE & REFIX ,KNOCKING ,STRAIGHTEN & RE-ALIGN REAR BUMPER ,REAR TRUNK LID COVER ,ALL AFFECTED PARTS & ETC.INCLUSIVE OF THE REPAIR OF REAR BUMPER REINFORCEMENT BEAM AND EXHAUST SILENCER RH .		1,800.00	1,000.00
	SPRAY PAINTING ON DAMAGE PARTS.		1,200.00	900.00

Report Ref No. CC4/FCI21004071/Ues3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TUFF-KOTE ON DAMAGE PARTS.		80.00	30.00
	DIAGNOSTIC & RESET AFTER REPAIRS.		380.00	200.00
	CHECK ALL LIGHTING & WIRING AFTER REPAIR .		120.00	20.00
			4,180.00	2,500.00
GRAND TOTAL			22,460.00	10,842.48
RECOMMENDED COST OF REPAIRS				10,842.48

Report Ref No. CC4/FCI21004071/Ues3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMT 34T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMT 34T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

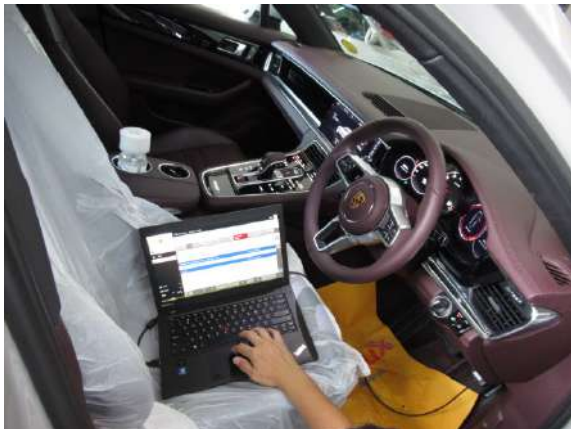



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMT 34T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMT 34T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

