



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2200113

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 06/01/2022
Reference CC4/LPC21004148/Apa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKW 2345R
Insured Veh. YM 8468S
Claim No. 20/21/21/VC00/024388
Policy No. Z/20/VC00/108955
Accident Date 30/03/2021
Inspection Date 05/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21004148/Apa3q2 Date: 06/01/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YM 8468S	Veh. Inspected	SKW 2345R	
Policy No.	Z/20/VC00/108955	Coverage (\$)	0.00	
Claim No.	20/21/21/VC00/024388	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	31/03/2021	
2. Vehicle Particulars & Condition				
Make & Model	AUDI Q7	c.c	2995	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	WAUZZZ4M4GD010593	Colour	SILVER	
Odometer	112122 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	285/45 R20	SCORPION	6 mm	
L/H Front Tyre	285/45 R20	SCORPION	6 mm	
R/H Rear Tyre	285/45 R20	SCORPION	6 mm	
L/H Rear Tyre	285/45 R20	SCORPION	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/03/2021	Inspection Date	05/04/2021	
Survey held at	PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1 . SINGAPORE 408699			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKW 2345R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER (SN)	DEFORMED	2,724.00	2,724.00
1	FRONT BUMPER FIXING PARTS (SN)	NOT NECESSARY	447.00	-
1	FRONT BUMPER AIR GUIDE -INNER (SN)	NOT NECESSARY	67.00	-
1	FRONT BUMPER END CAP -RH (SN)	NOT NECESSARY	36.00	-
1	FRONT BUMPER LOWER GRILLE -CENTER (SN)	NOT NECESSARY	206.00	-
1	FRONT BUMPER CLOSING ELEMENT(SN)	NOT NECESSARY	210.00	-
1	FRONT BUMPER SPOILER RH (SN)	TO REPAIR SEE LABOUR	211.00	-
1	FRONT BUMPER OUTER SPOILER -RH (SN)	TO REPAIR SEE LABOUR	44.00	-
1	FRONT BUMPER AIR GUIDE GRILLE -RH (SN)	DAMAGED	297.00	297.00
1	FRONT BUMPER AIR GUIDE GRILLE END CAP -RH (SN)	NOT NECESSARY	34.00	-
1	FRONT BUMPER AIR GUIDE GRILLE SPRING CLIP -RH (SN)	NOT NECESSARY	4.00	-
1	FRONT BUMPER AINNER SPOILER -RH (SN)	NOT NECESSARY	59.00	-
1	FRONT BUMPER GUIDE SECTION (SN)	NOT NECESSARY	44.00	-
1	FRONT BUMPER FOAM FILLER PIECE (SN)	NOT NECESSARY	171.00	-
1	FRONT BUMPER CARRIER (SN)	NOT NECESSARY	964.00	-
1	FRONT FENDER -RH (SN)	TO REPAIR SEE LABOUR	1,620.00	-
1	FRONT FENDER ATTACHMENT PARTS -RH (SN)	NOT NECESSARY	76.00	-
1	FRONT FENDER BRACKET -RH (SN)	NOT NECESSARY	65.00	-
1	FRONT FENDER BRACE -RH (SN)	NOT NECESSARY	101.00	-
1	'S-LINE' EMBLEM (SN)	NECESSARY	128.00	127.50
2	FRONT WHEEL HOUSING LINER -SHORT /LONG -RH (SN)	NOT NECESSARY	480.00	-
1	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS (SN)	NOT NECESSARY	183.00	-
1	FRONT WISHBONE LINE LH -LOWER (SN)	NOT NECESSARY	131.00	-
1	'CAUTION' STICKER (SN)	NOT NECESSARY	14.00	-
1	HEADLIGHT MOUNTING BEAM (SN)	NOT NECESSARY	118.00	-
1	HEADLIGHT -RH (SN)	CUT	12,792.00	12,792.00
1	HEADLIGHT LIFT CYLINDER -RH (SN)	NOT NECESSARY	198.00	-
2	FRONT WHEEL COVER (SN)	NECESSARY	1,150.00	1,150.00

Report Ref No. CC4/LPC21004148/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR -RH (SN)	NOT NECESSARY	695.00	-
1	SUNDRIES (SN)	NECESSARY	350.00	67.60
			23,619.00	17,158.10
	LABOUR			
	TO REMOVE CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS ,HORNS ,OUTSIDE TEMPERATURE SENSOR ,HEADLIGHT WASHER ASSY AND FRONT PARKING.		480.00	480.00
	TO REMOVE AND TRANSFER RHS HEADLIGHTS'S CONTROL UNIT AND POWER MODULE.		450.00	450.00
	TO DISMABNTLE AND REINSTALL RHS FRONT DOOR PANEL TRIM.TO REMOVE AND REINSTALL RHS WING MIRROR ASSY .		280.00	280.00
	TO DISMANTLE AND RENEW FRONT BUMPER ,RHS FRONT FENDER AND RHS HEADLIGHT .RE-ORGANIZE CRASH MANAGEMENT COMPONENTS .REINSTALL ALL PARTS REMOVED.INCLUSIVE OF THE REPAIR OF FRONT BUMPER SPOILER RH,FRONT BUMPER OUTER SPOILER -RH AND FRONT FENDER -RH .		2,700.00	900.00
	TO RESPRAY FRONT BUMPER ,RHS FRONT BUMPER LOWER SPOILER ,RHS FRONT FENDER ,DOOR COVER AND BOTH WHEEL ARCH TRIM .		5,000.00	3,000.00
	TO CARRY OUT DIAGNOSTIC CHECK.		192.00	192.00
			9,102.00	5,302.00
GRAND TOTAL			32,721.00	22,460.10
RECOMMENDED COST OF REPAIRS				22,460.10

Report Ref No. CC4/LPC21004148/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKW 2345R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

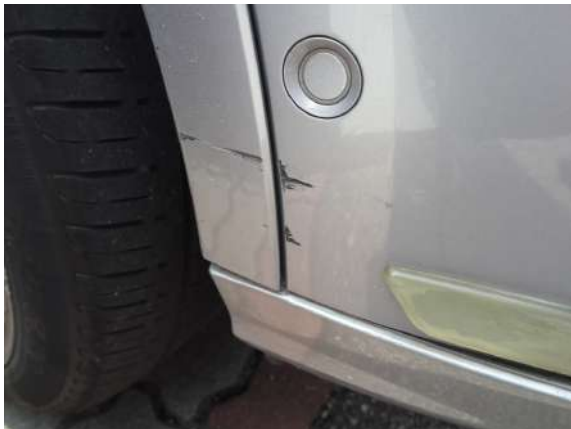



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKW 2345R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKW 2345R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

