



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2201363

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 14/03/2022
Reference CC3/CTI21004181/Tes3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHA 7743T
Insured Veh. XE 316D
Claim No. SNM21D201861/C02
Policy No. DMCVSNW00004112102
Accident Date 25/03/2021
Inspection Date 26/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21004181/Tes3q2 Date: 14/03/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 316D		Veh. Inspected	SHA 7743T
Policy No.	DMCVSNW00004112102		Coverage (\$)	0.00
Claim No.	SNM21D201861/C02		Excess (\$)	0.00
Assign From			Assign Date	26/03/2021
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ		c.c	1580
Engine No.	HIDDEN		Year of Reg.	2020
Chassis No.	KMHC851CVLU189609		Colour	BLUE
Odometer	55714 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	GOOD			
3. Conditions of Tyres				
		Size	Make	Balance
R/H Front Tyre	195/65 R15		MICHELIN	6 mm
L/H Front Tyre	195/65 R15		MICHELIN	6 mm
R/H Rear Tyre	195/65 R15		MICHELIN	6 mm
L/H Rear Tyre	195/65 R15		MICHELIN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	25/03/2021		Inspection Date	26/03/2021
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHA 7743T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	459.40	459.40
2	REAR BUMPER SIDE BRACKET RH/LH @\$55.80	NOT NECESSARY	111.60	-
10	REAR BUMPER CLIPS	NECESSARY	22.00	22.00
1	REAR BUMPER REINFORCEMENT	CRACKED	394.80	394.80
2	REAR BUMPER REINFORCEMENT BRACKET LH/RH @\$138.10	NOT NECESSARY	276.20	-
1	BOOTLID	BENT	2,480.40	2,480.40
1	BOOTLID TRIMBOARD	NOT NECESSARY	343.90	-
2	BOOTLID HINGE LH/RH @\$31.30	TO REPAIR SEE LABOUR	71.30	-
1	BOOTLID LOCK UPPER	NOT NECESSARY	224.00	-
1	BOOTLID H EMBLEM	NECESSARY	28.00	28.00
1	BOOTLID HYBRID	NECESSARY	24.30	24.30
1	BOOTLID LONIQ	NECESSARY	31.30	31.30
2	BOOTLID LAMP LH/RH @\$794.40	CRACKED	1,588.80	1,588.80
1	BOOTLID UPPER GLASS	NOT NECESSARY	907.20	-
1	BOOTLID LOWER GLASS	CUT	584.90	584.90
2	TAIL LAMP LH/RH @\$870.40	NOT NECESSARY	1,740.80	-
1	REAR BUMPER CENTRE MOULDING	DEFORMED	451.25	451.25
1	REAR BUMPER LOWER MOULDING	NOT NECESSARY	155.00	-
1	REAR TOW HOOK COVER	NOT NECESSARY	94.60	-
1	REAR BUMPER FOG LAMP	NOT NECESSARY	201.50	-
2	NUMBER PLATE LAMP LH/RH @\$85.30	NOT NECESSARY	170.60	-
1	REAR BUMPER CENTRE UNDER COVER	NOT NECESSARY	123.85	-
1	REAR END PANEL	BENT	532.00	532.00
1	REAR PANEL GARNISH	NOT NECESSARY	346.80	-
2	REAR BUMPER REFLECTOR LH/RH @\$41.45	NOT NECESSARY	82.90	-
1	BLIND SPOT REAR	NOT NECESSARY	125.00	-
1	ANTENNA ASSY -SMART	NOT NECESSARY	40.50	-
1	REAR BUMPER TOW COVER	NOT NECESSARY	98.80	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 20% DISCOUNT		-2,342.34	-1,319.43
			9,369.36	5,277.72
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE /W HOLDER (SN)	NOT NECESSARY	55.00	-
1	REAR REVERSE SENSOR (SN)	NOT WORKING	180.00	180.00
1	BOOTLID APP LOGO STICKER (SN)	NECESSARY	40.00	40.00
2	BOOTLID COMFORT LOGO /TEL NO.STICKER (SN)	NECESSARY	60.00	60.00
			335.00	280.00
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF BOOTLID HINGE LH/RH.		1,400.00	750.00
	SPRAY PAINTING CHARGE.		1,000.00	750.00
	CHECK WIRING.		60.00	30.00
	DIAGNOSE /RESET ERASE FAULT CODE.	NOT NECESSARY	240.00	-
	TUFF KOTE.		120.00	30.00
	REMOVE/REFIX REVERSE SENSOR .		60.00	30.00
			2,880.00	1,590.00
GRAND TOTAL			12,584.36	7,147.72
RECOMMENDED COST OF REPAIRS				7,147.72

Report Ref No. CC3/CTI21004181/Tes3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 7743T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

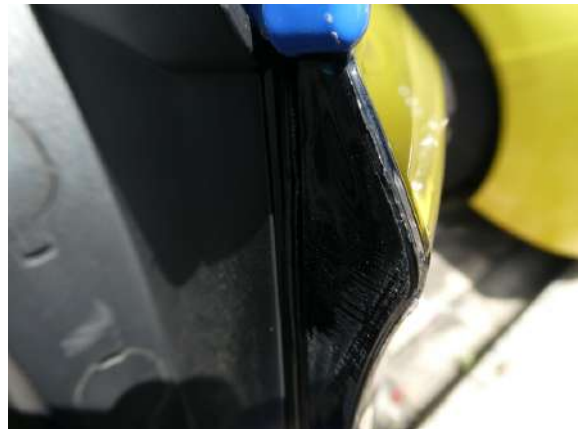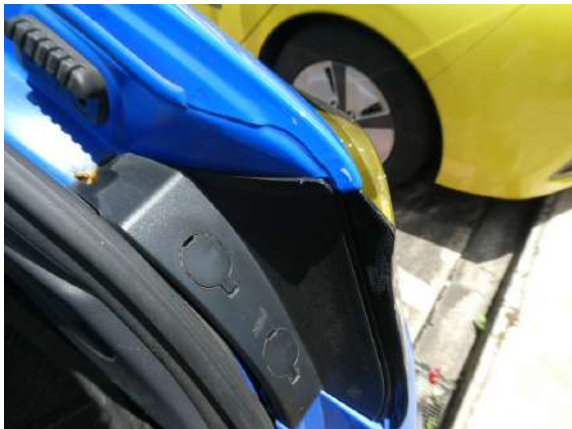



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

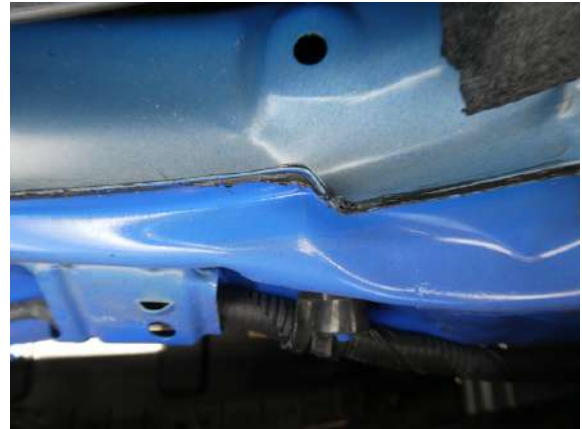



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 7743T

RE-INSPECTION

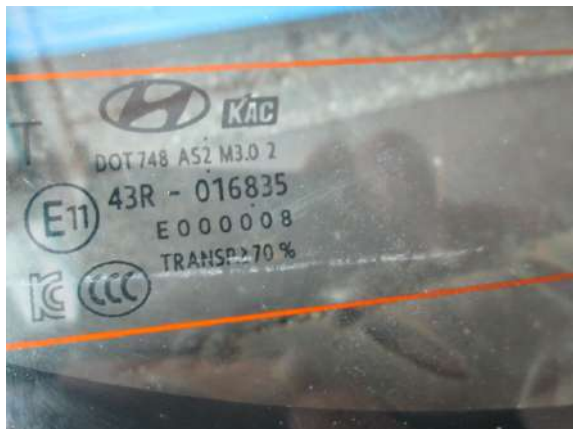



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

