



55 UBI ROAD 1, SINGAPORE 406699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0273/2021/HR
DATE : 31-Mar-21
WIP : 21696

VEHICLE TOWED IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 1/4/21

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR. TAY CHING KOCK
ADDRESS : 235 PASIR RIS ST 21
#02-59
SINGAPORE 510235
TELEPHONE : 65 93850621
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 1900173682-01
VEHICLE NO : **SMP 9739 E**
MODEL CODE : A6 2.0 TFSI S TRONIC
MODEL YEAR : 24/10/2019
ENGINE NO : DLH 065560
CHASSIS NO : WAUZZZF29LN016034
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 31-Mar-21
PLACE OF ACCIDENT : LOYANG AVENUE

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMP 9739 E

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID.	S/N \$ 480.00	✓ ✓
2	TO REMOVE AND RENEW AIRCON CONDENSER, CHARGED AIR COOLER AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS. (R1234)	S/N \$ 1,700.00	? ✓
3	TO DISMANTLE AND REINSTALL BOTH FRONT DOOR PANEL TRIMS. TO REMOVE AND REINSTALL BOTH WING MIRROR ASSYS. <i>LH only.</i>	S/N \$ 800.00	360 ✓
4	TO REMOVE AND TRANSFER BOTH HEADLIGHTS CONTROL UNITS AND POWER MODULES.	S/N \$ 800.00	250 500
5	TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND BOTH HEADLIGHTS. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 6,300.00	3500 1500 (without lock carrier) X 2750 (with lock carrier)
6	TO RESPRAY FRONT BUMPER, BONNET, HINGES, BOTH FRONT FENDERS, BOTH UPPER A-PILLARS AND BOTH FRONT DOORS. <i>LH only.</i>	\$ 7,800.00	3300 7 x 530 = 3710 3850 ✓
7	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 384.00	✓ ✓
TOTAL LABOUR CHARGES		\$ 18,264.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 9739 E

					DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS		
1	FRONT BUMPER <i>Distorted</i>	1	\$	2,832.00	✓	2265.60
2	FRONT BUMPER FIXING PARTS <i>new</i>		\$	650.00	✓	
③	FRONT BUMPER CLOSING ELEMENT - CTR <i>new corrected</i>	1	\$	222.00	✓	177.60
4	FRONT BUMPER ADAPTER - LH / RH <i>Not new</i>	2	\$	78.00	7 X	
5	FRONT BUMER REINFORCEMENT - LH / RH <i>Not new</i>	2	\$	222.00	7 X	
6	FRONT BUMPER LOWER GRILLE - CTR <i>2 behind</i>	1	\$	153.00	✓	122
7	FRONT BUMPER LOWER CLOSING ELEMENT <i>Not new</i>	1	\$	210.00	✓	
8	FRONT BUMPER SPOILER <i>new</i>	1	\$	252.00	✓	
9	FRONT BUMPER AIR GUIDE GRILLE - LH / RH	2	\$	868.00	✓	
10	FRONT BUMPER OUTER AIR GUIDE - LH / RH <i>new</i>	2	\$	58.00	✓	
11	FRONT BUMPER INNER AIR GUIDE - LH / RH	2	\$	42.00	✓	
12	FRONT RADIATOR GRILLE <i>smashed</i>	1	\$	2,217.00	✓	1773.60
13	FRONT RADIATOR GRILLE COVER	1	\$	54.00	✓	43.20
14	FRONT RADIATOR COVER CAP	1	\$	89.00	✓	70.96
15	FRONT RADIATOR BRACKET	1	\$	93.00	✓	74.32
16	FRONT RADIATOR SECURING PLATE	1	\$	84.00	✓	66.72
①7	FRONT CAMERA <i>cut</i>	1	\$	906.00	✓	724.80
18	FRONT CAMERA ADAPTER CABLE <i>Not new</i>	1	\$	416.00	7 X	
19	FRONT CAMERA FLAT CONNECTOR BRACKET <i>Not new</i>	1	\$	14.00	7 X	
20	FRONT CAMERA CONNECTOR HOUSING BRACKET <i>Not new</i>	1	\$	28.00	7 X	
SUB TOTAL SPARE PARTS			:	\$		9,488.00

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.




55 UBI ROAD 1, SINGAPORE 408699
TEL: 6366 2323 FAX: 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 9739 E

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT BUMPER WIRING SET <i>3 new</i>	1	\$ 577.00	X
22	FRONT PARKING AID SENSOR	4	\$ 1,074.00	X
23	FRONT PARKING AID SENSOR ASSIST <i>Not new</i>	1	\$ 268.00	X
24	FRONT PARKING AID SENSOR SEAL RING <i>Not new</i>	6	\$ 21.00	X
25	FRONT BUMPER FOAM FILLER PIECE <i>Repld</i>	1	\$ 226.00	✓ 180.40
26	FRONT BUMPER CARRIER <i>Best</i>	1	\$ 1,012.00	✓ 809.60
27	FRONT BUMPER POP RIVERT <i>new</i>	6	\$ 5.00	✓ 3.84
28	FRONT BUMPER SUPPORT <i>can</i>	2	\$ 59.00	✓ 47.20
29	FRONT BUMPER BRACKET - LH / RH <i>can</i>	2	\$ 108.00	✓ 86.40
30	FRONT BUMPER GUIDE SECTION - LH / RH <i>can</i>	2	\$ 88.00	✓ 44 To 24
31	FRONT BUMPER COVER <i>could</i>	1	\$ 126.00	✓ 100.40
32	WARNING SIGN <i>3 new</i>	1	\$ 30.00	✓ 24
33	AIR CONDITIONER STICKER	1	\$ 8.00	✓ 5.68
34	FRONT FANFARE HORN - HIGH / LOW TONE - LH / RH <i>Not new</i>	2	\$ 432.00	X
35	FRONT FANFARE HORN SPRING SHACKLE <i>new</i>	2	\$ 94.00	+
36	FRONT FENDER - LH / RH <i>can</i>	2	\$ 2,936.00	1768 2348.80
37	FRONT FENDER ATTACHMENT PARTS <i>new</i>	1	\$ 42.00	X
38	FRONT FENDER BRACE - LH / RH <i>Not bent</i>	2	\$ 236.00	✓ 188.80
39	FRONT FENDER BRACKET - LH / RH <i>Not new</i>	2	\$ 88.00	X
40	FRONT FENDER CLOSING ELEMENT - LH / RH <i>Not new</i>	2	\$ 106.00	X
SUB TOTAL SPARE PARTS			\$ 7,536.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 9739 E

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	FRONT WHEEL HOUSING LINER LH <i>new</i>	1	\$ 275.00	+
42	FRONT WHEEL HOUSING LINER RH <i>new</i>	1	\$ 266.00	+
43	WHEEL HOUSING LINER ATTACHMENT PART <i>new</i>	1	\$ 71.00	+
44	FRONT WHEEL SPOILER LH / RH	2	\$ 332.00	+
45	FRONT STONE CHIP GUARD LH / RH <i>new</i>	2	\$ 102.00	+
46	SILL PANEL TRIM BRACKET LH / RH <i>new</i>	2	\$ 80.00	+
47	BONNET <i>Distorted</i>	1	\$ 5,528.00	4432.40
48	BONNET HINGE LH / RH <i>new</i>	2	\$ 344.00	274.40
49	BONNET ATTACHMENT PARTS <i>new</i>	1	\$ 233.00	+
50	BONNET ABSORBER <i>LH Damaged</i>	2	\$ 241.00	120.50 96.40
51	BONNET IMPACT PROTECTION LH / RH <i>new</i>	2	\$ 38.00	30.56
52	BONNET IMPACT PROTECTION CTR	1	\$ 44.00	35.12
53	BONNET STRIKER LH / RH <i>new</i>	2	\$ 220.00	175.20
54	BONNET LOCK WITH SWITCH <i>Damaged</i>	2	\$ 419.00	335.20
55	FRONT FENDER TOP COVER LH / RH <i>LH Del</i>	2	\$ 64.00	32 25.52
56	BONNET HINGE COVER LH / RH <i>cracked</i>	2	\$ 88.00	68.97
57	PLENUM CHAMBER COVER <i>new</i>	1	\$ 200.00	+
58	FRONT FENDER TOP LEDGE COVER <i>LH Del</i>	2	\$ 72.00	36 28.24
59	BOWDEN CABLE <i>cut</i>	2	\$ 58.00	46
60	RELEASE ELEMENT <i>cut</i>	1	\$ 58.00	46
SUB TOTAL SPARE PARTS		:	\$	8,733.00

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 9739 E

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
61	RELEASE LEVER <i>cut</i>	1	\$ 14.00	? 10.48
62	RELEASE CABLE COVER <i>can</i>	1	\$ 10.00	? 7.60
63	HEADLIGHT MOUNTING LH / RH <i>can</i>	2	\$ 236.00	188.80
64	LED HEADLIGHT LH / RH <i>can</i> <i>LH smushed, RH crushed</i>	2	\$ 17,248.00	8624 13,798.40
65	LED HEADLIGHT CAP LH <i>single</i>	1	\$ 58.00	? 46
66	LED HEADLIGHT HOSE LH <i>cut</i>	1	\$ 29.00	x 22.48
67	LIFT CYLINDER LH / RH <i>new</i>	2	\$ 396.00	? X
68	LIFT CYLINDER BRACKET LH <i>new</i>	1	\$ 6.00	? X
69	LIFT CYLINDE HOSE <i>new</i>	1	\$ 182.00	+
70	LOCK CARRIER <i>can</i> <i>de</i>	1	\$ 1,234.00	? 987.20
71	LOCK CARRIER LOWER SUPPORT LH / RH <i>de</i> 	2	\$ 44.00	? 34.56
72	A/C CONDENSER <i>lot</i>	1	\$ 622.00	? 497.60
73	A/C CONDENSER O-RING <i>new</i>	1	\$ 10.00	? X
74	A/C CONDENSER SEAL RING <i>new</i>	1	\$ 7.00	? X
75	A/C CONDENSER SEAL RING <i>new</i>	1	\$ 10.00	? X
76	A/C PRESSURE SENSOR <i>new</i>	1	\$ 186.00	? X
77	A/C CONDENSOR SAFETY SWITCH VALVE <i>new</i>	1	\$ 51.00	? X
78	A/C REFRIGERANT LINE <i>new</i>	1	\$ 248.00	? X
79	A/C REFRIGERANT LINE <i>new</i>	1	\$ 264.00	? X
80	A/C REFRIGERANT LINE BRACKET <i>new</i>	1	\$ 23.00	? X
SUB TOTAL SPARE PARTS		:	\$ 20,878.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 9739 E

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
81	OUTSIDE TEMPERATURE SENSOR <i>Not mee</i>	1	\$ 58.00	<i>X</i>
81	CHARGE AIR COOLER <i>Not mee</i>	1	\$ 587.00	<i>X</i>
82	CHARGE AIR COOLER SEAL RING <i>Not mee</i>	1	\$ 56.00	<i>X</i>
83	CHARGE AIR COOLER PRESSURE PIPE <i>Not mee</i>	1	\$ 375.00	<i>X</i>
84	RADIATOR <i>bt</i>	1	\$ 904.00	<i>722.80</i>
85	RADIATOR COOLANT <i>nee</i>	4	\$ 179.00	<i>143.04</i>
86	RADIATOR AIR GUIDE LH / RH <i>cm</i>	2	\$ 78.00	<i>60.96</i>
87	RADIATOR AIR GUIDE UPPER <i>cm</i>	1	\$ 30.00	<i>23.76</i>
88	RADIATOR AIR GUIDE LOWER <i>Not mee</i>	1	\$ 33.00	<i>X</i>
89	WATER DEFLECTOR STRIP LH <i>bt</i>	1	\$ 59.00	<i>46.88</i>
90	WINDOW SLOT SEAL LH - OUTER <i>Not mee</i>	2	\$ 400.00	<i>X</i>
91	WINDOW SLOT SEAL RH - OUTER <i>Not mee</i>	1	\$ 46.00	<i>X</i>
92	INTAKE AIR GUIDE - FRONT <i>Not mee</i>	1	\$ 84.00	<i>X</i>
93	INTAKE AIR GUIDE - REAR <i>Not mee</i>	1	\$ 150.00	<i>X</i>
94	AIR FILTER <i>Not mee</i>	1	\$ 302.00	<i>X</i>
95	FRONT NUMBER PLATE <i>Distorted</i>	S/N	\$ 60.00	<i>60</i>
96	SUNDRIES <i>Not</i>		\$ 400.00	<i>228.22</i>
TOTAL SPARE PARTS		:	\$ 50,436.00	
TOTAL LABOUR CHARGES		:	\$ 18,264.00	
GRAND TOTAL		:	\$ 68,700.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APROVED
 SPARE PARTS ARE SPECIAL NETT.

 PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME : *Adrian King*
SURVEYED DATE : *01/04/21*
AUTHORISED DATE :
EXCESS COST :
LIABILITY :
REMARKS :

*Not Authorized, 08 Days (Without Lock Carrier)
10 Days (With Lock Carrier)*

PLEASE NOTE :

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY.
FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

*14 Days.
St S.*

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate

GST Reg No. 19-9902271-W


AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 / Fax: 6256 4315

Estimate No.
Date
Service Advisor
Pages
Regn No
Model No

PA/OD/0273/2021/HR
6-Apr-21
CHANG
1 of 1
SMP 9739 E
AUDI A6 2.0 TFSI

Quantity	Description	Unit Price	Amount
Parts			
1	FAN RING <i>scd</i>	\$ 267.00	213.20
2	RADAIOR FAN <i>scd</i>	\$ 2,318.00	1854.40
3	WIRE CONNECTOR <i>cm</i>	\$ 26.00	20.64
4	HEADLIGHT COMPENSATING PIECE - LH/RH <i>cm</i>	\$ 160.00	127.36
GRAND TOTAL		\$ 2,771.00	

For Premium Automobiles Pte Ltd

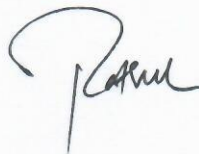

06/04/21



Authorised Signature

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate- 2

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0273/2021/HR

8-Apr-21

CHANG

1 of 1


SMP 9739 E

AUDI A6 2.0 TFSI

Quantity	Description	Unit Price	Amount
Labours			
1	TO RENEW STARTER GENERATOR AND OTHER ENGINE COMPONENTS.	S/N \$ 480.00	✓
Parts			
1	WIRE CONNECTOR / OR (Alternator) Bay d.	\$ 8.00	5.93
2	STARTER GENERATOR	\$ 1,987.00	✓ 1589.60
3	COOLANT PIPE / BT	\$ 54.00	42.64
4	COOLANT RETURN PIPE / BR	\$ 39.00	30.80
GRAND TOTAL		\$ 2,568.00	

For Premium Automobiles Pte Ltd

Stere
9/4/21

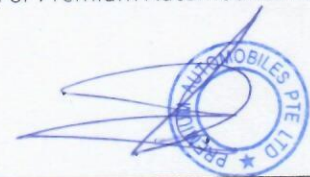

Authorised Signature