

 PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0270/2021/HR
DATE : 31-Mar-21
WIP : 21581

VEHICLE NOT IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 1/4/21

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR LOW ENG KWANG
ADDRESS : 706 UPPER CHANGI ROAD EAST
#02-03
SINGAPORE 486836
TELEPHONE : HP +65 96312823
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 1900006954-01
VEHICLE NO : **SMH 3361 S**
MODEL CODE : A4 SEDAN 2.0 TFSI S TRONIC
MODEL YEAR : 18/1/2019
ENGINE NO : CVK 073829
CHASSIS NO : WAUZZZF44KA009550
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 30-Mar-21
PLACE OF ACCIDENT : PIE NEAR SIMEI ROAD ENTRANCE.

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMH 3361 S

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY & FRONT PARKING AID.	S/N \$ 480.00	✓
2	TO REMOVE AND TRANSFER LHS HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 350.00	250
3	TO DISMANTLE AND REINSTALL LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY.	S/N \$ 280.00	X
4	TO REMOVE AND RENEW LHS FRONT WHEEL SUSPENSION ASSY WITH SUBFRAME.	S/N \$ 2,400.00	✓
5	TO DISMANTLE AND RENEW FRONT BUMPER, LHS FRONT FENDER, BONNET AND LHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	590 X 3 \$ 2,800.00	1500
6	TO RESPRAY FRONT BUMPER, LHS FRONT FENDER, BONNET, HINGES & LHS FRONT DOOR.	580 X 3 \$ 3,900.00	1650
SUB LABOUR CHARGES		\$ 10,210.00	



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMH 3361 S

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO RENEW LHS FRONT RIM WITH TYRE. TO CARRY OUT PRE/POST WHEEL ALIGNMENT.	S/N \$ 520.00	✓
8	TO CARRY OUT DIAGNOSTIC CHECK	S/N \$ 192.00	✓
SUB TOTAL LABOUR CHARGES		: \$ 10,922.00	



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMH 3361 S

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER COVER ✓ <i>BR</i>	1	\$ 1,787.00	1429.60 ✓
2	FRONT BUMPER COVER FIXING PARTS <i>X NM</i>	1	\$ 587.00	
3	FRONT BUMPER SECURING STRIP <i>? X NM</i>	2	\$ 71.00	
4	FRONT BUMPER GRILLE - CENTER <i>X NM</i>	1	\$ 196.00	
5	FRONT BUMPER LOWER CLOSING ELEMENT - CENTER <i>? X NM</i>	1	\$ 210.00	
6	FRONT BUMPER AIR GUIDE - LH <i>? X NM</i>	1	\$ 63.00	
7	FRONT RADIATOR GRILLE ✓ <i>BR</i>	1	\$ 1,332.00	1065.60 ✓
8	FRONT BUMPER AIR GUIDE GRILLE - LH ✓ <i>BR</i>	1	\$ 135.00	108 ✓
9	FRONT BUMPER CARRIER <i>X NM</i>	2	\$ 845.00	
10	FRONT BUMPER FOAM FILLER PIECE <i>X NM</i>	1	\$ 124.00	
11	FRONT BUMPER REINFORCEMENT COVER <i>(Top 2) - BR</i>	1	\$ 127.00	101.00 ✓
12	FRONT BUMPER GUIDE SECTION - LH ✓ <i>BR</i>	1	\$ 36.00	28.72 ✓
13	"CAUTION" STICKER ✓ <i>nc</i>	1	\$ 14.00	10.88 ✓
14	AIR CONDIONER STICKER ✓ <i>nc</i>	1	\$ 8.00	5.68 ✓
15	FRONT BUMPER BRACKET <i>nc - BR</i>	1	\$ 137.00	109.60 ✓
16	FRONT BUMPER CARRIER SUPPORT - LH / RH <i>X NM</i>	2	\$ 58.00	
17	FRONT HIGH TONE HORN - LH <i>X NM</i>	1	\$ 126.00	
18	FRONT HIGH TONE HORN SPRING SHACKLE - LH <i>X NM</i>	1	\$ 29.00	
19	FRONT FENDER - LH ✓ <i>DD</i>	1	\$ 767.00	613.20 ✓
20	FRONT FENDER ATTACHMENT PARTS - LH <i>X NM</i>	1	\$ 202.00	
SUB TOTAL SPARE PARTS			\$ 6,854.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMH 3361 S

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES		REMARKS
			S/NETT		
21	FRONT FENDER CLOSING ELEMENT - LH ✓ <i>npc</i>	1	\$	72.00	57.52 ✓
22	FRONT FENDER BRACKET - LH ✓ <i>DT</i>	1	\$	35.00	27.92 ✓
23	FRONT FENDER DEFORMATION BRACKET - LH ? <i>X NM</i>	1	\$	49.00	
24	FRONT FENDER POP RIVERT ✓ <i>npc</i>	6	\$	20.00	15.84 ✓
25	FRONT FENDER BRACE - LH ? ✓ <i>DT</i>	1	\$	118.00	94.40 ✓
26	FRONT FENDER INNER BRACKET - LH ? <i>X NM</i>	1	\$	32.00	
27	FRONT WHEEL HOUSING LINER - LH ✓ <i>TN</i>	1	\$	240.00	191.60 ✓
28	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS - LH <i>X BR</i>	1	\$ <i>NM</i>	233.00	
29	FRONT WHEEL SPOILER - LH ✓ <i>BR</i>	1	\$	73.00	58.40 ✓
30	FRONT WHEEL SPOILER TRIM - LH ? <i>X NM</i>	1	\$	35.00	
31	FRONT FENDER STONE CHIP GUARD ✓ <i>CUT</i>	1	\$	51.00	40.32 ✓
32	FRONT FENDER LONG LEDGE COVER - LH ✓ <i>npc</i>	1	\$	31.00	24.64 ✓
33	FRONT FENDER SHORT LEDGE COVER - LH ✓ <i>npc</i>	1	\$	23.00	17.92 ✓
34	FRONT BONNET ✓ <i>DD</i>	1	\$	3,246.00	2596.80 ✓
35	FRONT BONNET ATTACHMENT PARTS <i>X NM</i>	1	\$	412.00	
36	FRONT BONNET LID HINGE - LH / RH <i>X NM</i>	2	\$	610.00	
37	FRONT BONNET IMPACT PROTECTION - LH / RH / CTR ✓ <i>npc</i>	3	\$	84.00	65.68 ✓
38	FRONT FENDER LEDGE COVER - LH ? <i>X NM</i>	1	\$	62.00	
39	FRONT BONNET STRIKER - LH ? <i>X NM</i>	1	\$	50.00	
40	FRONT BONNET LID LOCK <i>X NM</i>	1	\$	214.00	
SUB TOTAL SPARE PARTS			:	\$	5,690.00

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMH 3361 S

				DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT		REMARKS	
41	HEADLIGHT - LH ✓ OR	1	\$	7,693.00	6154.40 ✓	
42	HEADLIGHT POWER MODULE ? X NM	1	\$	761.00		
43	HEADLIGHT CONTROL UNIT ? X NM	1	\$	751.00		
44	HEADLIGHT HOSE - LH X NM	2	\$	36.00		
45	HEADLIGHT LIFT CYLINDER - LH ? X NM	1	\$	210.00		
46	HEADLIGHT CORRUGATED PIPE X NM	1	\$	93.00		
47	FRONT ALUMINIUM RIM - LH ✓ CAT	1	\$	1,142.00	913.60 ✓	
48	FRONT ASSEMBLY CARRIER ? X NM	1	\$	1,891.00		
49	FRONT WISHBONE LINK - LH ? BT	1	\$	539.00	439.80 ✓	
50	FRONT SUSPENSION GUIDE - LH ? BT	1	\$	943.00	754.40 ✓	
51	FRONT SUSPENSION CONTROL GUIDE ? X NM	2	\$	1,024.00		
52	FRONT WHEEL BEARING HOUSING - LH ? REC	1	\$	968.00	774.90 ✓	
53	FRONT WHEEL SWIVEL JOINT - LH ? BT	1	\$	193.00	154.40 ✓	
54	FRONT WHEEL HUB - LH ? REC	1	\$	479.00	383.20 ✓	
55	FRONT WHEEL BALL BEARING ? REC	1	\$	246.00	196.80 ✓	
56	FRONT SUSPENSION FORKS ? X NM	1	\$	264.00		
57	FRONT COUPLING ROD ? X NM	1	\$	127.00		
58	FRONT ANTI ROLL BAR ? X NM	1	\$	433.00		
59	FRONT GAS SHOCK ABSORBER ? X NM	1	\$	301.00		
60	FRONT DRIVE SHAFT ? X NM	1	\$	2,650.00		
SUB TOTAL SPARE PARTS			:	\$	20,744.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMH 3361 S

DAMAGED PARTS & PRICES

S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
61	STEERING GEAR ? X N/A	1	\$ 6,787.00	
62	STEERING GEAR GREASE ? X N/A	1	\$ 43.00	
63	FRONT INNER TRACK ROD ? - DT	1	\$ 99.00	78.88 /
64	FRONT INNER TIE ROD ? - GT	2	\$ 197.00	157.20 /
65	FRONT PLENUM CHAMBER COVER ? X N/A	1	\$ 97.00	
66	FRONT NUMBER PLATE - N/A	S/N	\$ 60.00	/
67	FRONT TIRE - LH X N/A	S/N	\$ 270.00	
68	SUNDRIES ? - N/A		\$ 350.00	132 /
TOTAL SPARE PARTS		:	\$ 41,191.00	
TOTAL LABOUR CHARGES		:	\$ 10,922.00	
GRAND TOTAL		:	\$ 52,113.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED

SPARE PARTS ARE SPECIAL NETT.

Steve (LKK) 1/4/21 3.00pm

DD- N/A M

Excess - ?

P/P

M B/L Jrg

13 Feb 2021

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer

Signature:

Date:

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0270/2021/HR

1-Apr-21

CHANG

1 of 1


SMH 3361 S

AUDI A4 SEDAN 2.0 TFSI

Quantity	Description	Unit Price	Amount
Labours			
1	TO DISMANTLE AND REINSTALL LHS FRONT DOOR PANEL. TO REMOVE AND RENEW LHS SIDE MIRROR MOUNTING.	\$ 280.00	✓
2	TO RESPRAY LHS MIRROR COVER.	\$ 300.00	150
Parts			
1	SIDE MIRROR MOUNTING - LH	\$ 1,089.00	✓ C4T 871-20 ✓
GRAND TOTAL		\$ 1,669.00	

For Premium Automobiles Pte Ltd

Steve CLKKJ
1/4/21, 3:00pm

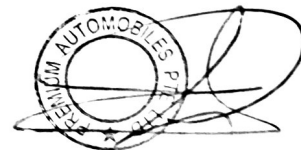

Authorised Signature

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate - 2

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0270/2021/HP

8 Apr-21

CHANG


1 of 1

SMH 3361 S

AUDI A4 SEDAN 2.0 TFSI

Quantity	Description	Unit Price	Amount
Labours			
1	TO RENEW AIRCOND REFRIGERANT PIPE. S/N	\$ 280.00	✓
Parts			
1	RADIATOR AIR GUIDE - OUTER LH ✓ OR	\$ 12.00	9.44 ✓
2	RAFRIGERANT PIPE ✓ OT	\$ 523.00	418.99 ✓
3	RAFRIGERANT PIPE BRACKET ✓ OT	\$ 8.00	5.76 ✓
4	FRONT UPPER LINK GUIDE - LH FRONT ? X N/N	\$ 512.00	
5	FRONT UPPER LINK GUIDE - LH REAR ? X N/N	\$ 512.00	
GRAND TOTAL			\$ 1,847.00

For Premium Automobiles Pte Ltd

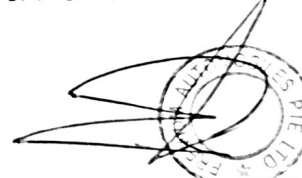

Authorised Signature

Steve
9/4/21