



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105828

3 ANSON ROAD #16-00  
SPRINGLEAF TOWER  
SINGAPORE 079909

INV Date 18/08/2021  
Reference CC6/CTI21004372/Aea3q2  
Code CTI

### PROFESSIONAL SERVICE FEE

Vehicle No. PA 7942R  
Insured Veh. SMR 1933C  
Claim No. SNM21D201810/C02  
Policy No. DMPCSNW00192432000  
Accident Date 28/03/2021  
Inspection Date 05/04/2021

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (7%)</b>                | <b>28.00</b>  |
| <b>Grand Total</b>             | <b>428.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                      |                                                                                                |                 |                                                              |  |
|----------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------|-----------------|--------------------------------------------------------------|--|
| CHINA TAIPING INSURANCE (S) PTE LTD<br>3 ANSON ROAD #16-00<br>SPRINGLEAF TOWERSINGAPORE 079909                                         |                                                                                                |                 | Ref: CC6/CTI21004372/Aea3q2<br>Date: 18/08/2021<br>Code: CTI |  |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                      |                                                                                                |                 |                                                              |  |
| Insured Veh.                                                                                                                           | SMR 1933C                                                                                      | Veh. Inspected  | PA 7942R                                                     |  |
| Policy No.                                                                                                                             | DMPCSNW00192432000                                                                             | Coverage (\$)   | 0.00                                                         |  |
| Claim No.                                                                                                                              | SNM21D201810/C02                                                                               | Excess (\$)     | 0.00                                                         |  |
| Assign From                                                                                                                            |                                                                                                | Assign Date     | 05/04/2021                                                   |  |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                          |                                                                                                |                 |                                                              |  |
| Make & Model                                                                                                                           | TOYOTA HIACE COMMUTER                                                                          | c.c             | 2982                                                         |  |
| Engine No.                                                                                                                             | HIDDEN                                                                                         | Year of Reg.    | 2008                                                         |  |
| Chassis No.                                                                                                                            | KDH2230004250                                                                                  | Colour          | WHITE                                                        |  |
| Odometer                                                                                                                               | 384685 KM                                                                                      | Steering        | IN ORDER                                                     |  |
| Brakes                                                                                                                                 | IN ORDER                                                                                       | Modification    | SPORTS RIM                                                   |  |
| General                                                                                                                                | GOOD                                                                                           |                 |                                                              |  |
| <b>3. Conditions of Tyres</b>                                                                                                          |                                                                                                |                 |                                                              |  |
|                                                                                                                                        | Size                                                                                           | Make            | Balance                                                      |  |
| R/H Front Tyre                                                                                                                         | 195/70 R15C                                                                                    | TOURADOR        | 6 mm                                                         |  |
| L/H Front Tyre                                                                                                                         | 195/70 R15C                                                                                    | TOURADOR        | 6 mm                                                         |  |
| R/H Rear Tyre                                                                                                                          | 195/70 R15C                                                                                    | TOURADOR        | 6 mm                                                         |  |
| L/H Rear Tyre                                                                                                                          | 195/70 R15C                                                                                    | TOURADOR        | 6 mm                                                         |  |
| <b>4. Description of Damages</b>                                                                                                       |                                                                                                |                 |                                                              |  |
| THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.<br>DAMAGES SEE DETAILS.                                                             |                                                                                                |                 |                                                              |  |
| <b>5. General Information</b>                                                                                                          |                                                                                                |                 |                                                              |  |
| Accident Date                                                                                                                          | 28/03/2021                                                                                     | Inspection Date | 05/04/2021                                                   |  |
| Survey held at                                                                                                                         | ISHARE AUTO PTE. LTD.<br>8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875 |                 |                                                              |  |
| <b>5a. Remarks</b>                                                                                                                     |                                                                                                |                 |                                                              |  |
| A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                                |                 |                                                              |  |
| <b>5b. Estimate Days of Repair</b>                                                                                                     |                                                                                                |                 |                                                              |  |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                                |                 | 6 Working Days                                               |  |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. PA 7942R

| Qty                                | Description of Parts                                   | Condition                | Estimate By Workshop (\$) | Our Adjusted (\$) |
|------------------------------------|--------------------------------------------------------|--------------------------|---------------------------|-------------------|
| <b><u>REPLACEMENT OF PARTS</u></b> |                                                        |                          |                           |                   |
| 1                                  | DASHBOARD                                              | NOT NECESSARY            | 969.90                    | -                 |
| 1                                  | DASHBOARD SIDE LOWER COVER GARNISH RH                  | CRACKED                  | 312.10                    | 312.10            |
| 1                                  | DASHBOARD CENTER COVER GARNISH                         | NOT NECESSARY            | 426.20                    | -                 |
| 1                                  | REAR BUMPER                                            | DEFORMED                 | 436.10                    | 436.10            |
| 4                                  | REAR BUMPER BRACKET @\$21.80                           | BENT                     | 87.20                     | 87.20             |
| 2                                  | REAR BUMPER SIDE RETAINER @\$55.00                     | NECESSARY                | 110.00                    | 110.00            |
| 2                                  | TAIL LAMP @\$390.00                                    | N/S CUT / O/S<br>CRACKED | 780.00                    | 656.00            |
| 1                                  | TAILGATE                                               | DISTORTED                | 2,054.30                  | 1,925.00          |
| 1                                  | TAILGATE LOGO                                          | NECESSARY                | 75.20                     | 75.20             |
| 1                                  | TAILGATE CENTER MOULDING (CHROME)                      | CRACKED                  | 674.80                    | 386.00            |
| 2                                  | TAILGATE CORNER INNER GARNISH @\$36.20                 | NOT NECESSARY            | 72.40                     | -                 |
| 1                                  | TAILGATE STOPPER                                       | NOT NECESSARY            | 28.00                     | -                 |
| 1                                  | TAILGATE INNER BOARD                                   | CRACKED                  | 271.80                    | 271.80            |
| 1                                  | TAILGATE WEATHERSTRIP                                  | CUT                      | 329.50                    | 329.50            |
| 1                                  | TAILGATE WEATHERSTRIP PROTECTOR                        | DEFORMED                 | 368.20                    | 228.00            |
| 1                                  | TAILGATE INNER LOCK                                    | DAMAGED                  | 425.60                    | 289.00            |
| 1                                  | TAILGATE LOWER LOCK                                    | NOT NECESSARY            | 45.20                     | -                 |
| 2                                  | TAILGATE DAMPER @\$127.40                              | NOT NECESSARY            | 254.80                    | -                 |
| 1                                  | REAR END PANEL (INNER)                                 | TO REPAIR SEE<br>LABOUR  | 1,043.20                  | -                 |
| 1                                  | REAR END PANEL (OUTER)                                 | DENTED                   | 597.00                    | 597.00            |
| 1                                  | REAR END PANEL (EXTEND)                                | DENTED                   | 349.10                    | 349.10            |
|                                    | LESS 25% DISCOUNT                                      |                          | -2,427.65                 | -1,513.00         |
|                                    |                                                        |                          | 7,282.95                  | 4,539.00          |
| <b><u>SPECIAL NETT ITEMS</u></b>   |                                                        |                          |                           |                   |
| 1                                  | SET DASHBOARD CLIP (SN)                                | NOT NECESSARY            | 150.00                    | -                 |
| 1                                  | SET DASHBOARD SIDE LOWER COVER GARNISH CLIP<br>RH (SN) | NOT NECESSARY            | 80.00                     | -                 |
| 1                                  | SET DASHBOARD CENTER COVER GARNISH CLIP (SN)           | NECESSARY                | 80.00                     | 30.00             |
| 1                                  | REAR NUMBER PLATE (SN)                                 | NOT NECESSARY            | 80.00                     | -                 |

Report Ref No. CC6/CTI21004372/Aea3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

| Qty | Description of Parts                                                               | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
| 1   | SET REAR BUMPER CLIP (SN)                                                          | NECESSARY     | 80.00                     | 30.00             |
| 1   | SET TAIL LAMP CLIP (SN)                                                            | NECESSARY     | 60.00                     | 20.00             |
| 1   | SET TAILLAMP LOWER GARNISH CLIP (SN)                                               | NOT NECESSARY | 40.00                     | -                 |
| 1   | TAILGATE SEALANT (SN)                                                              | NOT NECESSARY | 120.00                    | -                 |
| 1   | TAILGATE CENTER MOULDING 'EMERGENCY DOOR PULL TOPEN' STICKER (SN)                  | NOT NECESSARY | 50.00                     | -                 |
| 1   | SET TAILGATE CENTER MOULDING (CHROME) CLIP (SN)                                    | NECESSARY     | 60.00                     | 10.00             |
| 1   | SET TAILGATE INNER BOARD CLIP (SN)                                                 | NECESSARY     | 80.00                     | 30.00             |
| 1   | TAILGATE WINDSCREEN SEALANT (SN)                                                   | NECESSARY     | 80.00                     | 40.00             |
| 1   | TAILGATE WINDSCREEN INNER SEAL (SN)                                                | NECESSARY     | 60.00                     | 40.00             |
| 1   | TAILGATE STICKER '70KM/H' (SN)                                                     | NECESSARY     | 30.00                     | 15.00             |
| 1   | REAR END PANEL (OUTER) SEALANT (SN)                                                | NECESSARY     | 150.00                    | 60.00             |
| 1   | REAR END PANEL (EXTEND) SEALANT RH (SN)                                            | NOT NECESSARY | 80.00                     | -                 |
| 1   | REAR FLOOR TOP COVER BOARD (SPECIAL TYPE) (SN)                                     | NOT NECESSARY | 650.00                    | -                 |
| 1   | REAR FLOOR PANEL MAT (SPECIAL TYPE) (SN)                                           | NOT NECESSARY | 650.00                    | -                 |
| 1   | SET REVERSE SENSOR (SN)                                                            | DAMAGED       | 220.00                    | 200.00            |
| 1   | REVERSE CAMERA (SN)                                                                | NOT NECESSARY | 550.00                    | -                 |
|     |                                                                                    |               | 3,350.00                  | 475.00            |
|     | <b>LABOUR</b>                                                                      |               |                           |                   |
|     | PANEL BEATING AND REPLACE PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL (INNER). |               | 1,600.00                  | 800.00            |
|     | SPRAY PAINTING TO AFFECTED AREA.                                                   |               | 1,600.00                  | 800.00            |
|     | WIRING BULB CHECKNG.                                                               |               | 150.00                    | 30.00             |
|     | REMOVE AND REFIX DASHBOARD AND INTERNAL WIRING.                                    |               | 680.00                    | 150.00            |
|     | TRANSFER TAILGATE MECHAISM.                                                        |               | 80.00                     | 80.00             |
|     | REMOVE AND REFIX TAILGATE WINDSCREEN .                                             |               | 120.00                    | 120.00            |
|     | CONDUCT WATER LEAKAGE TEST.                                                        | NOT NECESSARY | 120.00                    | -                 |
|     | REAR CHASSIS ALIGNMENT.                                                            | NOT NECESSARY | 250.00                    | -                 |
|     | REMOVE AND REFIX REAR REVERSE SENSOR .                                             |               | 80.00                     | 50.00             |
|     | REMOVE AND REFIX REAR REVERSE CAMERA.                                              |               | 80.00                     | 50.00             |
|     | REMOVE AND REFIX VIDEO RECORDER .                                                  |               | 80.00                     | 50.00             |



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

| Qty                                                                         | Description of Parts                                                                            | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
|                                                                             | TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC. | NOT NECESSARY | 180.00                    | -                 |
|                                                                             |                                                                                                 |               | 5,020.00                  | 2,130.00          |
| <b>GRAND TOTAL</b>                                                          |                                                                                                 |               | <b>15,652.95</b>          | <b>7,144.00</b>   |
| <b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b> |                                                                                                 |               |                           | <b>5,700.00</b>   |

Report Ref No. CC6/CTI21004372/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. PA 7942R

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

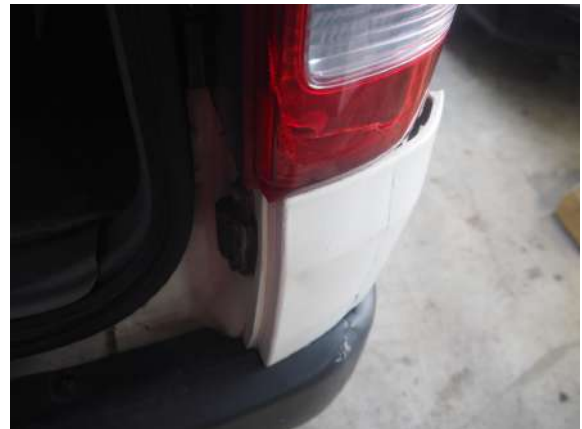



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. PA 7942R**

**RE-INSPECTION**





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

