

**Goldbell Engineering Pte Ltd**  
**8 Tuas Ave 18, Singapore**  
**638892**

**Insurer Reference: GBH101B**  
**Repairer Reference: GBH101B**  
**Date calculated: 21/07/2021 4:56 PM**

**Full Report**  
**Registration: GBH101B**  
**Printed: 26/07/2021 9:54 AM**

## Summary Information

---

### Claim

|                        |                          |                   |                                             |
|------------------------|--------------------------|-------------------|---------------------------------------------|
| Location:              | Singapore (SG)           | Work Provider:    | China Taiping Insurance (Singapore) Pte Ltd |
| Printed by:            | Catherine Chong Kai Ling | Currency:         | SGD                                         |
| Claim Reference:       | GBH101B                  | Date of Incident: | 02/04/21                                    |
| Estimated Repair Time: | 25                       | Hire Car Start:   |                                             |
| Actual Repair Days:    | 25                       | Hire Car End:     |                                             |

## Vehicle Details

---

### Vehicle

|                     |                   |
|---------------------|-------------------|
| Manufacturer:       | MERCEDES-BENZ     |
| Model:              | VITO (W447)       |
| Sub Model:          | 114 CDI LONG      |
| Model Sheet Number: | 03 AJ 32          |
| Registration:       | GBH101B           |
| VIN number:         | WDF44760323201689 |
| Odometer:           | 162329            |

### Model Specs

|                      |                      |                      |                      |
|----------------------|----------------------|----------------------|----------------------|
| FROM 3161988/E827839 | LOAD COMP LED LIGHT  | ROOF CONTROL UNIT    | ADJ STEERING WHEEL   |
| MULTI FUNC S-WHEEL   | PARTITION PNL PREPAR | INTERIOR MIRROR      | GRILLE TRIM CHROMED  |
| GLOVE BOX LOCKABLE   | SMOKER PACKAGE       | AIR CONDITIONING     | REARVIEW CAMERA      |
| ELEC FOLD DR MIRRORS | ELEC/HEATED D/MIRROR | AUDIO 15             | FRONT SPEAKER        |
| LED LIGHT SYSTEM     | HIGH BEAM ASSISTANT  | TRIM LEATHERETTE     | CHROME PACKAGE       |
| MATRIX COMBI INSTR   | LIGHT-/RAIN SENSOR   | PASSENGER TWO SEATER | SERVICE CHEK 25000KM |
| DRIVER'S SEAT COMF   | EMISSION STD EURO 6  | BLUEEFFICIENCY       | FUEL TANK 70L        |
| BATTERY 12V 95AH     | ALTERNATOR 200A      | 7-SPEED AUTOMATIK    | TYRE PRESSURE SENSOR |
| START & STOP SYSTEM  | FILTER W/SEPARATOR   | CRUISE CONTROL       | TYRES 205/65 R16C    |
| WHEELS 6.5J X 16 ALU | SPARE WHEEL          | WOOD FLOOR           | TAILGATE GLAZED      |
| L/SLIDING DOOR       | REAR WIPER           | WEIGHT 3050KG        | VEH W/VAN REGIST     |
| VAN                  | PASSENGER AIRBAG     | HEAT ABS GLAZING CPL | PREPARE OFF VEHICLE  |
| CLEAR COAT HARD      | PAINTED BUMPER/MLDG  | 3 COAT SYSTEM        |                      |

## Vehicle Condition


### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

### Damage Areas

All ☐  
Underbody ☒

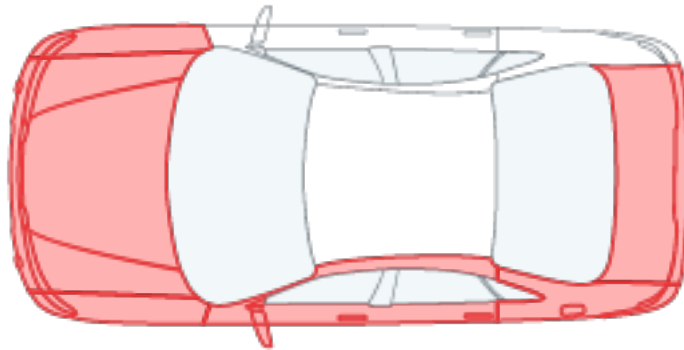

## Labour

| Code        | Description                                                                                                          | Time Base 10 WU/h | Price = 42.00 SGD/h |           |
|-------------|----------------------------------------------------------------------------------------------------------------------|-------------------|---------------------|-----------|
|             |                                                                                                                      |                   | WU                  | Price SGD |
| 91-0660 ZAX | CHECK SAFETY SYSTEM                                                                                                  |                   | 2.0                 | 8.40      |
| 54-1011 01  | SHORT TEST<br>INCLUDES: CONNECT + DISCONNECT STAR<br>DIAGNOSIS,<br>PRINT DATA,<br>DELETE ERROR MEMORY                |                   | 3.0                 | 12.60     |
| 83-1762 01  | AIR-CONDITIONING SYSTEM DRAIN FLUID,<br>EXHAUST, REFILL, PRESSURE TEST<br>(FOR ALL WORK ON THE SYSTEM)               |                   | 5.0                 | 21.00     |
| 54-1120 01  | R + R BATTERY                                                                                                        |                   | 3.0                 | 12.60     |
| 54-7989 01  | R + R BATTERY EARTH CABLE<br>(WHEN DISCONNECTING ELECTRIC PLUG AND<br>SOCKET CONNECTIONS)                            |                   | 1.0                 | 4.20      |
| NO NUMBER   | R + R FUSE BOX                                                                                                       |                   | 2.0                 | 8.40      |
| 61-1105 01  | R + R LOWER ENGINE COMPARTMENT PANELLING                                                                             |                   | 3.0                 | 12.60     |
| 88-1102 01  | R + R FRONT BUMPER                                                                                                   |                   | 7.0                 | 29.40     |
| 88-1108 01  | RENEW FRONT BUMPER (REMOVED)                                                                                         |                   | 7.0                 | 29.40     |
| 88-1400 ZAX | FRONT BUMPER ADJUST                                                                                                  |                   | 2.0                 | 8.40      |
| 88-1936 01  | R + R FRONT UPPER LOCK CARRIER<br>(FRONT BUMPER REMOVED)<br>INCLUDES: FRONT BUMPER REINFORCEMENT<br>REMOVE AND REFIT |                   | 8.0                 | 33.60     |
| 88-1937 01  | RENEW LOCK CARRIER (REMOVED)<br>INCLUDES: HEADLAMP AND REQUIRED<br>ATTACHED PARTS R + R.                             |                   | 4.0                 | 16.80     |
| 62-1258 01) | RENEW FRONT BUMPER CARRIER (REMOVED)                                                                                 |                   | 3.0                 | 12.60     |
| 82-4886 01  | ADDITION TO RENEW HEADLAMP<br>(VEHICLE WITH LED HEADLAMP)                                                            |                   | 3.0                 | 12.60     |
| 82-1110 01  | ADJUST HEADLAMPS                                                                                                     |                   | 3.0                 | 12.60     |

| Code        | Description                                                                                                                          | WU    | Price SGD |
|-------------|--------------------------------------------------------------------------------------------------------------------------------------|-------|-----------|
| 88-1858 01  | R + R FRONT LOWER CROSSMEMBER<br>(BUMPER REMOVED)                                                                                    | 3.0   | 12.60     |
| 88-2503 01  | R + R BONNET                                                                                                                         | 9.0   | 37.80     |
| 88-2508 01  | RENEW BONNET (REMOVED)                                                                                                               | 3.0   | 12.60     |
| 88-4104 02  | R + R BOTH FRONT WINGS<br>(BUMPER REMOVED)                                                                                           | 9.0   | 37.80     |
| 88-4716 01  | R + R RIGHT FRONT WHEELHOUSE SHELL                                                                                                   | 3.0   | 12.60     |
| 88-4717 01) | RENEW R/F WHEELHOUSE SHELL (REMOVED)                                                                                                 | 1.0   | 4.20      |
| 20-1140 01) | DRAIN + REFILL COOLANT                                                                                                               | 3.0   | 12.60     |
| 20-4095 02) | R + R RADIATOR                                                                                                                       | 6.0   | 25.20     |
| 20-4320 01  | ADDITIONAL FOR R + R RADIATOR<br>(VEHICLE WITH AIR CONDITIONING)                                                                     | 1.0   | 4.20      |
| 20-4300 01  | ADDITIONAL FOR R + R RADIATOR<br>(VEHICLE WITH AUTOMATIC GEARBOX)                                                                    | 1.0   | 4.20      |
| 09-6814 01  | R + R AIR INTERCOOLER                                                                                                                | 1.0   | 4.20      |
| 83-6545 01  | R + R CONDENSER (RADIATOR REMOVED)                                                                                                   | 3.0   | 12.60     |
| 83-7011 01  | ADDITION TO R + R CONDENSER<br>(VEHICLE WITH AUTOMATIC GEARBOX)                                                                      | 2.0   | 8.40      |
| 27-7101 01  | R + R TRANSMISSION OIL COOLER                                                                                                        | 11.0  | 46.20     |
| 91-2162 01) | R + R PASSENGER AIRBAG                                                                                                               | 3.0   | 12.60     |
| 68-4901 01  | R + R LUGGAGE TRAY                                                                                                                   | 3.0   | 12.60     |
| 68-4753 01  | R + R CENTRE CONSOLE                                                                                                                 | 3.0   | 12.60     |
| 91-1905 01) | R + R AIRBAG-/PRETENSIONING SYSTEM<br>CONTROL UNIT, RENEW IF NECESSARY                                                               | 5.0   | 21.00     |
| 46-8240 01  | R + R STEERING WHEEL                                                                                                                 | 6.0   | 25.20     |
| 68-1121 01  | R + R R/LOWER B-PILLAR TRIM<br>INCLUDES: R + R UPPER B-PILLAR TRIM                                                                   | 4.0   | 16.80     |
| 91-1012 01) | R + R DRIVER SEAT BELT<br>(TRIM REMOVED)                                                                                             | 3.0   | 12.60     |
| 91-1042 01) | R + R PASSENGER SEAT BELT<br>(TRIM REMOVED)                                                                                          | 3.0   | 12.60     |
| 91-3602 01  | R + R PASSENGER SEAT                                                                                                                 | 3.0   | 12.60     |
| NO NUMBER   | R + R FRT CTR SEAT BELT                                                                                                              | 3.0   | 12.60     |
| 72-1595 01  | RENEW L/SLIDING DOOR                                                                                                                 | 24.0  | 100.80    |
| 72-8487 01  | R + R L/DOOR SEAL                                                                                                                    | 6.0   | 25.20     |
| 72-7806 01) | R + R LEFT CENTRE GUIDE RAIL                                                                                                         | 6.0   | 25.20     |
| 72-7816 01) | R + R L/LOWER SLIDING DOOR GUIDE RAIL                                                                                                | 8.0   | 33.60     |
| 60-1740 01  | R + R INTERIOR TRIMS FOR RENEWAL OF THE<br>L/SIDE PANEL<br>(SLIDING DOOR, SEATS AND MATS REMOVED)<br>INCLUDES: R + R REAR HEADLINING | 20.0  | 84.00     |
| 63-5772 02  | RENEW L/R SIDE PANEL                                                                                                                 | 128.0 | 537.60    |
| 60-1750 ZAX | R + R L/INTERIOR INSULATIONS, RENEW IF<br>NECESSARY                                                                                  | 2.0   | 8.40      |
| 97-4100 01  | APPLY UNDERSEAL TO WELDED-IN REPLACEMENT<br>PARTS (UP TO 50 SQM)                                                                     | 3.0   | 12.60     |
| 97-4101 01) | APPLY UNDERBODY SEALANT AT WELDED PARTS<br>ADD/WORK                                                                                  | 2.0   | 8.40      |
| 40-2410 01) | R + R R/R TYRE (WHEEL REMOVED)                                                                                                       | 3.0   | 12.60     |
| 40-2410 01) | R + R TYRE (ADD/WORK)                                                                                                                | 1.0   | 4.20      |
| 40-2180 ZAX | ADDITION TO R + R REAR TYRE<br>(VEHICLE WITHOUT PRODUCTION TYRES)                                                                    | 1.0   | 4.20      |
| 40-2055 01  | BALANCE ONE WHEEL (WHEEL REMOVED)                                                                                                    | 2.0   | 8.40      |
| 40-2181 ZAX | ADDITION TO WHEEL BALANCING<br>(FIT ADHESIVE WEIGHTS)                                                                                | 1.0   | 4.20      |

| Code | Description                       | WU           | Price SGD       |
|------|-----------------------------------|--------------|-----------------|
| 3481 | L/RR SIDE PANEL UNDERBODY SEALANT |              |                 |
|      | <b>Labour Cost</b>                | <b>Hrs</b>   | <b>WU</b>       |
|      | <b>Panel / Mechanical Labour</b>  | <b>35.00</b> | <b>350.0</b>    |
|      | <b>Total of Labour</b>            |              | <b>1,470.00</b> |

## Paint

| Paint Work | SYSTEM AZT                                | Time Basis 10 WU/h |
|------------|-------------------------------------------|--------------------|
| Code       | Description - 3 COAT SYSTEM               | WU Price SGD       |
|            | FRT BUMPER SUPPORT SURFACE PAINT          | 6.0                |
|            | BONNET NEW PART PAINTING                  | 27.8               |
|            | L/SLIDING DOOR NEW PART PAINTING          | 34.9               |
|            | L/STEP BOARD REINF SURFACE PAINT          | 4.0                |
|            | L/RR SIDE PANEL NEW PART PAINTING         | 60.2               |
|            | L/S PNL REINF CLOSER SURFACE PAINT        | 4.0                |
|            | L/LOCK STRIKER REINF SURFACE PAINT        | 4.0                |
|            | L/LWR CLOSING PANEL SURFACE PAINT         | 4.0                |
|            | L/CTR SILL SIDEMEMB SURFACE PAINT         | 4.0                |
|            | L/SILL BOX SURFACE PAINT                  | 4.0                |
|            | FRONT BUMPER NEW PART PAINT K1G/P         | 40.2               |
|            | FRT TOWING EYE COVER NEW PART PAINT K1G/P | 5.5                |
|            | L/OUT SLDG D/HANDLE NEW PART PAINT K1G/P  | 5.5                |
|            | L/SLDG DOOR HAND TRM NEW PART PAINT K1G/P | 5.6                |
|            | LEFT CTR SILL REPAIR PAINTING >50%        | 13.0               |
|            | L/SIDE PANEL COVER REPAIR PAINTING >50%   | 13.1               |
|            | L/F WING SURFACE PAINT                    | 8.8                |
|            | R/F WING SURFACE PAINT                    | 8.8                |
|            | FRT LWR CROSSMEMBER SURFACE PAINT         | 6.0                |
|            | LEFT FRONT DOOR SURFACE PAINT             | 13.2               |
|            | REAR BUMPER SURFACE PAINT PLAST.          | 17.0               |
|            | BOOTLID/TAILGATE SURFACE PAINT            | 15.9               |

## Paint Material Per Part

| Code | Description                               | Price SGD |
|------|-------------------------------------------|-----------|
| 0340 | FRT BUMPER SUPPORT SURFACE PAINT          | 9.96      |
| 0471 | BONNET NEW PART PAINTING                  | 85.16     |
| 1781 | L/SLIDING DOOR NEW PART PAINTING          | 115.97    |
| 2197 | L/STEP BOARD REINF SURFACE PAINT          | 1.99      |
| 3481 | L/RR SIDE PANEL NEW PART PAINTING         | 102.72    |
| 3503 | L/S PNL REINF CLOSER SURFACE PAINT        | 1.25      |
| 3505 | L/LOCK STRIKER REINF SURFACE PAINT        | 1.25      |
| 4299 | L/LWR CLOSING PANEL SURFACE PAINT         | 2.49      |
| 4301 | L/CTR SILL SIDEMEMB SURFACE PAINT         | 1.99      |
| 4303 | L/SILL BOX SURFACE PAINT                  | 3.74      |
| 0281 | FRONT BUMPER NEW PART PAINT K1G/P         | 162.82    |
| 0299 | FRT TOWING EYE COVER NEW PART PAINT K1G/P | 1.03      |
| 1867 | L/OUT SLDG D/HANDLE NEW PART PAINT K1G/P  | 2.06      |
| 1869 | L/SLDG DOOR HAND TRM NEW PART PAINT K1G/P | 3.09      |
| 2101 | LEFT CTR SILL REPAIR PAINTING >50%        | 5.31      |
| 3499 | L/SIDE PANEL COVER REPAIR PAINTING >50%   | 6.28      |
| 0741 | L/F WING SURFACE PAINT                    | 15.84     |

**Paint Material Per Part**

| Code | Description                       | Price SGD |
|------|-----------------------------------|-----------|
| 0742 | R/F WING SURFACE PAINT            | 15.84     |
| 1001 | FRT LWR CROSSMEMBER SURFACE PAINT | 9.96      |
| 1481 | LEFT FRONT DOOR SURFACE PAINT     | 37.41     |
| 2581 | REAR BUMPER SURFACE PAINT PLAST.  | 73.98     |
| 2931 | BOOTLID/TAILGATE SURFACE PAINT    | 48.53     |

**Labour Cost - Paint**

|                                | Hrs            | WU           | Price SGD    |
|--------------------------------|----------------|--------------|--------------|
| Factor                         | 42.00 SGD/h    |              |              |
| Time Paint                     |                | 306.0        |              |
| Preparation Main Work Metal    | 2.50           | 25.0         | 105.00       |
| Preparation Comp. Work Plastic | 0.80           | 8.0          | 33.60        |
| Preparation Multi-Coat         | 0.50           | 5.0          | 21.00        |
| <b>Total</b>                   | <b>10 WU/h</b> | <b>34.40</b> | <b>344.0</b> |

**Material Cost - Paint**

|                                     | Price SGD     |
|-------------------------------------|---------------|
| New Part Painting                   | 303.85        |
| New Part Painting - Plastic K1G/PUR | 169.00        |
| Repair Painting                     | 11.59         |
| Surface-/Blend Paint                | 150.25        |
| Surface Painting Plastic            | 73.98         |
| Material-constant Metal Preparation | 28.60         |
| Material-constant Multi-Coat        | 9.30          |
| Material-constant Plastic           | 12.70         |
| <b>Total</b>                        | <b>759.27</b> |

**Spare Parts**

|      |                      |                   |               | prices as at 2015-06-01 |
|------|----------------------|-------------------|---------------|-------------------------|
| Code | Description          | Part Number       | Part Source   | Price SGD               |
| 0281 | FRONT BUMPER         | 447 885 0825 9999 | Original      | 816.00                  |
| 0293 | FRT LWR BUMPER COVER | 447 885 0136 9051 | Original      | 70.00                   |
| 0340 | FRT BUMPER SUPPORT   | 447 620 0630      | Original      | 456.00                  |
| 0344 | R/F INN BUMPER REINF | 447 880 0316 9051 | Original      | 60.00                   |
| 0351 | SCREW                | 004 990 8712      | Original      | 16.50                   |
| 0352 | R/F BUMPER BRACKET   | 447 880 0724      | Original      | 53.00                   |
| 0367 | FRT LWR BUMPER BRKT  | 126 994 1345      | Original      | 15.00                   |
| 0411 | CLIP FASTENING       | 000 991 9440      | Supplementary | 11.00                   |
| 0431 | FRONT MANUFACT BADGE | 906 817 0416 5337 | Original      | 0.00                    |
| 0471 | BONNET               | 447 880 7701 64   | Original      | 1,020.00                |
| 0542 | R/H-LAMP STRAP       | 447 905 1804      | Supplementary | 870.00                  |
| 0562 | RIGHT HEADLAMP ASSY  | 447 906 2601      | Original      | 1,980.00                |
| 0842 | R/F WHEELHOUSE COVER | 447 684 0277      | Original      | 95.00                   |
| 0930 | FRT UPP LOCK CARRIER | 447 880 1103      | Original      | 245.00                  |
| 0932 | R/BRACKET            | 447 885 0064      | Original      | 25.00                   |
| 1001 | FRT LWR CROSSMEMBER  | 447 880 0403      | Original      | 235.00                  |
| 1781 | L/SLIDING DOOR       | 447 730 4200 64   | Original      | 1,800.00                |
| 1809 | L/SLIDING DOOR SEAL  | 447 731 0900      | Original      | 220.00                  |

| Code | Description             | Part Number          | Part Source   | Price SGD |
|------|-------------------------|----------------------|---------------|-----------|
| 1843 | L/LOWER SLIDING RAIL    | 447 766 1037         | Original      | 98.00     |
| 1847 | L/LOWER CONNECTION      | 639 730 0616         | Original      | 84.00     |
| 1855 | L/PROTECTION CAP        | 000 987 3520         |               | 0.00      |
| 1865 | L/SLDG DOOR HAND<br>BRK | 447 760 0234         | Supplementary | 98.00     |
| 2011 | L/SLIDING DOOR COVER    | 447 737 0260 7386    | Original      | 75.00     |
| 2039 | L/DOOR TRIM CLIP        | 000 991 7171         | Original      | 37.50     |
| 2195 | L/R SILL TRIM           | 447 680 3106 9051    | Original      | 250.00    |
| 2197 | L/STEP BOARD REINF      | 447 730 2906         | Original      | 90.00     |
| 3475 | L/QTR PANEL BOND KIT    | 012 989 1771 09      |               | 0.00      |
| 3481 | L/RR SIDE PANEL         | 447 630 2700         | Original      | 880.00    |
| 3503 | L/S PNL REINF CLOSER    | 447 630 0022         |               | 0.00      |
| 3505 | L/LOCK STRIKER REINF    | 447 630 0916         |               | 0.00      |
| 4323 | AIRBAG SYSTEM           | REPLACE              | Original      |           |
| 4325 | PASSENGER AIRBAG        | 447 860 0202 9116    | Original      | 1,850.00  |
| 4661 | DRIVER'S SEAT BELT      | 447 860 3785<br>9C94 | Original      | 720.00    |
| 4662 | PASSENGER SEAT BELT     | 447 860 0700<br>9C94 | Original      | 720.00    |
| 4663 | FRT CTR SEAT BELT       | 447 860 2585<br>9C94 | Original      | 720.00    |
| 7445 | DRIVER AIRBAG           | 000 860 1402 9116    | Original      | 1,850.00  |
| 7763 | LWR RADIATOR COVER      | 447 505 0430         | Original      | 108.00    |
| 7768 | R/UPP RADIATOR BRKT     | 169 504 0114         | Original      | 30.00     |
| 7770 | R/LWR RADIATOR BRKT     | 447 500 0631         | Original      | 30.00     |
| 7792 | R/FASTENING CLIP        | 000 991 2195         | Original      | 15.00     |
| 8730 | INTERCOOLER             | 447 501 1301         | Original      | 580.00    |
| 9552 | R/RR WHEEL              | 447 401 0301 7X45    | Original      | 620.00    |
| 9659 | AIRBAG/TENS C-UNIT      | 447 900 0900         |               | 0.00      |
| 9665 | FUSE BOX                | 447 540 4326         | Supplementary | 468.00    |
| 9986 | AIR CON COOLANT         | NO NUMBER            | Original      | 50.00     |
| 9987 | COOLANT/ANTIFREEZE      | NO NUMBER            | Original      | 50.00     |
| 1000 | AIRBAG MODULE (1)       | MODULE               | Original      | 1,050.00  |
| 1001 | ALIGNMENT (1)           | ALIGNMENT            | Original      | 80.00     |
| 1004 | ram AIRBAG ECU (1)      | AIRBAG MODULE        | Original      | 380.00    |
| 1007 | NESS                    | MTG PLATE            | Original      | 11.00     |
| 1008 | RH                      | HEADLAMP<br>MODULE   | Supplementary | 700.00    |

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

|                 |                  |
|-----------------|------------------|
| <b>Savings</b>  | <b>0.00</b>      |
| <b>Subtotal</b> | <b>19,632.00</b> |
| <b>Total</b>    | <b>19,632.00</b> |

## Extras

| Code                | Description                       | Price SGD       |
|---------------------|-----------------------------------|-----------------|
| 1002                | SEALANT (2) sealant               | 80.00*          |
| 1003                | ram hdlamp ECU (1) HEADLAMP ECU   | 380.00*         |
| 1005                | ram hdlamp module HEADLAMP SIGNAL | 380.00*         |
| 1006                | ram fuse blk module Fuse module   | 380.00*         |
| 2039                | [E]: L/DOOR TRIM CLI P: x15       | 0.00*           |
| <b>Total Extras</b> |                                   | <b>1,220.00</b> |

## Final Calculation

|                                       | SGD       | SGD              |
|---------------------------------------|-----------|------------------|
| <b>Parts</b>                          | 19,632.00 |                  |
| <b>Total Parts</b>                    |           | <b>19,632.00</b> |
| <b>Labour Time Base 10 WU/h</b>       |           |                  |
| Total 350.0 WU X 42.00 SGD/h          | 1,470.00  |                  |
| <b>Total of Labour</b>                |           | <b>1,470.00</b>  |
| <b>Additional Costs</b>               |           |                  |
| Underbody Sealer                      |           |                  |
| Rate 5.0 WU X 42.00 SGD/h             | 21.00     |                  |
| <b>Total Of Additional Costs</b>      |           | <b>21.00</b>     |
| <b>Total Of Extras</b>                |           | <b>1,220.00</b>  |
| <b>Paint Work Time Base 10 WU/h</b>   |           |                  |
| Labour Cost 344.0 WU X 42.00 SGD/h    | 1,444.80  |                  |
| Material Cost                         | 759.27    |                  |
| <b>Total Paint Including Material</b> |           | <b>2,204.07</b>  |
| <b>Repair Cost Excludes GST</b>       |           | <b>24,547.07</b> |
| GST (+7.0%)                           |           | <b>1,718.29</b>  |
| <b>Repair Cost Included GST</b>       |           | <b>26,265.36</b> |

## Comments

\* - USER SUPPLIED DATA  
NN - NO MANUFACTURERS CODE EXISTS  
) - WU PARTIAL INCL IN OTHER POSITIONS

## Assessment Note

| Author         | Date               | Text                |
|----------------|--------------------|---------------------|
| Catherinechong | 21/07/2021 4:56 PM | Attn, Rasul & veron |
| Catherinechong | 30/06/2021 9:34 AM | ATTN :RASUL & VERON |