

ASS. RES. BY:

REF:

AIG / 210044721KV f3

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

QD / TP / WS / TP RES / QD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____ MBM

of _____

Insured: _____

Policy No. 1800027135

Claims No. 7140128801SG

Sum Insured: _____ Excess: 0

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \$ 219K

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 08 days Res.: Yes or No

Lum Sum: 1-B.1 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: STJ 10014 Yr Regn: 06, 13

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Bmw m3 c.c. 2979

Colour: M. Gold A/C: Insured / Std / NI / NA

Sp. Reading: _____ T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WBS 3 C9 20 XOP 878163

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 265/35R19

R: 275/35R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front: _____ Rear: _____

R/Bal. 5 mm R/Bal. 3 mm

L/Bal. 5 mm L/Bal. 3 mm

D.O.A. 31/3/21 D.O.I. 8/4/2021

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

28/9/21

Final fig \$27,013 confirmed by email (Red 46,803.90, 63%)

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2) 4/10/21-Typist

Days Of Repair: 8

Resurvey No. of Trip: 2

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation: \$ - RS. \$

Fees

Others Investigation

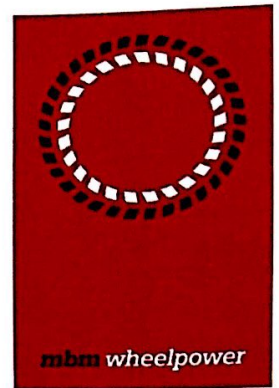
TOTAL

500

Report Format: Merimen

Lump Sum / I.B.I: (\$ 27,013

MBM WHEELPOWER PTE. LTD.



YOUR REF.:

OUR REF.: SJJ1001U

TO: AIG

CC: MOTOR CLAIMS DEPARTMENT

FAX:

ESTIMATE FOR VEHICLE NO.: SJJ1001U

Not Authorized
1/1 Log &
Repair After Paint

DATE: 3 April 2021
FROM: Alvin Koh
FAX: 64525333
CONTACT: 81387188
MAKE & MODEL: BMW M3 SEDAN AT ABS D
CHASSIS NO.: WBS3C920X0P818163
ENGINE NO.: 06979068S55B30A
YEAR MADE: 2014
ACCIDENT DATE: 31 March 2021

(B' Burnt)

NO.	DESCRIPTION	PART NO.	QTY.	LIST PRICE
1	FRONT WINDSCREEN		1	\$ 2,011.00
2	FRONT WINDSCREEN MOULDING		1	\$ 121.00
3	FRONT WINDSCREEN RAIN SENSOR		1	\$ 716.00
4	HEAD LINING - ROOF		1	\$ 2,087.00
5	SUN VISOR RH		1	\$ 315.00
6	SUN VISOR RH BRACKET		1	\$ 76.00
7	FRONT SAFETY BELT RH		1	\$ 637.00
8	FRONT SAFETY BELT STOPPER RH		1	\$ 27.00
9	FRONT SAFETY BELT LOCKER		1	\$ 519.00
10	STEERING WHEEL LEATHER (M-SPORTS EDITION)		1	\$ 2,202.00
11	STEERING WHEEL REAR COVER		1	\$ 213.00
12	STEERING WHEEL FRONT COVER		1	\$ 254.00
13	STEERING WHEEL BMW AIR BAG		1	\$ 3,301.00
14	FRONT ELECTRICAL SEAT MECHANISM RH		1	\$ 3,259.00
15	FRONT ELECTRICAL SEAT ADJUSTABLE MODULE RH		1	\$ 934.00
16	FRONT ELECTRICAL MEMORY SEAT MODULE RH		1	\$ 863.00
17	FRONT ELECTRICAL SEAT MOTOR ADJ (LONG HEIGHT)		1	\$ 857.00
18	FRONT ELECTRICAL SEAT MOTOR ADJ (SEAT HEIGHT)		1	\$ 857.00
19	FRONT ELECTRICAL SEAT MOTOR ADJ (SEAT ANGLE)		1	\$ 857.00
20	FRONT ELECTRICAL SEAT MOTOR ADJ (BACKREST)		1	\$ 709.00
21	FRONT ELECTRICAL SEAT REAR PANEL		1	\$ 675.00
22	FRONT ELECTRICAL SEAT COVER RH - MATT BLACK		1	\$ 123.00
23	FRONT ELECTRICAL SEAT UPHOLSTREY		1	\$ 664.00
24	FRONT ELECTRICAL SEAT UPHOLSTREY BACKREST		1	\$ 669.00
25	FRONT ELECTRICAL SEAT UPHOLSTREY PAD		1	\$ 159.00
26	FRONT ELECTRICAL SEAT (M) LOGO EMBLEM		1	\$ 254.00
27	FRONT ELECTRICAL SEAT LEATHER		1	\$ 2,891.00
28	FRONT ELECTRICAL SEAT LEATHER BACKREST		1	\$ 2,797.00
29	FRONT ELECTRICAL SEAT BACKREST PAD		1	\$ 162.00
30	FRONT ELECTRICAL SEAT WIRE STRAP		1	\$ 43.00
31	FRONT DOOR PANEL LEATHER RH		1	\$ 3,390.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

MBM WHEELPOWER PTE. LTD.
160 SIN MING DRIVE, #06-02
SIN MING AUTOCITY

32	FRONT DOOR PANEL LED INTERIOR LAMP RH	1	\$	Sm Y	62.00
33	FRONT DOOR PANEL LEATHER ARM REST RH	1	\$	B ✓	684.00
34	FRONT DOOR PANEL PULL STRAP SUPPORT RH	1	\$	9 ✓	216.00
35	FRONT DOOR PANEL PULL STRAP INTERIOR COVER RH	1	\$	?	619.00
36	FRONT DOOR PANEL POWER WINDOW MAIN SWITCH ASSY	1	\$	?	512.00
37	FRONT DOOR FRAME SEAL (WITH SPEAKER) RH	1	\$	B ✓	248.00
38	FRONT DOOR GLASS INNER RUBBER SEAL RH	1	\$	B ✓	156.00
39	FRONT DOOR WINDOW GLASS RH	1	\$	B ✓	483.00
40	FRONT DOOR ENTRY RUBBER SEAL RH	1	\$	B ✓	327.00
41	FRONT DOOR COVER PLATE - MATT BLACK	1	\$	Sm B ✓	67.00
42	FRONT DOOR COVER PLATE CLIPS	4	\$	vn B ✓	40.00
43	FRONT DOOR ENTRANCE COVER - MATT BLACK	1	\$	B ✓	231.00
44	FRONT DOOR ENTRANCE COVER CLIPS 13.2MM	4	\$	vn B ✓	40.00
45	FRONT DOOR ENTRANCE COVER CLIPS 11.2MM	4	\$	vn B ✓	40.00
46	FRONT DOOR COLUMN B LOWER COVER RH - MATT BACK	1	\$	B ✓	179.00
47	FRONT DOOR COLUMN B LOWER COVER RH CLIPS	4	\$	vn B ✓	40.00
48	FRONT DOOR COLUMN C LOWER COVER RH - MATT BLACK	1	\$	?	133.00
49	FRONT DOOR COLUMN C LOWER COVER RH CLIPS	4	\$	?	40.00
50	FRONT FLOOR COVER	1	\$	B ✓	1,643.00
51	FRONT FLOOR COVER FOAM CUSHION INSERT	1	\$	?	71.00
52	REAR FLOOR COVER	1	\$	?	1,579.00
53	WIRE HARNESS - B PILLAR	1	\$	?	162.00
54	WIRE HARNESS - FRONT SEAT BELOW	1	\$	?	178.00
55	WIRE HARNESS - ECU	1	\$	?	142.00
56	WIRE HARNESS - MAIN	1	\$	?	15,000.00
TOTAL:					\$ 55,534.00
LESS 10%:					\$ (5,553.40)
PARTS TOTAL:					\$ 49,980.60

SPECIAL NETT

WINDSCREEN SEALANT	1	\$	?	80.00
3M FLOOR MATT RH	1	\$	nz X	150.00
FRONT WINDSCREEN SOLAR FILM (V-KOOL)	1	\$	?	350.00
FRONT DOOR GLASS SOLAR FILM (V-KOOL)	1	\$	?	120.00

Insured or not?

LABOUR

TO REMOVE, REFIT & REPAIR AFFECTED DAMAGED PARTS	\$	300l	1,400.00
TO REMOVE & REPLACE FRONT WINDSCREEN	\$	7	150.00
TO REMOVE & REPLACE DOOR WINDOW GLASS	\$	60l	100.00
TO REMOVE, REFIT FRONT FLOOR BOARD	\$	100l	180.00
TO REMOVE & REFIT ROOF LINING & GARNISH TO FACILIATE REPAIR	\$	100l	200.00
TO REMOVE & REFIT FRONT DOOR RH INNER BOARD	\$	60l	80.00
TO REMOVE & REFIT AUDIO SYSTEM	\$	7	150.00
TO REMOVE, REFIT FRONT SEAT MECHANISM	\$	150l	280.00
TO REMOVE, REFIT & UPHOLSTERY TO FACILITATE REPAIRS	\$	150l	350.00
TO REMOVE, REFIT WIRE HARNESS	\$	✓	180.00
TO RESET ENGINE WARNING LIGHT (ABS, SRS, ECU MEMORY & ETC)	\$	250l	350.00
TO CHECK & RECONNECT ALL NECESSARY WIRING	\$	60l	120.00
TOTAL:		\$	54,220.60
7% GST:		\$	3,795.44
GRAND TOTAL:		\$	58,016.04



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	01/04/2021 17:46 (SGT)
Date of Accident	31/03/2021 22:00 (SGT)
Exact Location of Accident	Fairways Dr, Singapore
Additional Location Information	Champion Golf Driving Range Carpark
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJJ1001U
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	Simon Kastono
NRIC No	SXXXX963F
Email Address	skastono68@yahoo.com.sg
Mobile Phone No	(Phone) +65-96952682
Alternative Phone No	+65-96952682

VEHICLE PARTICULARS

Manufacturer	BMW
Model	M3
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2979

INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	1800027135-03
Cover Note Number	-

DRIVER

Name of Driver	Simon Kastono
NRIC No	SXXXX963F



SKETCH PLAN

VEHICLE A - SJJ1001U



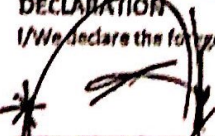
CHAMPION
GOLF DRIVING
RANGE CARPARK

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT


On 31 March 2021 around 2200 hrs, I drove my car (BMW M3, SJJ1001U) to Champion Driving Range to practice my golf. I parked the car at the outdoor carpark at the Champion Driving Range premises. After the car was parked while I practice my golf about 30 minutes upon arrival, someone spotted there was fire in my car. I was informed and rushed to my car and managed to take out fire extinguisher and kill the fire.

DECLARATION

I/We declare the foregoing particulars are true in every respect.


Policyholder's Signature
Date & Time:

GLADAC Single Form V3


Driver's Signature
(If driver is not the policyholder)
Date & Time:

01 APR 2021


Reporting Centre Personnel's Signature
Name:
NRIC/IN No.:

Angie Soh