



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2104109

INV Date 11/06/2021

Reference CC4/LPC21004731/R1ga3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMX 7042C
Insured Veh. SMT 7739Y
Claim No. 20/21/21/VP05/024447
Policy No. Z/20/VP00/107875
Accident Date 12/04/2021
Inspection Date 21/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21004731/R1ga3q2	
			Date: 11/06/2021	
			Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMT 7739Y	Veh. Inspected	SMX 7042C
	Policy No.	Z/20/VP00/107875	Coverage (\$)	0.00
	Claim No.	20/21/21/VP05/024447	Excess (\$)	0.00
	Assign From	GERALD	Assign Date	14/04/2021
2. Vehicle Particulars & Condition				
	Make & Model	B.M.W. 318i	c.c	1998
	Engine No.	HIDDEN	Year of Reg.	2021
	Chassis No.	WBA72DY060FK63320	Colour	BLUE
	Odometer	02665 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/50 R17	BRIDGESTONE	6 mm
	L/H Front Tyre	225/50 R17	BRIDGESTONE	6 mm
	R/H Rear Tyre	225/50 R17	BRIDGESTONE	6 mm
	L/H Rear Tyre	225/50 R17	BRIDGESTONE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	12/04/2021	Inspection Date	21/04/2021
	Survey held at	PERFORMANCE MOTORS LTD 303 ALEXANDRA ROAD SINGAPORE 159941		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMX 7042C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SUNDRIES (SN)	NECESSARY	80.00	80.00
1	ADAPTER (SN)	SERVICEABLE	48.40	-
1	TRIM STRIP (SPORT) (SN)	SERVICEABLE	104.20	-
1	REAR BUMPER PANEL PRIMED (SPORT) (SN)	DEFORMED	1,281.30	1,281.30
4	DECOUPLING RING (SN)	NOT NECESSARY	20.60	-
			1,534.50	1,361.30
	<u>LABOUR</u>			
	REPLACE REAR BUMPER INCLUDE REMOVE ATTACHMENT ETC.		1,275.00	850.00
	PAINTING REAR BUMPER .		1,038.00	986.00
	TO CHECK ELECTRICAL WIRING SYSTEM AND LIGHTING AT THE REAR SECTION FOR PROPER FUNCTION .		177.00	168.00
			2,490.00	2,004.00
	GRAND TOTAL		4,024.50	3,365.30
RECOMMENDED COST OF REPAIRS				3,365.30

Report Ref No. CC4/LPC21004731/R1ga3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMX 7042C

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

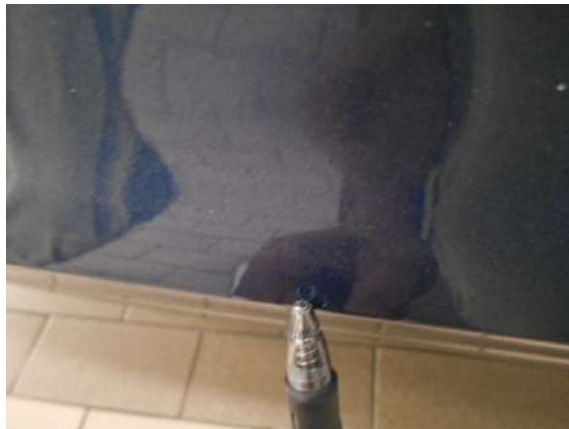



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

