



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2104143

INV Date 14/06/2021

Reference CC4/LPC21004888/Ups3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMK 5626A
Insured Veh. GBE 943D
Claim No. 20/21/21/VC00/024462
Policy No. Z/20/VC00/107761
Accident Date 15/04/2021
Inspection Date 19/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21004888/Ups3q2 Date: 14/06/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBE 943D		Veh. Inspected	SMK 5626A
Policy No.	Z/20/VC00/107761		Coverage (\$)	0.00
Claim No.	20/21/21/VC00/024462		Excess (\$)	0.00
Assign From	ONG LI LI		Assign Date	19/04/2021
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA VIOS (A)		c.c	1497
Engine No.	HIDDEN		Year of Reg.	2009
Chassis No.	MR053HY9305110597		Colour	RED
Odometer	211184 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	GOOD			
3. Conditions of Tyres				
		Size	Make	Balance
R/H Front Tyre		185/65 R15	FALKEN	6 mm
L/H Front Tyre		185/65 R15	FALKEN	6 mm
R/H Rear Tyre		185/65 R15	FALKEN	6 mm
L/H Rear Tyre		185/65 R15	FALKEN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	15/04/2021		Inspection Date	19/04/2021
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMK 5626A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOTLID	DENTED / BENT	766.50	645.10
1	BOOTLID OUTER HANDLE	CRACKED	198.10	198.10
1	BOOTLID REAR LOGO	NECESSARY	60.80	60.80
1	BOOTLID INNER LOCK	TWISTED	199.40	185.40
1	BOOTLID 'VIOS' EMBLEM	NECESSARY	66.80	58.20
1	BOOTLID 'G' EMBLEM	NECESSARY	89.90	48.00
1	BOOTLID WEATHERSTRIP	TWISTED	266.50	198.70
1	REAR BUMPER	DEFORMED	655.10	427.90
2	REAR BUMPER SIDE RETAINERS @\$76.50	N/S BENT	153.00	76.50
2	REAR BUMPER BRACKETS @\$99.10	NOT NECESSARY	198.20	-
2	REAR BUMPER REFLECTORS @\$195.00	N/S CRACKED	390.00	151.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR EXHAUST	NOT NECESSARY	588.10	-
2	REAR EXHAUST MOUNTINGS @\$65.00	NOT NECESSARY	130.00	-
1	REAR END PANEL	DENTED / BENT	655.20	601.10
1	REAR END PANEL GARNISH	TWISTED	315.10	165.80
2	TAILLAMPS @\$520.10	CRACKED	1,040.20	650.20
2	TAILLAMPS HOUSING PANELS @\$199.50	TO REPAIR SEE LABOUR	399.00	-
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	911.20	-
1	REAR FLOOR PANEL TOP BOARD	TORN	422.50	291.10
2	REAR FLOOR PANEL SIDE TOOLS SPONGE @\$389.10	N/S TORN	778.20	305.10
2	REAR FENDERS @\$845.10	TO REPAIR SEE LABOUR	1,690.20	-
2	REAR FENDER INNER SPLASH SHIELDS @\$105.00	N/S TORN	210.00	82.20
	LESS 25% DISCOUNT		-	-1,048.80
			10,234.00	3,146.40
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00

Report Ref No. CC4/LPC21004888/Ups3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	200.00	-
			530.00	250.00
	LABOUR			
	TO CHECK WIRING .		80.00	30.00
	TO DISMANTLE & REPLACING REVERSE SENSOR .		80.00	50.00
	TO TRANSFER BOOTLID MECHANISM .		80.00	60.00
	TO SPRAY RUST PROOFING .		120.00	60.00
	TO DISMANTLE & REFIX REAR EXHAUST .	NOT NECESSARY	100.00	-
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY .		180.00	80.00
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF TAILLAMPS HOUSING PANELS ,REAR FLOOR PANEL AND REAR FENDERS.		1,800.00	880.00
	TO PUTTY & SPRAY PAINTING .		1,680.00	1,100.00
			4,120.00	2,260.00
GRAND TOTAL			14,884.00	5,656.40
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,500.00

Report Ref No. CC4/LPC21004888/Ups3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 5626A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

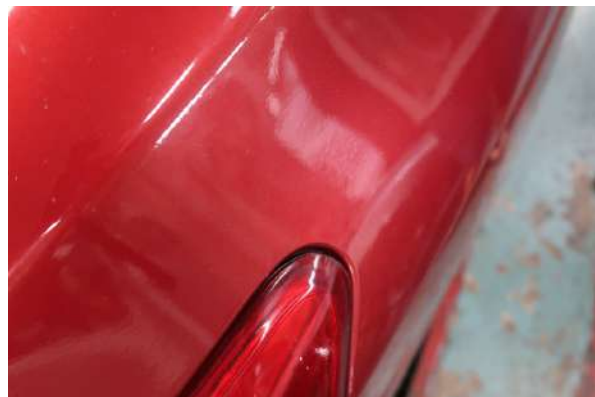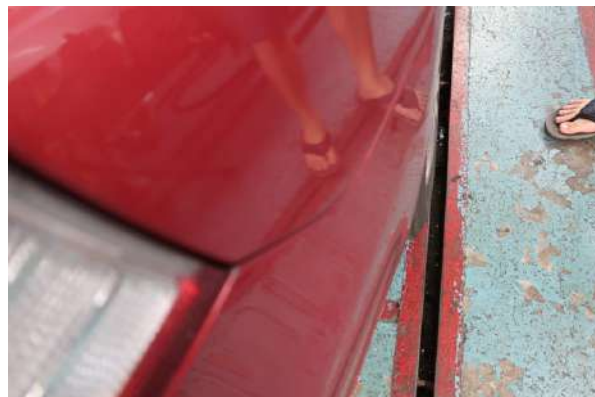



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 5626A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

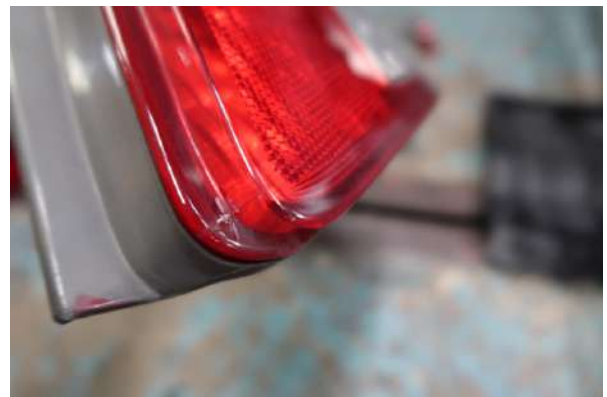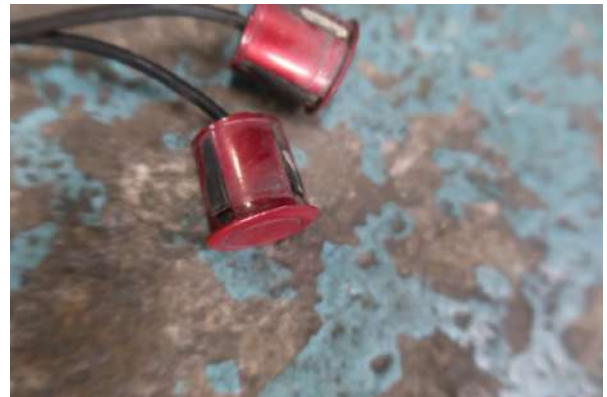



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 5626A

RE-INSPECTION

