

ASS. REC. BY:

REF:

C72 / 210050321KV

Kennerh

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

22 days

Res.: Yes or No

Lum Sum:

1.8.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

CBG 8279A Regn: 11, 17

Type: M.Car / M.Cycle / Bus (Van) / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

NIS NV350

c.c.

2481

Colour

Green

A/C:

Insured / Std / NI / NA

Sp. Reading

9088

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JNIMC 24268 0009637

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

195R15x8

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

12/4/21

D.O.I.

22/4/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Terana said unable to locate two parts.

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. \$

Fees

Others

TOTAL

Report Format:

Lump Sum / I.B.I: (\$

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$



TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 1

M/S : DAIMLER FLEET MANAGEMENT S'PORE PTE LTD

1 GATEWAY DRIVE
#15-08 WESTGATE TOWER
SINGAPORE 608531

TEL : 6849 8118

FAX :

ATTN : ACCOUNTS DEPT

YOUR REF NO : SMK8410K

CLAIM TYPE : THIRD PARTY

TP INS. CO. : CHINA TAIPING INSURANCE (SINGAPORE) PTE

ACCIDENT DATE : 12/04/2021

TP VEH REG NO : SMK8410K

ESTIMATE

NO : QUOT202104-000034(00)

DATE : 21/04/2021

POLICY NO : 999995580

VEH REG NO : GBG8279A

MAKE/MODEL : NISSAN NV350 PANEL VAN 2.5
5AT 5DR EURO V

CHASSIS NO : JN1MC2E26Z0009637

ENGINE NO : YD25002157B

REG. DATE : 2017

Not Authorised

Summary BQ paid

22 days

Estimate Repair Cost to Vehicle No : GBG8279A

Description	Quantity	Unit Price	Amount
		S\$	S\$
NET PRICE			
1 Tailgate	1	2,597.90	2,597.90 ✓
2 Tailgate outer chrome	1	535.70	535.70 ?
3 Tailgate absorber - RH / LH	2	237.00	474.00 X
4 Tailgate hinges - RH / LH	2	75.00	150.00 X
5 Tailgate lock	1	287.10	287.10 ✓
6 Tailgate lock cover	1	45.00	45.00 ✓
7 Tailgate lock striker	1	60.00	60.00 ?
8 Tailgate lock remote control	1	198.70	198.70 ?
9 Tailgate lock actuator	1	178.50	178.50 ?
10 Tailgate lock actuator fuel lid opener	1	164.00	164.00 ?
11 Tailgate weatherstrip	1	167.00	167.00 ✓
12 Tailgate inner trimboard	1	198.00	198.00 ✓
13 Tailgate trimboard clips	15	5.50	82.50 ✓
14 Tailgate centre logo	1	79.90	79.90 ✓
15 Tailgate 'NV350' emblem	1	85.25	85.25 ✓
16 Tailgate 'URVAN' emblem	1	85.25	85.25 ✓
17 Rear end panel (outer)	1	216.00	216.00 ✓
18 Rear end panel (inner)	1	460.80	460.80 ✓
19 Rear cross member (outer)	1	462.00	462.00 ?
20 Rear cross member (inner)	1	613.00	613.00 ?
21 Rear bumper	1	667.20	667.20 ✓
22 Rear bumper reinforcement	1	667.20	667.20 X
23 Rear bumper retainer - LH / RH	2	181.00	362.00 ✓
24 Rear step panel	1	0.00	0.00 ✓
25 Rear step garnish	1	0.00	0.00 ?
26 Rear bumper clips	15	5.50	82.50 ✓
27 Taillamp assy - RH / LH	2	247.30	494.60 ✓
28 Rear fender - LH	1	2,006.90	2,006.90 ✓
29 Rear exhaust silencer	1	993.60	993.60 ✓
30 Rear exhaust bracket	1	50.00	50.00 ✓
31 Rear exhaust mounting	2	23.00	46.00 ✓
32 Front wiper garnish	1	226.00	226.00 ?



TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 2

M/S : DAIMLER FLEET MANAGEMENT S'PORE PTE LTD
1 GATEWAY DRIVE
#15-08 WESTGATE TOWER
SINGAPORE 608531

TEL : 6849 8118

FAX :

ATTN : ACCOUNTS DEPT

YOUR REF NO : SMK8410K

CLAIM TYPE : THIRD PARTY

TP INS. CO. : CHINA TAIPING INSURANCE (SINGAPORE) PTE

ACCIDENT DATE : 12/04/2021

TP VEH REG NO : SMK8410K

ESTIMATE

NO : QUOT202104-000034(00)

DATE : 21/04/2021

POLICY NO : 999995580

VEH REG NO : GBG8279A

MAKE/MODEL : NISSAN NV350 PANEL VAN 2.5
5AT 5DR EURO V

CHASSIS NO : JN1MC2E26Z0009637

ENGINE NO : YD25002157B

REG. DATE : 2017

Estimate Repair Cost to Vehicle No : GBG8279A

Description	Quantity	Unit Price	Amount
33 Front wiper blade – RH / LH	1	\$S 36.40	\$S 36.40 X
34 Front wiper arm – RH / LH	2	\$S 93.80	\$S 187.60 X
35 Front wiper cap – RH / LH	1	\$S 8.50	\$S 8.50 X
36 Front panel	1	\$S 1,227.00	\$S 1,227.00 ✓
37 Front panel reinforcement	1	\$S 416.00	\$S 416.00 ?
38 Front panel insulator	1	\$S 85.00	\$S 85.00 ?
39 Front lower panel - RH	1	\$S 352.50	\$S 352.50 ?
40 Front lower panel - LH	1	\$S 352.50	\$S 352.50 X
41 Front lower panel - center	1	\$S 86.00	\$S 86.00 ?
42 Front corner panel – LH	1	\$S 534.60	\$S 534.60 ✓
43 Front grille	1	\$S 479.30	\$S 479.30 ✓
44 Front grille emblem	1	\$S 79.90	\$S 79.90 ✓
45 Headlamp assy - RH / LH	2	\$S 481.50	\$S 963.00 ✓
46 Front bumper	1	\$S 578.00	\$S 578.00 ✓
47 Front bumper reinforcement	1	\$S 705.00	\$S 705.00 ✓
48 Front bumper center bracket	1	\$S 117.00	\$S 117.00 ?
49 Front bumper side retainer - LH / RH	1	\$S 181.00	\$S 181.00 ✓
50 Front bumper center bar	1	\$S 235.00	\$S 235.00 ?
51 Front bumper fog lamp – LH / RH	2	\$S 215.20	\$S 430.40 ✓
52 Front bumper fog lamp cover - RH / LH	2	\$S 120.00	\$S 240.00 ✓
53 Front bumper clips	15	\$S 5.50	\$S 82.50 ✓
54 Inter-cooler assy	1	\$S 2,121.60	\$S 2,121.60 ✓
55 Oil cooler	1	\$S 700.30	\$S 700.30 ?
56 Air-con cooling coil	1	\$S 680.00	\$S 680.00 ?
			\$S 23,615.70
		Less 10%	\$S 2,361.56
			\$S 21,254.14
SPECIAL NET			
57 Rear windscreen sealant	1	\$S 60.00	\$S 60.00 ✓
58 Tailgate "70km/h" sticker	1	\$S 25.00	\$S 25.00 ✓
59 Tailgate '5 pax' sticker	1	\$S 25.00	\$S 25.00 ✓
60 Rear bumper sensors	1	\$S 200.00	\$S 200.00 ✓
61 Rear number plate	1	\$S 40.00	\$S 40.00 ✓
62 Front number plate	1	\$S 40.00	\$S 40.00 ✓



TONG LUCK AUTO PTE LTD
 160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722
 Tel: 6250 0088 Fax: 6250 5545
 Email: operation@tlauto.com.sg
 GST No: 201700521W UEN No: 201700521W

PAGE: 3

M/S : DAIMLER FLEET MANAGEMENT S'PORE PTE LTD
 1 GATEWAY DRIVE
 #15-08 WESTGATE TOWER
 SINGAPORE 608531

TEL : 6849 8118 FAX :
 ATTN : ACCOUNTS DEPT

YOUR REF NO : SMK8410K
 CLAIM TYPE : THIRD PARTY
 TP INS. CO. : CHINA TAIPING INSURANCE (SINGAPORE) PTE
 ACCIDENT DATE : 12/04/2021
 TP VEH REG NO : SMK8410K

ESTIMATE

NO : QUOT202104-000034(00)
 DATE : 21/04/2021
 POLICY NO : 999995580
 VEH REG NO : GBG8279A
 MAKE/MODEL : NISSAN NV350 PANEL VAN 2.5
 5AT 5DR EURO V
 CHASSIS NO : JN1MC2E26Z0009637
 ENGINE NO : YD25002157B
 REG. DATE : 2017

Estimate Repair Cost to Vehicle No : GBG8279A

Description	Quantity	Unit Price	Amount
		S\$	S\$
LABOUR			390.00
63 To remove and refit rear windscreen glass			
64 To transfer damaged tailgate interior mechanism to new tailgate	1	150.00	150.00 120
65 To remove and refit rear bumper sensor	1	120.00	120.00 60
66 To check and rectify wiring system	1	100.00	100.00 50
67 To panel beat and straighten rear floorboard panel, front & rear rear chassis frame, to cut and weld rear end panel, LH rear fender, front panel, including replacement of parts and align where necessary, to refit and adjust the same	1	80.00	80.00 40
	1	2,800.00	2,800.00 2200
68 To putty and spray paint on affected areas (front & rear portion)	1	2,800.00	2,800.00 1800
69 To supply art works & paste decal on both side panel, tailgate and bonnet	1 (Bill)	2,200.00	2,200.00 7
			8,250.00
		TOTAL	S\$ 29,894.14
		ADD GST @ 7%	2,092.59
		GRAND TOTAL	S\$ 31,986.73

SINGAPORE DOLLAR THIRTY-ONE THOUSAND NINE HUNDRED EIGHTY-SIX AND CENTS SEVENTY-THREE ONLY

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

FOR TONG LUCK AUTO PTE LTD

Your NCD will be affected due to late reporting

 SINGAPORE ACCIDENT STATEMENT

ANNALS OF THE ENTOMOLOGICAL SOCIETY OF AMERICA

- (c) The report shall also specify the details of the complaint as stated by the complainant.
- (d) This report shall be submitted to the Policyholder and/or the Authorised Person.
- (e) This report document shall be an original and duplicate as provided. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- (f) The cause and acceptance of this report by insurance companies is not an admission of policy liability on the part of the insurance companies.
- (g) Any issue remaining may be referred to the Police for investigation.
- (h) This report will be reviewed by the Director of the Civil Service Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and the copies of this report will, at a fee, be made available upon application by interested parties.
- (i) In the event of any issues to the insurers, the policy contract in the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	14/04/2021 02:04 (SGT)
Date of Accident	12/04/2021 16:00 (SGT)
Exact Location of Accident	PIE, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBG8279A

INSURED POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	DAIMLER FLEET MANAGEMENT SINGAPORE PTE LTD
Company Reg No	1XXXXX778Z
Email Address	norazman.abdul_aziz@daimler.com
Mobile Phone No	(Phone) +65-68498118
Alternative Phone No	(Office) +65-68498118

VEHICLE PARTICULARS

Manufacturer	Nissan
Model	Nv350
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	0

INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	Yes
Policy Number	999995580
Cover Note Number	-


DRIVER

Name of Driver	NAY MYO AUNG
Passport No/FIN	GXXXXX071x

PLAN

A - GR8279A
 B - SMK 8410K
 C - YP3250U
 D - 4N4307K
 E - SMY 4015Y
 F - QGG5355B

CONTACT

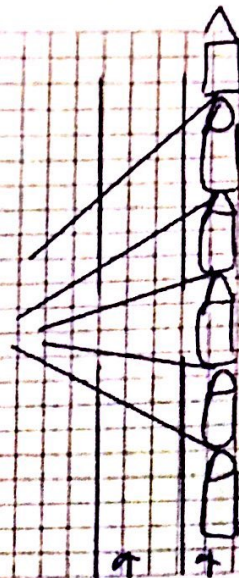

C

D

E

F

A

B

(LP-1602/1)

TUAS

T

PIE

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO ATTACHED STATEMENT.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time:

Driver's Signature

(If driver is not the policyholder)

VERIFY BY AJAX MARS (ARC)
 REPORTING OFFICER
 MOHAMED SHARIL BIN SATAR

Reporting Centre Personnel's Signature