

ASS. REC. BY:

REF: C72/ 21005181/k9f3

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s Goldbell

of _____

Insured: _____

Policy No. DMCVSNW00060492000Claims No. SNM21D202356C01Sum Insured: _____ Excess: 500

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

Bal. or Market Value: B 38k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 04 days Res.: Yes or NoLum Sum: 1.21 % 3 Val.: Yes or NoCA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: G80 9805R Yr Regn: 08/15
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: NIS Cebrata c.c. 2953Colour: Silver A/C: Insured / Std / NI / NASp. Reading: 193975 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JNISCEI-247 0857239Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orMod: M11 / S/Rlm / STD A/Rlm orTyre Size: F: Pirelli 195R15X8
R Maxxis 155R12X8(D)

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front		Rear
R/Bal.	<u>P</u> mm	R/Bal. <u>P.P</u> mm
L/Bal.	<u>P</u> mm	L/Bal. <u>P.P</u> mm
D.O.A.	<u>22/4/21</u>	D.O.I. <u>28/4/2021</u>

Survey held at

Des. of Damages: FR Rear / O/S / N/S / U/C / Rooftop orFR O/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

28/04/21 @ 3.49pm revert to Kah Leong via Merimen.

30/04/21 @ 9.26am Kah Leong informed C/A via Merimen.

30/04/21 @ 9.53am Informed Yin Siew C/A & ex: \$500 by email.

Kenneth confirmed final fig \$2552.60 (Red \$2095.43, 45%)

Date/Time, File Pass to?

☐ : Prell. Report

11/18/05 Typist

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: 4Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S - R.S. ... SI

Fees

Others

TOTAL

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech Invs (\$ _____)☐ : Weekend (\$ _____)Report Format: MER-ODLump Sum / I.B.I. (\$) 2552.60

Goldbell Engineering Pte Ltd
8 Tuas Ave 18, Singapore
638892

Insurer Reference: GBD9805R
Repairer Reference: GBD9805R
Date calculated: 26/04/2021 4:08 PM

Full Report
Registration: GBD9805R
Printed: 26/04/2021 4:35 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Kon Yin Siew	Currency:	SGD
Claim Reference:	GBD9805R	Date of Incident:	22/04/21
Estimated Repair Time:	7	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	NISSAN		
Model:	CABSTAR		
Sub Model:	BASE MODEL		
Model Sheet Number:	71 94 01		
Registration:	GBD9805R		
VIN number:			
Odometer:	16150		
Model Specs			
SINGLE CAB	PREPARE OFF VEHICLE	CLEAR COAT HARD	TWO COAT PEARL/MICA


Not Notified
Repairing
4 days

Vehicle Condition

Vehicle Status
Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

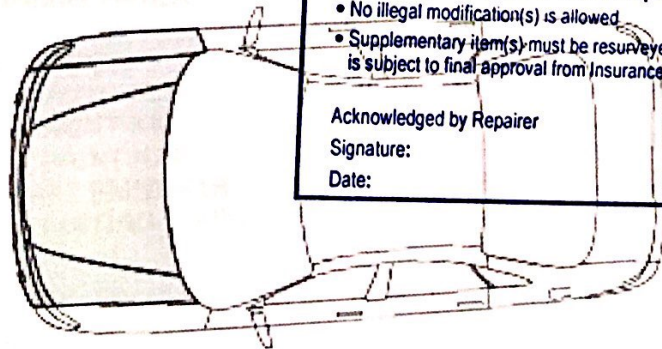

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Labour

Time Base 10 WU/h

Price = 42.00 SGD/h

Audatex System Using Manufacturer Times

Page 1 of 4

PRINT DATE 26/04/2021

Code	Description	WU	Price SGI
UA10A1)	R + R FRONT BUMPER		
UA10A1)	RENEW FRONT BUMPER (REMOVED)	6.0	25.20
NO NUMBER	R + R TYPE BADGE	2.0	8.40
RE20A1)	R + R LEFT HEADLAMP	3.0	12.60
	(FRONT GRILLE REMOVED)	5.0	21.00
	INCLUDES: REQUIRED COVERS REMOVE AND REFIT. ADJUST HEADLAMPS.		
RE20A1)	R + R RIGHT HEADLAMP	3.0	12.60
	(FRONT GRILLE REMOVED)		
	INCLUDES: REQUIRED COVERS REMOVE AND REFIT. NOT INCLUDED: ADJUST HEADLAMPS.		
NO NUMBER	R + R R/F WIND DEFLECTOR	2.0	8.40
NO NUMBER	R + R FRONT VENTILATION GRILLE	2.0	8.40
NO NUMBER	R + R BADGE NISSAN	3.0	12.60
NO NUMBER	RENEW FRONT PANEL	90.0	378.00
RG12A1)	R + R WIPER MOTOR	1.0	4.20
RG16A1)	R + R WASHER RESERVOIR	3.0	12.60
UG10A1	R + R WINDSCREEN	11.0	46.20
RG24A1)	R + R WIPER LINKAGE	1.0	4.20
VC10A1	R + R INSTRUMENT PANEL CPL	25.0	105.00
	INCLUDES: R + R COVERS, GLOVE BOX, INSTRUMENT HOUSING AND STEERING WHEEL		
TB10A1)	R + R HEATING	4.0	16.80
NO NUMBER	DRAIN-REFILL COOLENT LIQUID	3.0	12.60
1482	RIGHT FRONT DOOR REPAIR	30 50.0*	210.00
	Labour Cost	Hrs 21.40	WU 214.0
	Panel / Mechanical Labour		898.80
	Total of Labour		898.80

Paint

Paint Work

Code	Description - TWO COAT PEARL/MICA	Time Basis 10 WU/h	WU	Price SGI
	FRONT PANEL NEW PART PAINTING		31.0	
	FRONT AIR GRILLE NEW PART PAINT K1R		5.0	
	L/HEADLAMP TRIM NEW PART PAINT K1R		3.0	
	R/HEADLAMP TRIM NEW PART PAINT K1R		3.0	
	R/F WIND DEFLECTOR NEW PART PAINT K1R		4.0	
	RIGHT FRONT DOOR REPAIR PAINTING >50%		27.0	

Paint Material Per Part

Code	Description	Price SGI
0900	FRONT PANEL NEW PART PAINTING	43.40
0410	FRONT AIR GRILLE NEW PART PAINT K1R	13.20
0421	L/HEADLAMP TRIM NEW PART PAINT K1R	0.90
0422	R/HEADLAMP TRIM NEW PART PAINT K1R	0.90
0888	R/F WIND DEFLECTOR NEW PART PAINT K1R	9.80
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	39.50

PRINT DATE 26/04/202

Labour Cost - Paint

Factor
Time Paint
Preparation Main Work Metal
Preparation Comp. Work Plastic
Total

42.00 SGD/h

10 WU/h

Hrs	WU	Price SGI
	73.0	
2.50	25.0	105.00
0.50	5.0	21.00
10.30	103.0	432.60

Material Cost - Paint

New Part Painting
New Part Painting - Plastic K1R
Repair Painting
Material-constant Metal Preparation
Material-constant Plastic
Total

Price SGI
43.40
25.00
39.50
28.60
9.00
145.60

Spare Parts

				prices as at 2015-06-01/0:	
Code	Description	Part Number	Part Source		Price SGI
0281	FRONT BUMPER	62022 MB40A	Original	By ✓	620.00
0343	FRONT GRILLE BRACKET	62392 MB40A	Original	By ✓	40.00
0410	FRONT AIR GRILLE	F2320 MB4HA	Original	By ✓	325.00
0421	L/HEADLAMP TRIM	75894 MA00E	Original	By X	85.00
0422	R/HEADLAMP TRIM	75893 MA00E	Original	By ✓	85.00
0431	BADGE	99081 MB40C	Original	By X	71.50
0432	BADGE MODEL	65092 MB40A	Original	By X	71.50
0561	LEFT HEADLAMP ASSY	26060 MB500	Original	By X	325.00
0562	RIGHT HEADLAMP ASSY	26010 MB500	Original	By ✓	325.00
0888	R/F WIND DEFLECTOR	F1262 MA0M0	Original	By ✓	280.00
0900	FRONT PANEL	61200 MB530	Original	By X	720.00
1436	W-WASHER BOTTLE	28910 LC60A	Original	By ✓	95.00
					0.00
f: OEM Parts					3,043.00
n: Non-OEM Parts					
u: Used parts					
Savings					
Subtotal					
Total					3,043.00

Extras

Code	Description	Price SGI
1000	ROC STICKER	30.00
Total Extras		30.00

Final Calculation

	SGD	SGI
Parts	3,043.00	
Total Parts		3,043.00
Labour Time Base 10 WU/h		
Total 214.0 WU X 42.00 SGD/h	898.80	
Total of Labour		898.80
Total Of Extras		30.00
Paint Work Time Base 10 WU/h		
Labour Cost 103.0 WU X 42.00 SGD/h	432.60	
Material Cost	145.63	
Total Paint Including Material		578.23
Repair Cost Excludes GST		4,550.03
GST (+7.0%)		318.51
Repair Cost Included GST		4,868.54

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

PRINT DATE 26/04/202

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission
Date of Accident 23/04/2021 17:23 (SGT)
Exact Location of Accident 22/04/2021 19:15 (SGT)
Additional Location Information Lornie Hwy, Singapore
Country/State of Loss -
Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBD9805R
INSURED/POLICYHOLDER
Is company? Yes
Name Of Registered Owner LIAN TAT (JACK) ENGINEERING PTE LTD
Company Reg No 2XXXXX000Z
Email Address liantat.mail@gmail.com
Mobile Phone No (Phone) +65-82212659
Alternative Phone No (Office) +65-82212659

VEHICLE PARTICULARS

Manufacturer Nissan
Model Cabstar
Variant -
Exact purpose for which vehicle was being used at time of accident Employment
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Commercial vehicle
Transmission Manual
CC 2953

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMCVSNW00060492000
Cover Note Number -

DRIVER

Name of Driver CHUNG CHEE MENG
NRIC No SXXXX994H

 Accident report SG0F214N0006

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Owner ID:

Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

PQP Paid:

COE Rebate Amount:

Total Rebate Amount:

Company

000Z

GBD9805R

Yes

26 Apr 2021

NISSAN

CABSTAR 3.0 5M/T ABS 2DR 2WD EURO 5

Silver

2015

ZD30346765K

JN15C2F24Z0857239

-

\$25,089.00

05 Aug 2015

05 Aug 2015

0

\$1,255.00

No

-

\$0.00

04 Aug 2025

C - Goods Vehicle & Bus

10

\$39,502.00

\$16,883.00

\$16,883.00

The information contained herein is correct as at 26 Apr 2021

OK

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No 65470000



T/20210423/2062

1 of 3

Report No. T/20210423/2062

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 23/04/2021 13:55 Vide Report No.: Station Diary No.:

Informant's Particulars

Name of Informant: CHUNG CHEE MENG Address: APT BLK 412 ANG MO KIO AVENUE 10 #04-893 TECK GHEE HEARTLANDS SINGAPORE 560412
ID Type / ID No.: NRIC NO / S2538994H Contact No.: Home/Office: Mobile: 82212659
Nationality: SINGAPORE CITIZEN Email:
Sex: Male Age: 69 Date of Birth: 11/09/1951 Type of Informant: Driver
Race: Chinese Language: Institution / School Name:
Occupation: SUPERVISOR Driving Licence Information: Class: 2B,2A,2,3 Date of Expiry:

General Information of the Accident

Type of Accident:	Non-Injury Others	Drink Drive: No	Date/Time of Accident: 22/04/2021 19:15	Type of Location:
Location: LORNIE HIGHWAY				
Weather: Drizzling	Road Surface: Wet	Road Speed Limit:		
Traffic Flow:	Traffic Control:	Traffic Volume: Light		
Type of Collision: Moving Vehicle Against - Animal				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
GBD9805R	Lorry	NISSAN	CABSTAR 3.0 5M/T ABS 2DR 2WD EURO 5	Silver		0

Details of Person Involved

Any Pedestrian Involved: No
No. of Pedestrians Injured: NIL Use of Pedestrian Crossing: NA



SINGAPORE
POLICE FORCE



T/20210423/2062

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

2 of 3

Report No. T/20210423/2062

CONTINUATION OF REPORT

Driver			
Name	CHUNG CHEE MENG		ID No. S2538994H
Related Vehicle	NIL		Contact No. 82212659
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date Class: 2B,2A,2.3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

ON THE STATED DATE, TIME, PLACE

I EXITED PIE INTO LORNIE HIGHWAY, I WAS TRAVELLING AT A SPEED OF 50KM/HR. JUST BEFORE I CAN ENTER THE TUNNEL INTO UPPER THOMSON ROAD, I HEARD A SOUND FROM THE FRONT OF THE VEHICLE. I SAW A WILD BOAR CROSSING FROM MY RIGHT TO LEFT SIDE AND IT WENT TO THE BUSHES. I DID NOT SEE THE WILD BOAR WHEN I HIT IT. THAT ALL