



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD  
#17-00 TOWER BLOCK  
MND COMPLEX  
SINGAPORE 069110

INV No. AC2103534

INV Date 18/05/2021

Reference CC3/EQI21005303/Ktcq2

Code EQI

### PROFESSIONAL SERVICE FEE

Vehicle No. SHC 5154X

Insured Veh. SLR 2527Y

Claim No. DM21HO00661/SG

Policy No.

Accident Date 24/04/2021

Inspection Date 28/04/2021

Description	Total
Survey Inspection	300.00
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>300.00</b>
<b>GST (7%)</b>	<b>21.00</b>
<b>Grand Total</b>	<b>321.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110			Ref: CC3/EQI21005303/Ktcq2	Date: 18/05/2021
			Code: EQI	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	SLR 2527Y	Veh. Inspected	SHC 5154X	
Policy No.		Coverage (\$)	0.00	
Claim No.	DM21HO00661/SG	Excess (\$)	0.00	
Assign From		Assign Date	28/04/2021	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	VF1ABL15AUC276543	Colour	METALLIC WHITE / RED	
Odometer	648447 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	SAILUN	7 mm	
L/H Front Tyre	215/60 R16	SAILUN	7 mm	
R/H Rear Tyre	215/60 R16	SAILUN	8 mm	
L/H Rear Tyre	215/60 R16	SAILUN	8 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	24/04/2021	Inspection Date	28/04/2021	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5154X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	BUMPER COVER REAR	BURST	561.70	561.70
1	BUMPER LOWER REAR	DENTED / CRACKED	411.90	411.90
1	BUMPER REFLECTOR LH	CRACKED	16.60	16.60
1	BUMPER REFLECTOR RH	SERVICEABLE	16.60	-
1	BUMPER BRACKET CTR REAR	DISTORTED	98.10	98.10
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	82.10	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	59.80	-
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	80.80	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	54.20	-
1	FENDER PANEL REAR RH	TO REPAIR SEE LABOUR	1,933.20	-
1	WHEELARCH REAR RH	SERVICEABLE	275.40	-
1	ABSORBER REAR	SERVICEABLE	217.30	-
1	BUMPER BEAM REAR	BENT	547.80	547.80
1	BUMPER BEAM BRACKET LH REAR	DISTORTED	114.50	114.50
1	BUMPER BEAM BRACKET RH REAR	BENT	114.50	114.50
1	OUTER PANEL REAR (END PANEL)	BENT	745.80	745.80
1	OUTER PANEL REAR (END PANEL)TRIM	DENTED	404.56	404.56
1	BOOT REAR	BENT	1,677.20	1,677.20
1	BOOT LOCK	DENTED	246.60	246.60
1	BOOT LOCK CATCH	TO REPAIR SEE LABOUR	41.70	-
1	BOOT FINISHER	SERVICEABLE	344.70	-
1	BOOT STRUT LH	SERVICEABLE	145.10	-
1	BOOT STRUT RH	SERVICEABLE	145.10	-
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	254.20	-
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	254.20	-
1	BOOT BADGE 'RENAUNT'	NECESSARY	82.40	82.40
1	BOOT BADGE	NECESSARY	95.80	95.80
1	BOOT REFLECTOR LAMP LH	SERVICEABLE	277.70	-

Report Ref No. CC3/EQI21005303/Ktcq2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	277.70	-
1	TAILLAMP LH	SERVICEABLE	401.40	-
1	TAILLAMP RH	SERVICEABLE	401.40	-
1	EXHAUST REAR	TO REPAIR SEE LABOUR	5,263.60	-
1	EXHAUST CAP REAR	TO REPAIR SEE LABOUR	125.40	-
	LESS 10% DISCOUNT		-1,576.91	-511.75
			14,192.15	4,605.71
1	BOOT WEATHERSTRIP (SN) (50%)	CUT	178.20	89.10
	LESS 10% DISCOUNT		-17.82	-
			160.38	89.10
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	17.82	-
1	LICENSE PLATE WITH HOLDER FRT (SN)	SERVICEABLE	120.00	-
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INNER SPONGE SEAL WINDSCREEN	NOT NECESSARY	130.00	-
			1,509.82	132.00
	<b><u>LABOUR</u></b>			
	TO REMOVE AND REFIT REAR BIG AND SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	300.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		3,000.00	660.00

Report Ref No. CC3/EQI21005303/Ktcq2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FENDER PANEL REAR RH,BOOT LOCK CATCH,BOOT HINGE LH,BOOT HINGE RH,EXHAUST REAR AND EXHAUST CAP REAR .		3,000.00	600.00
	TO RUST-PROOFING OF THE AFFECTED AREAS .		170.00	60.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	60.00
	TO TRANSFER OF BOOTLID FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE .	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX ,RENEW THE SAME ,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT .	NOT NECESSARY	220.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
			7,880.00	1,520.00
<b>GRAND TOTAL</b>			<b>23,742.35</b>	<b>6,346.81</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>3,200.00</b>

Report Ref No. CC3/EQI21005303/Ktcq2

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date of Submission	26/04/2021 20:46 (SGT)
Date of Accident	24/04/2021 22:40 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	JUNCTION OF RIVERVALE DR AND RIVERVALE LANE
Country/State of Loss	Singapore

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC5154X
-----------------------------	----------

#### INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Company Reg No	2XXXXX878K
Email Address	claims@transcab.com.sg
Mobile Phone No	(Phone) +65-62866666
Alternative Phone No	(Office) +65-62866666

#### VEHICLE PARTICULARS

Manufacturer	Renault
Model	Latitude
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private hire
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1998

#### INSURANCE COMPANY

Name of Insurance Company	AXA Insurance Pte Ltd
Type of Coverage	ThirdParty
Fleet Policy	Yes
Policy Number	VFX/P2413997
Cover Note Number	NA

#### DRIVER

Name of Driver	MOHAMAD NOOR BIN MAJEED
NRIC No	SXXXX974Z



Date Of Birth	30/10/1958
Occupation	Outdoor
Date Of Driving Pass	04/03/1980
Driving experience	41 YEARS AND 1 MONTH
Gender	Male
Mobile Number	(Phone) +65-85021021
Alt. Phone Number	-
Email Address	claims@transcab.com.sg
Address	182 RIVERVALE CRES #16-319
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	No
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### PASSENGER 1

Name	MA'IL BIN OSMAN
Gender	Male

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Kim Keat Neighbourhood Police Post
Police Station Phone No	(Phone) +65-18002529999
Alt. Police Station Phone No	(Fax) +65-63554311
Police Station Address	Blk 231 Lorong 8 Toa Payoh #01-186 Singapore 310231
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT T/20210426/2036


#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	VIDEO HAS BEEN FORWARDED TO TRANSCAB SERVICES & AXA INSURANCE
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1



SKETCH PLAN

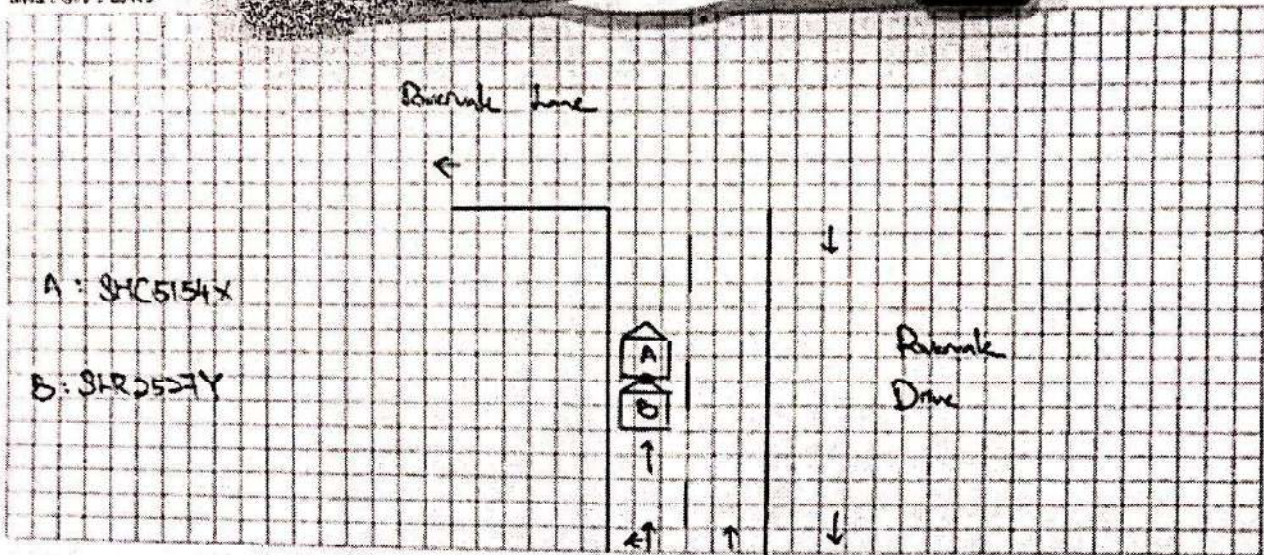

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO ATTACHED STATEMENT.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

VERIFY BY AJAX MARS (ARC)  
REPORTING OFFICER  
WONG JUN KEAT

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SHC 5154X

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

