



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2108395

INV Date 07/12/2021

Reference CC4/LPC21005395/R1rs3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMV 8617Z
Insured Veh. YP 1262Z
Claim No. 21/21/21/VC05/024526
Policy No. Z21VC05007141
Accident Date 30/04/2021
Inspection Date 05/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21005395/R1rs3q2 Date: 07/12/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YP 1262Z	Veh. Inspected	SMV 8617Z	
Policy No.	Z21VC05007141	Coverage (\$)	0.00	
Claim No.	21/21/21/VC05/024526	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	03/05/2021	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN NOTE 1.2 CVT	c.c	1198	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	JN1TAAE12Z0980177	Colour	GREY	
Odometer	61306 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/65 R15	CONTINENTAL	5 mm	
L/H Front Tyre	185/65 R15	CONTINENTAL	5 mm	
R/H Rear Tyre	185/65 R15	CONTINENTAL	5 mm	
L/H Rear Tyre	185/65 R15	CONTINENTAL	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/04/2021	Inspection Date	05/05/2021	
Survey held at	MOVA AUTOMOTIVE PTE LTD BLK 1008 BUKIT MERAH LANE 3 #01-04/06/08 . SINGAPORE 159722			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			22 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMV 8617Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	ROOF PANEL (N)	TO REPAIR SEE LABOUR	879.60	-
2	ROOF MOULDING RH & LH @\$153.30 (N)	SERVICEABLE	306.60	-
1	ROOF LINING (N)	DEFORMED	430.10	430.10
1	FRONT WINDSCREEN GLASS MOULDING (N)	NOT NECESSARY	136.00	-
1	BONNET (N)	BENT	786.00	786.00
1	BONNET LOCK (N)	SERVICEABLE	112.50	-
2	BONNET HINGE RH & LH @\$41.80 (N)	SERVICEABLE	83.60	-
1	RADIATOR GRILLE ASSY (N)	CRACKED	262.60	262.60
1	RADIATOR GRILLE LOGO (N)	NECESSARY	69.70	69.70
10	RADIATOR GRILLE CLIPS @\$4.40 (N)	NECESSARY	44.00	44.00
2	HEADLAMP ASSY RH & LH @\$1474.20 (N)	CRACKED	2,948.40	2,948.40
1	FRONT BUMPER (N)	TORN	534.90	534.90
2	FRONT BUMPER BRACKET RH & LH @\$54.10 (N)	NECESSARY	108.20	108.20
1	FRONT BUMPER SPONGE (N)	CRACKED	195.30	195.30
1	FRONT BUMPER REINFORCEMENT (N)	BENT	381.60	381.60
2	FRONT BUMPER RETAINER RH & LH @\$24.90 (N)	NECESSARY	49.80	49.80
1	FRONT BUMPER LOWER GRILLE -CENTER (N)	SERVICEABLE	344.00	-
2	FRONT BUMPER GRILLE RH & LH (N) (NPA)	SERVICEABLE	-	-
1	FRONT BUMPER UNDER COVER (N) (NPA)	SERVICEABLE	-	-
10	FRONT BUMPER CLIPS @\$4.40 (N)	NECESSARY	44.00	44.00
1	FRONT TOW COVER (N)	SERVICEABLE	26.50	-
2	FRONT FENDER COWLING RH & LH @\$86.40 (N)	SERVICEABLE	172.80	-
10	FRONT FENDER COWLING CLIPS @\$4.40 (N)	NOT NECESSARY	44.00	-
1	SUPPORT PANEL (N)	TO REPAIR SEE LABOUR	380.50	-
1	AIR CON ALUMINIUM PIPE (N)	BENT	115.20	115.20
2	REAR DOOR RH & LH @\$971.20 (N)	O/S BENT / N/S TO REPAIR SEE LABOUR	1,942.40	971.20
2	REAR DOOR STICKER RH & LH @\$29.90 (N)	N/S SERVICEABLE / O/S NECESSARY	59.80	29.90
2	REAR DOOR OUTER MOULDING RH & LH @\$122.80 (N)	NECESSARY	245.60	245.60

Report Ref No. CC4/LPC21005395/R1rs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR DOOR LOCK RH & LH @\$166.70 (N)	SERVICEABLE	333.40	-
2	REAR DOOR WEATHERSTRIP RH & LH @\$86.40 (N)	N/S SERVICEABLE / O/S NECESSARY	172.80	86.40
1	REAR DOOR TRIM BOARD RH (N)	DEFORMED	659.70	659.70
1	SPARE WHEEL PANEL (N)	SERVICEABLE	564.00	-
1	SPARE WHEEL BOARD (N)	SERVICEABLE	441.20	-
1	SPARE TYRE SCREW (NPA) (N)	NOT NECESSARY	-	-
1	SPARE TYRE SPONGE (N)	BROKEN	152.00	152.00
1	REAR CHASSIS MEMBER RH (N)	SERVICEABLE	397.30	-
1	REAR EXHAUST SILENCER (N)	BENT	480.00	480.00
1	CENTER EXHAUST PIPE (N)	SERVICEABLE	399.80	-
1	REAR EXHAUST HEAT COVER (N)	BENT	162.80	162.80
1	PETROL TANK (N)	SERVICEABLE	739.60	-
1	REAR SEAT BELT RH (NPA) (N)	NOT NECESSARY	-	-
2	FRONT SEAT BELT RH & LH (NPA) (N)	NOT NECESSARY	-	-
1	STEERING AIR BAG (N)	ACTIVATED	2,206.80	2,206.80
1	DASHBOARD ASSY (N)	TORN	1,149.30	1,149.30
1	DASHBOARD AIR BAG (N)	ACTIVATED	2,590.20	2,590.20
1	REAR KEYLESS SENSOR (NPA) (N)	NOT NECESSARY	-	-
1	REAR SPEAKER BOARD (NPA) (N)	NOT NECESSARY	-	-
2	REAR FENDER RH & LH @\$863.50 (N)	BUCKLED	1,727.00	1,727.00
2	REAR FENDER INNER TRM RH & LH @\$387.40 (N)	SERVICEABLE	774.80	-
2	REAR FENDER INNER PANEL RH & LH @\$420.00 (N)	SERVICEABLE	840.00	-
2	REAR FENDER COWLING RH & LH @\$54.60 (N)	N/S SERVICEABLE / O/S DEFORMED	109.20	54.60
1	TAILGATE (N)	BUCKLED	976.40	976.40
2	REAR QUARTER GLASS INNER TRIM RH & LH (NPA) (N)	SERVICEABLE	-	-
1	TAILGATE GLASS (N)	BROKEN	1,240.00	1,240.00
1	TAILGATE LOGO (N)	NECESSARY	69.70	69.70
1	TAILGATE EMBLEM -NOTE (N)	NECESSARY	76.30	76.30
1	TAILGATE GARNISH (N)	SCRATCHED	243.90	243.90
1	TAILGATE LOCK (N)	SERVICEABLE	126.70	-
1	TAILGATE LOCK STRIKER (N)	SERVICEABLE	37.10	-
1	TAILGATE WEATHERSTRIP (N)	NECESSARY	86.40	86.40

Report Ref No. CC4/LPC21005395/R1rs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE INNER TRIM (N)	SERVICEABLE	162.00	-
1	TAILGATE LOCK SENSOR (N)	SERVICEABLE	84.40	-
1	TAILGATE OUTER HANDLE (N)	SERVICEABLE	243.90	-
2	TAILGATE DAMPER RH & LH @\$182.50 (N)	SERVICEABLE	365.00	-
2	TAILLAMP ASSY RH & LH @\$460.70 (N)	BROKEN	921.40	921.40
2	TAILLAMP PANEL RH & LH @\$206.50 (N)	SERVICEABLE	413.00	-
4	TAILLAMP CLIPS @\$7.40 (N)	NECESSARY	29.60	29.60
1	REAR BUMPER (N)	DEFORMED	514.00	514.00
1	REAR BUMPER SPONGE (N)	CRACKED	121.90	121.90
2	REAR BUMPER BRACKET RH & LH @\$86.50 (N)	NECESSARY	173.20	173.20
2	REAR BUMPER RETAINER RH & LH @\$44.00 (N)	NECESSARY	88.00	88.00
2	REAR BUMPER REFLECTOR RH & LH @\$65.00 (N)	N/S SERVICEABLE / O/S CRACKED	130.00	65.00
2	REAR BUMPER REFLECTOR GARNISH RH & LH (NPA) (N)	NOT NECESSARY	-	-
10	REAR BUMPER CLIPS @\$4.40 (N)	NECESSARY	44.00	44.00
1	REAR END PANEL (N)	BENT	552.80	552.80
1	REAR END PANEL TOP GARNISH (N)	SERVICEABLE	83.50	-
2	CENTER PILLAR STICKER RH & LH @\$38.60 (N)	SERVICEABLE	77.20	-
	LESS 10% DISCOUNT		-3,146.40	-2,168.79
			28,317.60	19,519.11
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT WINDSCREEN GLASS SEALANT (SN)	NOT NECESSARY	40.00	-
1	FRONT NUMBER PLATE (SN)	MISSING	40.00	40.00
1	AIR CON CONDENSER (SN)	BENT	517.90	517.90
2	AIR GUIDE RH & LH @\$57.70 (SN)	DEFORMED	115.40	115.40
1	RADIATOR ASSY (SN)	SERVICEABLE	584.00	-
1	RADIATOR FAN ASSY (SN)	SERVICEABLE	597.00	-
1	RADIATOR SPARE TANK (SN)	SERVICEABLE	72.10	-
1	SPARE TYRE (SN)	SERVICEABLE	200.00	-
3	REAR EXHAUST MOUNTINGS @\$26.80 (SN)	TORN	80.40	80.40
1	REAR AXLE (SN)	BENT	963.60	963.60
2	REAR SHOCK ABSORBER RH & LH @\$75.40 (SN)	SERVICEABLE	150.80	-
2	REAR TYRES RH & LH @\$200.00 (SN)	SERVICEABLE	400.00	-

Report Ref No. CC4/LPC21005395/R1rs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SEAT ASSY (SN)	CRUMPLED	1,580.00	1,580.00
1	REAR SEAT REST RH (SN)	BENT	1,080.00	1,080.00
1	SRS CONTROL UNIT (SN)	SERVICEABLE	1,589.50	-
1	STEERING AIR BAG CIRCUIT WIRE (SN)	SERVICEABLE	237.30	-
2	FRONT IMPACT SENSOR RH & LH @\$390.80 (SN)	SERVICEABLE	781.60	-
2	ENGINE MOUNTING RH & LH @\$186.70 (SN)	TORN	373.40	373.40
2	REAR QUARTER GLASS SEALANT RH & LH @\$40.00 (SN)	NECESSARY	80.00	80.00
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	40.00	40.00
1	TAILGATE WIPER ARM COVER (SN)	MISSING	14.20	14.20
1	TAILGATE WIPER ARM (SN)	SCRATCHED	87.90	87.90
1	TAILGATE WIPER MOTOR (SN)	SERVICEABLE	411.70	-
1	TAILGATE SOLAR FILM (SN)	NECESSARY	200.00	200.00
1	THIRD BRAKE LIGHT (SN)	CRACKED	252.00	252.00
1	SET REVERSE CAMERA (SN)	SERVICEABLE	380.00	-
1	SET REVERSE SENSOR (SN)	NOT WORKING	200.00	200.00
			11,068.80	5,624.80
	LABOUR			
	TO CUT /WELD SUPPORT PANEL,ROOD PANEL ,REAR FENDER RH & LH ,REAR END PANEL ,REAR CHASSIS MEMBER RH ,SPARE WHEEL PANEL KNOCK AND STRAIGHTEN FRONT BODY MEMBER ,REAR SEAT PANEL,REAR CHASSIS MEMBER LH ,CENTER PILLARS ,REMOVE AND REPLACE ACCIDENT DAMAGED PARTS ,REALIGN ALL CONNECTION .INCLUSIVE OF THE REPAIR OF ROOF PANEL,SUPPORT PANEL AND REAR DOOR LH .		3,600.00	3,000.00
	SPRAY PAINT BONNET ,SUPPORT PANEL ,FRONT BUMPER ,ROOF PANEL ,REAR DOORS ,CENTER PILLARS ,REAR FENDERS ,REAR FENDER INNER PANEL,SPARE WHEEL PANEL ,REAR END PANEL,REAR SEAT PANEL ,TAILLAMP PANELS ,TAILGATE ,REAR BUMPER .		2,800.00	2,000.00
	REMOVE & REINSTALL AIR CON CONDENSER ,PIPE,HOSE AND RECHARGE AIR CON GAS .		120.00	60.00
	REMOVE & REFIT DASHBOARD ASSY ,GLOVE BOX AND OTHER ATTACHMENT PARTS.		300.00	150.00
	REMOVE & REFIT FRONT AND REAR SEAT BELTS,CENTER GARNISH ,TRIM COVERING.		100.00	100.00

Report Ref No. CC4/LPC21005395/R1rs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & REFIT REAR SEAT ASSY ,REAR FLOOR CARPET INNER TRIMS .		200.00	100.00
	REMOVE & REFIT REAR DOOR TRIM BOARD ,MECHANISM AND CHECK LOCKING SYSTEM.		120.00	80.00
	REMOVE & REINSTALL REAR QUARTER GLASS AND CHECK WATER LEAKAGE .		200.00	100.00
	REMOVE & REINSTALL FRONT WINDSCREEN GLASS AND CHECK WATER LEAKAGE.	NOT NECESSARY	120.00	-
	REMOVE & REINSTALL TAILGATE GLASS AND CHECK WATER LEAKAGE .		120.00	120.00
	REMOVE & REINSTALL REAR EXHAUST SILENCER ,PIPE ,HEAT COVER ,MOUNTING.		100.00	60.00
	REMOVE & REINSTALL PETROL TANK ,PIPE HOSE GARNISH .	NOT NECESSARY	80.00	-
	REMOVE & REINSTALL ROOF LINING ,UPHOLSTERY COVERING.		100.00	60.00
	REMOVE & REINSTALL ENGINE MOUNTINGS ,BRACKETS .	NOT NECESSARY	120.00	-
	TO APPLY SEAL ON WELDING JOINTS.		200.00	100.00
	COMPUTER WHEEL ALIGNMENT.		60.00	60.00
	CHECK CHASSIS ALIGNMENT ON LASER LOCK MACHINE.	NOT NECESSARY	280.00	-
	CHECK WIRING AND FOCUS HEADLIGHT .		40.00	30.00
	RUST PROOF AFFECTED ARES.		160.00	100.00
			8,820.00	6,120.00
GRAND TOTAL			48,206.40	31,263.91
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				24,000.00

Report Ref No. CC4/LPC21005395/R1rs3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMV 8617Z

INSPECTION

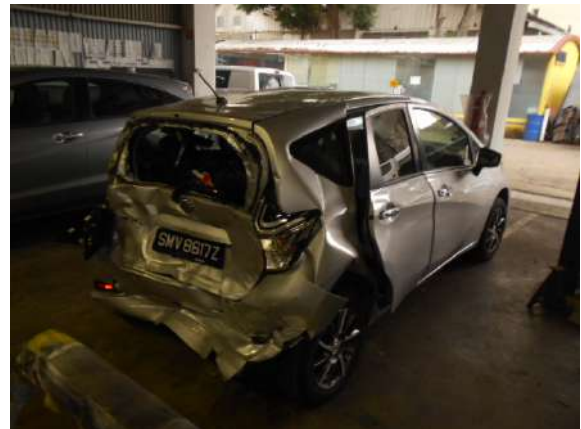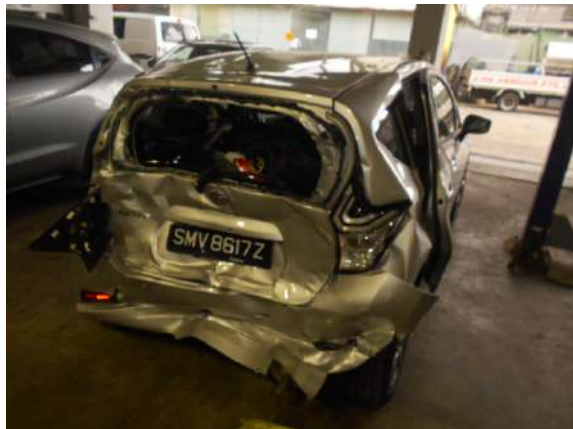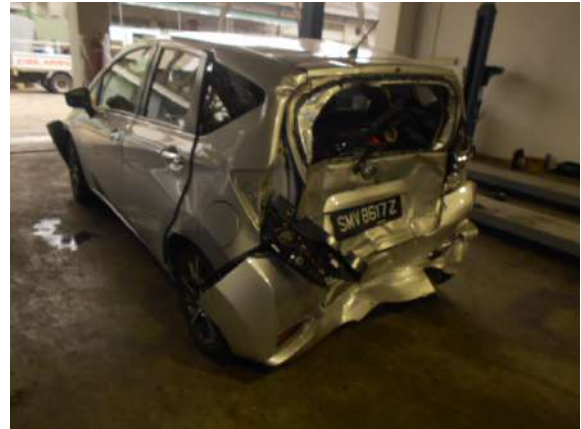



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

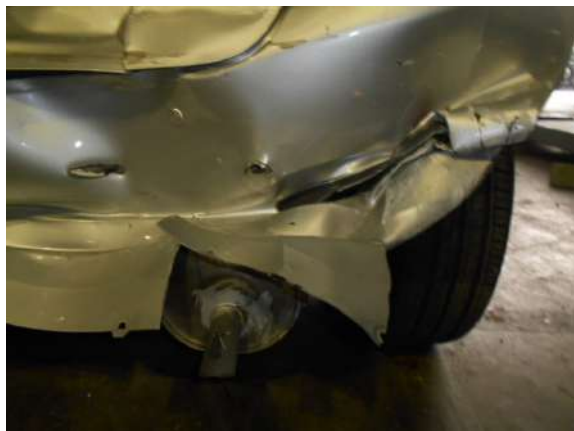





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

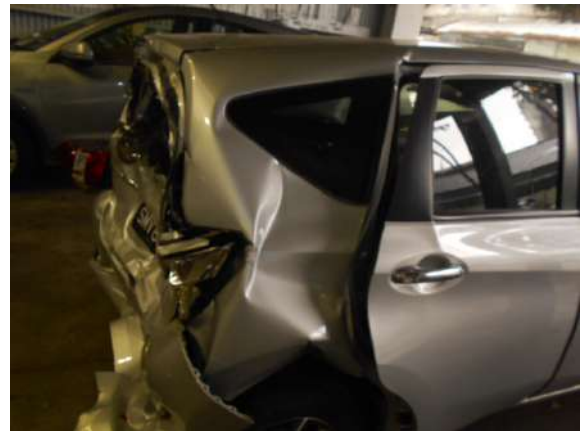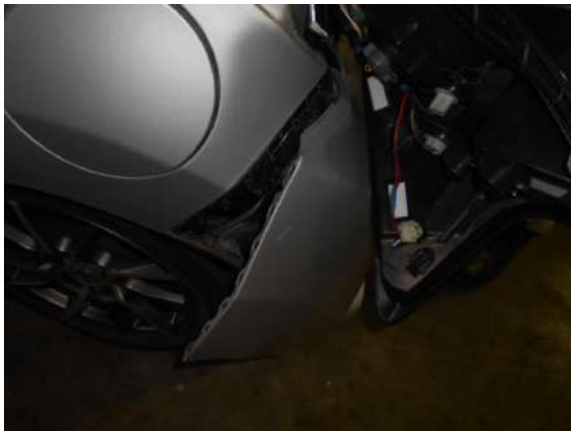



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

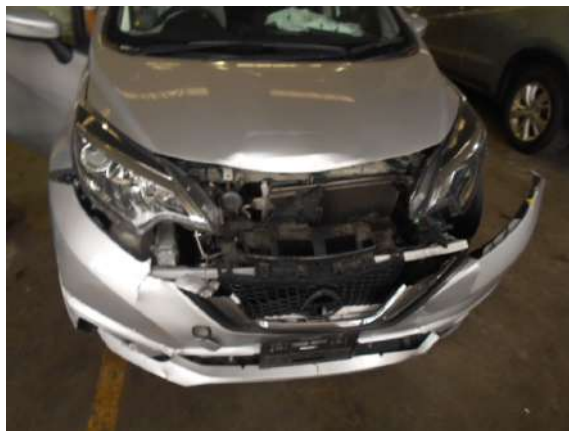




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

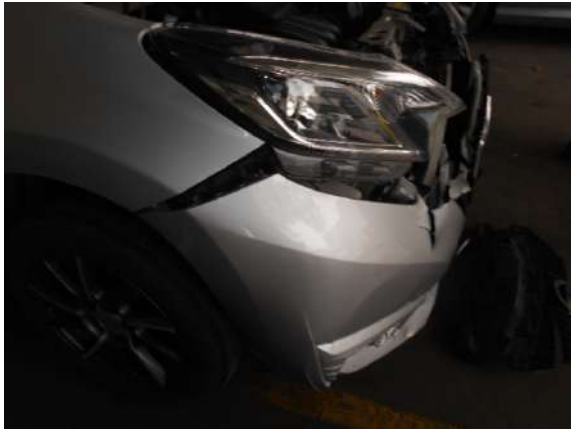



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

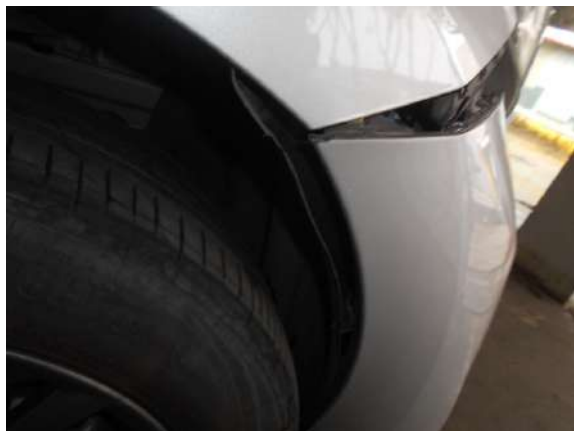



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMV 8617Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

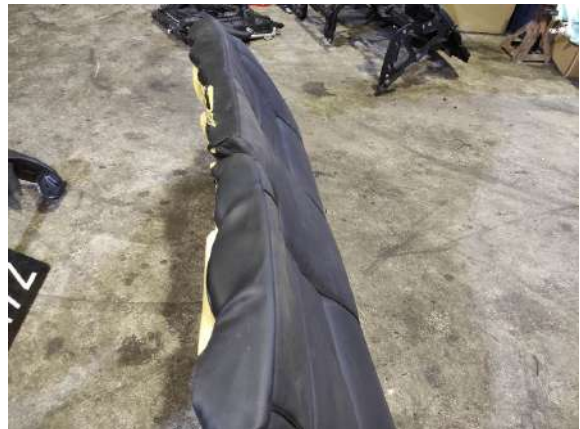



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

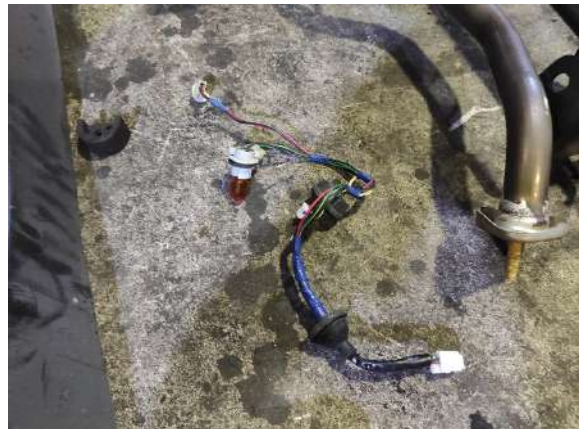



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

