



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2106743

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/09/2021
Reference CC6/CTI21005440/Aea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMD 1295J
Insured Veh. SGV 6360Y
Claim No. SNM21D202577/C02
Policy No. DMHCSNW00000611900
Accident Date 01/05/2021
Inspection Date 04/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21005440/Aea3q2 Date: 29/09/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SGV 6360Y	Veh. Inspected	SMD 1295J	
Policy No.	DMHCSNW00000611900	Coverage (\$)	0.00	
Claim No.	SNM21D202577/C02	Excess (\$)	0.00	
Assign From		Assign Date	04/05/2021	
2. Vehicle Particulars & Condition				
Make & Model	HONDA JAZZ	c.c	1318	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	JHMGK3850JX226573	Colour	WHITE	
Odometer	26676 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	175/65 R15	YOKOHAMA	6 mm	
L/H Front Tyre	175/65 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	175/65 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	175/65 R15	YOKOHAMA	6 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY AND UNDERCARRIAGE. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	01/05/2021	Inspection Date	04/05/2021	
Survey held at	CN MOTORS PTE LTD 1 KAKI BUKIT AVENUE 6 BLK C #01-41 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMD 1295J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	TO REPAIR SEE LABOUR	583.00	-
1	FRONT BUMPER SIDE RETAINER RH	NOT NECESSARY	15.00	-
1	RH FRONT HEADLAMP	CUT	511.50	511.50
1	RH FRONT HEADLAMP LOWER BRACKET	NOT NECESSARY	24.00	-
1	RH FRONT FENDER	DENTED	560.20	560.20
1	RH FRONT FENDER INNER COWLING	TORN	85.10	85.10
1	RH FRONT FENDER INNER GARNISH	NOT NECESSARY	78.10	-
1	RH FRONT LOWER ARM	BENT	363.80	363.80
1	RH FRONT SHOCK ABSORBER	BENT	317.60	317.60
1	RH FRONT KNUCKLE ARM	DAMAGED	321.00	321.00
1	RH FRONT KNUCKLE ARM BEARING	DAMAGED	220.90	220.90
1	RH FRONT DRIVE SHAFT	NOT NECESSARY	1,181.00	-
1	FRONT STEERING RACK AND PINION	BENT	2,145.00	1,890.00
1	FRONT CROSS MEMBER	NOT NECESSARY	804.90	-
1	RH FRONT RIM WHEEL CAP	NOT NECESSARY	75.60	-
1	RH FRONT WIND MIRROR	CUT	498.70	498.70
1	RH FRONT WIND MIRROR COVER	NOT NECESSARY	121.30	-
1	RH FRONT DOOR	DENTED	1,489.00	872.00
1	RH FRONT DOOR HING TOP	NOT NECESSARY	95.00	-
1	RH FRONT DOOR HING BOTTOM	NOT NECESSARY	95.00	-
1	RH FRONT DOOR CHECKER	NOT NECESSARY	57.60	-
1	RH FRONT DOOR WEATHERSTRIPE	NOT NECESSARY	250.00	-
1	RH FRONT DOOR POWER WINDON REGULATOR GEAR	DAMAGED	548.00	298.00
1	RH FRONT DOOR POWER WINDON MOTOR	NOT NECESSARY	596.70	-
1	RH FRONT DOOR POWER WINDON GLASS OUTER CHANNEL	NOT NECESSARY	104.10	-
1	RH FRONT DOOR POWER WINDON GLASS INNER CHANNEL	NOT NECESSARY	104.10	-
1	RH FRONT DOOR GLASS INNER RUBBER	NOT NECESSARY	260.10	-
1	RH FRONT DOOR INNER TRIM BOARD	CRACKED	892.60	495.00
1	RH FRONT DOOR LOCK	DAMAGED	483.10	483.10

Report Ref No. CC6/CTI21005440/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RH FRONT DOOR INNER LOCK LEVEL	NOT NECESSARY	189.40	-
1	RH FRONT DOOR INNER LOCK LEVEL COVER	NOT NECESSARY	22.10	-
1	RH FRONT DOOR OUTER HANDLER	NOT NECESSARY	227.40	-
1	RH FRONT DOOR WIRE HARNESS	NOT NECESSARY	165.30	-
1	RH FRONT DOOR OUTER PILLAR	TO REPAIR SEE LABOUR	163.80	-
1	RH FRONT DOOR INNER PILLAR	TO REPAIR SEE LABOUR	175.50	-
1	RH ROCKER PANEL OUTER	TO REPAIR SEE LABOUR	215.60	-
1	RH ROCKER PANEL INNER	TO REPAIR SEE LABOUR	205.60	-
1	RH DOOR CENTER PILLAR OUTER	TO REPAIR SEE LABOUR	984.20	-
1	RH DOOR CENTER PILLAR INNER	TO REPAIR SEE LABOUR	836.90	-
1	RH REAR DOOR	DENTED	1,487.00	895.00
1	RH REAR DOOR SEAL	NOT NECESSARY	68.00	-
1	RH REAR DOOR HING TOP	NOT NECESSARY	98.00	-
1	RH REAR DOOR HING BOTTOM	NOT NECESSARY	98.00	-
1	RH REAR DOOR CHECKER	NOT NECESSARY	57.60	-
1	RH REAR DOOR WEATHERSTRIPE	NOT NECESSARY	119.30	-
1	RH REAR DOOR INNER TRIM BOARD	CRACKED	856.70	485.00
1	RH REAR DOOR WIRE HARNESS	NOT NECESSARY	165.30	-
1	RH REAR RIM WHEEL CAP	NOT NECESSARY	75.60	-
	LESS 20% DISCOUNT		-3,818.66	-1,659.38
			15,274.64	6,637.52
1	RH FRONT DOOR BLACK STICKER (SN)	NECESSARY	189.00	50.00
1	RH REAR DOOR BLACK STICKER (SN)	NECESSARY	189.00	50.00
	LESS 20% DISCOUNT		-75.60	-
			302.40	100.00
	<u>SPECIAL NETT ITEMS</u>			
10	RH FRONT FENDER INNER COWLING CLIPS @\$4.50 (SN)	NECESSARY	45.00	30.00
1	RH FRONT RIM (SN)	CUT	250.00	250.00

Report Ref No. CC6/CTI21005440/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RH FRONT TYRE (SN)	NOT NECESSARY	190.00	-
10	RH FRONT DOOR INNER TRIM BOARD CLIPS @\$6.50 (SN)	NECESSARY	65.00	30.00
10	RH REAR DOOR INNER TRIM BOARD CLIPS @\$6.50 (SN)	NECESSARY	65.00	30.00
1	RH REAR RIM (SN)	NOT NECESSARY	250.00	-
1	RH REAR TYRE (SN)	NOT NECESSARY	190.00	-
1	RH FRONT DOOR PILLAR SEALANT (SN)	NOT NECESSARY	80.00	-
1	RH CENTER DOOR PILLAR SEALANT (SN)	NOT NECESSARY	80.00	-
1	RH ROCKER PANEL SEALANT (SN)	NOT NECESSARY	80.00	-
			1,295.00	340.00
	LABOUR			
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT BUMPER,RH FRONT DOOR OUTER PILLAR,RH FRONT DOOR INNER PILLAR,RH ROCKER PANEL OUTER,RH ROCKER PANEL INNER,RH DOOR CENTER PILLAR OUTER AND RH DOOR CENTER PILLAR INNER.		2,000.00	1,100.00
	LABOUR FOR SPRAYPAINTING.		1,600.00	1,200.00
	WIRING CHECK.		100.00	30.00
	TO APPLY RUST PROOF ON ACCIDENT AREAS.		250.00	60.00
	TO APPLY TUFF COATING ON ACCIDENT AREAS.	NOT NECESSARY	250.00	-
	LABOUR FOR REMOVE & REFIX CUSHION /UPHOLSTERY/ROOF LINING TO FACILITATE THE REPAIR .	NOT NECESSARY	300.00	-
	LABOUR FOR REMOVE & RENEW BOTH RH DOOR FITTING.		300.00	160.00
	LABOUR FOR REMOVE & RENEW RH FRONT UNDERCARRIAGE /STEERING RACK & PINION.		400.00	350.00
	TO CONDUCT WHEEL ALIGNMENT.		150.00	80.00
	LABOUR FOR PRESS & REMOVE/RENEW RH FRONT WHEEL BEARING.	NOT NECESSARY	120.00	-
	LABOUR FOR REMOVE & TRANSFER BOTH RH DOOR GLASS .	NOT NECESSARY	200.00	-
	TO CONDUCT WATER CHECK LEAKAGE.	NOT NECESSARY	120.00	-
			5,790.00	2,980.00
GRAND TOTAL			22,662.04	10,057.52

Report Ref No. CC6/CTI21005440/Aea3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,000.00
---	--	--	----------

Report Ref No. CC6/CTI21005440/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 1295J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 1295J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

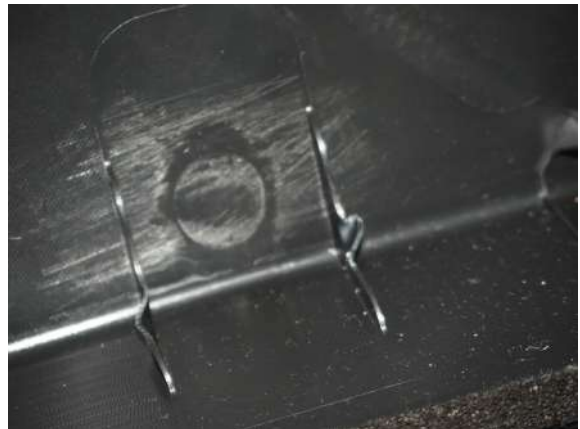



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

