



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2105342
3 ANSON ROAD #16-00	INV Date	29/07/2021
SPRINGLEAF TOWER	Reference	CC3/CTI21005534/Nea3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SHC 6975L
Insured Veh.	SMY 5607G
Claim No.	SNM21D202194/C02
Policy No.	DMPCSNW00072232100
Accident Date	16/04/2021
Inspection Date	10/05/2021

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC3/CTI21005534/Nea3q2 Date: 29/07/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SMY 5607G	Veh. Inspected	SHC 6975L
Policy No.	DMPCSNW00072232100	Coverage (\$)	0.00
Claim No.	SNM21D202194/C02	Excess (\$)	0.00
Assign From		Assign Date	10/05/2021
2. Vehicle Particulars & Condition			
Make & Model	KIA OPTIMA 1.7(A)	c.c	1685
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	KNAGM414MF5642450	Colour	SILVER
Odometer	616350 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	FAIR		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/65 R16	MAXXIS	5 mm
L/H Front Tyre	205/65 R16	MAXXIS	5 mm
R/H Rear Tyre	205/65 R16	MAXXIS	5 mm
L/H Rear Tyre	205/65 R16	MAXXIS	5 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	16/04/2021	Inspection Date	10/05/2021
Survey held at	PREMIER AUTOMOTIVE SERVICES PTE LTD 23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 6975L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	BOOT LID	SERVICEABLE	1,119.00	-
1	BOOT LID LOCK	SERVICEABLE	99.00	-
1	BOOT LID LOCK CABLE	SERVICEABLE	35.00	-
1	BOOTLID STRIKER	SERVICEABLE	21.00	-
1	BOOTLID EMBLEM	NECESSARY	27.00	27.00
1	BOOTLID CRDI	NECESSARY	29.00	29.00
1	BOOT LID RUBBER WEATHERSTRIP	SERVICEABLE	96.00	-
1	BOOT LID LOWER GARNISH	TO REPAIR SEE LABOUR	290.00	-
2	BOOT LID HINGES @\$66.00	SERVICEABLE	132.00	-
2	REAR LICENSE PLATE LAMP @\$30.00	SERVICEABLE	60.00	-
2	BOOTLID HINGE TORSION BAR @\$33.00	SERVICEABLE	66.00	-
1	HANDLE TRUNK LID HOOK	NOT NECESSARY	5.00	-
1	BOOTLID INNER TRIM	SERVICEABLE	190.00	-
1	END PANEL	SERVICEABLE	250.00	-
1	END PANEL INNER GARNISH	SERVICEABLE	74.00	-
1	REAR BUMPER	DEFORMED	696.00	696.00
1	REAR BUMPER LOWER COVER	DEFORMED	206.00	206.00
2	REAR BUMPER SIDE BRACKET O/S & N/S @\$29.00	SERVICEABLE	58.00	-
1	REAR BUMPER INNER SPONGE	SERVICEABLE	114.00	-
1	REAR BUMPER REINFORCEMENT	SERVICEABLE	607.00	-
2	REAR BUMPER STAY O/S & N/S @\$54.00	SERVICEABLE	108.00	-
2	REAR BUMPER REINFORCEMENT LOWER BRACKET @ \$18.00	SERVICEABLE	36.00	-
2	REAR BUMPER REINFORCEMENT UPPER BRACKET @ \$18.00	SERVICEABLE	36.00	-
2	REAR BUMPER REFLECTOR N/S & O/S @\$46.00	SERVICEABLE	92.00	-
	LESS 10% DISCOUNT		-444.60	-95.80
			4,001.40	862.20
<b>SPECIAL NETT ITEMS</b>				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	48.00	48.00

Report Ref No. CC3/CTI21005534/Nea3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET END PANEL INNER GARNISH CLIPS (SN)	SERVICEABLE	30.00	-
1	SET BOOTLID INNER TRIM CLIPS (SN)	SERVICEABLE	52.00	-
1	SET BOOTLID LOWER GARNISH CLIPS (SN)	SERVICEABLE	60.00	-
1	SET BOOTLID STICKERS (SN)	NECESSARY	100.00	30.00
1	SET REVERSE SENSOR (SN)	SERVICEABLE	280.00	-
1	REAR BUMPER TOP PROTECTOR (SN)	NECESSARY	80.00	50.00
1	REAR NO.PLATE WITH CASING (SN)	SERVICEABLE	50.00	-
1	SEALANT (SN)	NOT NECESSARY	50.00	-
1	SUNDRY (SN)	NOT NECESSARY	50.00	-
			800.00	128.00
	<b>LABOUR</b>			
	TO DISMANTLE /REPLACE REVERSE SENSOR TO NEW BUMPER AND RESET TO THE SAME .		120.00	30.00
	TO DISMANTLE /REFIT THE INNER GARNISHES ,INNER LININGS ,INNER TRIMS ,CUSHION SEAT ,CARPET ,ETC TO FACILITATE REPAIRS .	NOT NECESSARY	180.00	-
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS.TO HEAT/WELD ,CUT-OFF THE THE END PANEL,FLOORBOARD PANEL,REAR N/S & O/S FENDERS .INCLUDING KNOCK-OUT ,STRAIGHTEN ,REPAIR ,RESHAPE AND ADJUST OF THE REAR PANEL.INCLUSIVE OF THE REPAIR OF BOOT LID LOWER GARNISH .		1,000.00	360.00
	TO PUTTY AND SPRAY PAINTING ON BOOTLID ,BOOTLID LOWER GARNISH ,REAR BUMPER ,END PANEL ,BOOTFLOOR.		1,000.00	280.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		120.00	40.00
			2,420.00	710.00
	<b>GRAND TOTAL</b>		<b>7,221.40</b>	<b>1,700.20</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>1,350.00</b>

Report Ref No. CC3/CTI21005534/Nea3q2

MUHAMMAD NAZRIL BIN ABDULLAH

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SHC 6975L

## INSPECTION

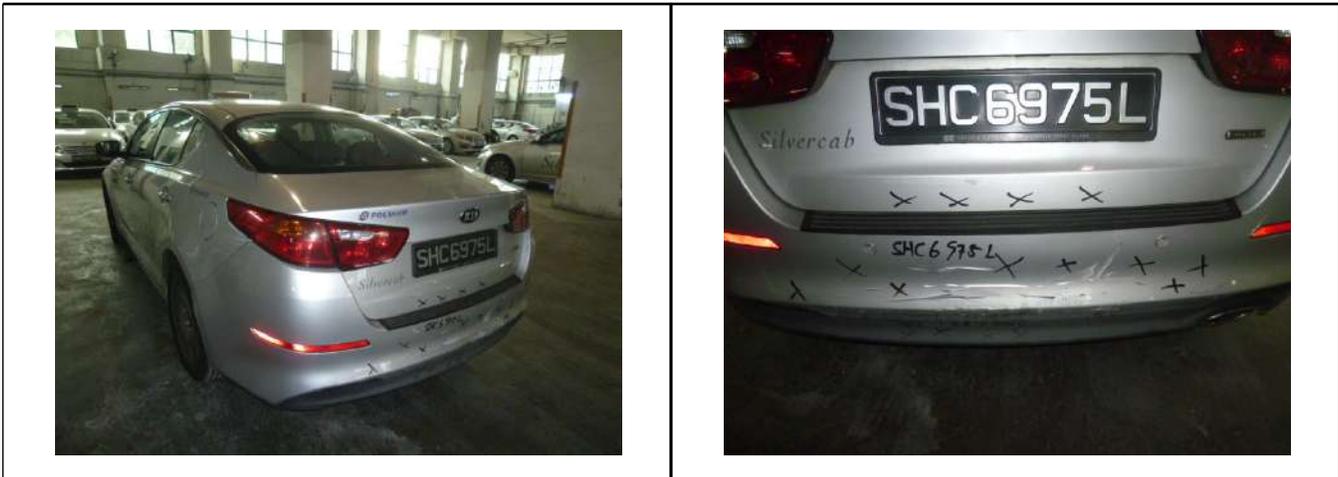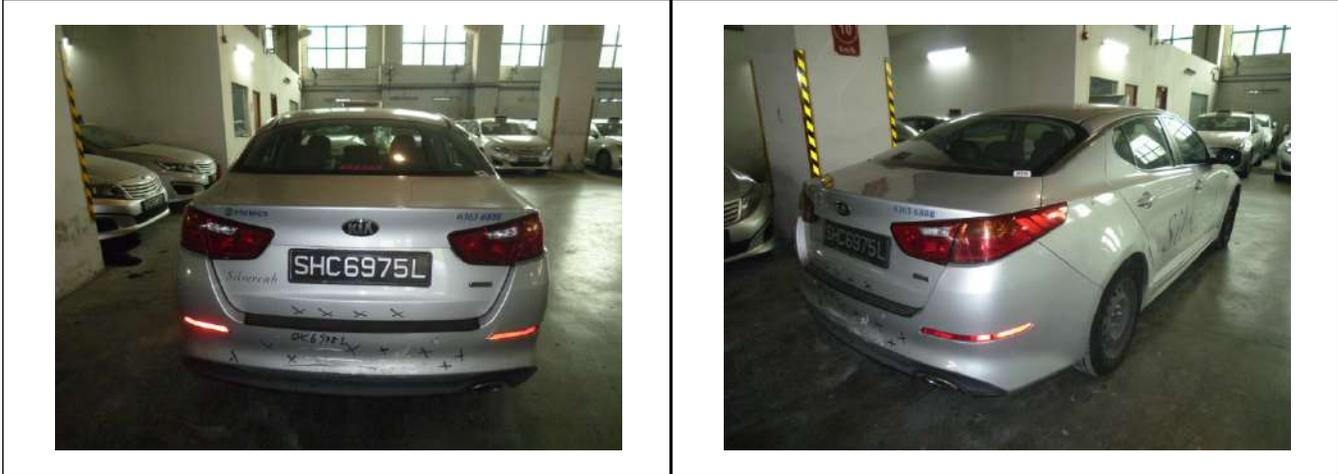



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 6975L

RE-INSPECTION

