

# WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647.Singapore 542224

Email: [Winsongkk@hotmail.com](mailto:Winsongkk@hotmail.com) Contact: 9747 0063

Company Register No. 53326249J

---

|             |                                                                      |                      |
|-------------|----------------------------------------------------------------------|----------------------|
| Our Ref:    | WG/TP/2021-05                                                        |                      |
| Invoice No: | TP/AUTOBULLOX/2021-05                                                | Date 12 January 2021 |
| Vehicle No: | SLQ7175B                                                             |                      |
| Attn:       | SHEEWIN TRAVELLERS LLP                                               |                      |
| Company:    | AUTO BULLOX                                                          |                      |
| Address:    | 53 Ubi Avenue 1, #01-25 . Paya Ubi Industrial Park. Singapore 408934 |                      |

## Invoice

|                    |                                            |
|--------------------|--------------------------------------------|
| Surveyor Fee:      | S\$380                                     |
| Re-inspection Fee: | S\$80                                      |
| Transport:         | S\$60                                      |
| Photographs:       | S\$27/- (@ \$1 per photo, total 27 photos) |
| Total:             | S\$547                                     |

|            |                                                                                     |
|------------|-------------------------------------------------------------------------------------|
| Surveyor:  | Winson Goh                                                                          |
| Signature: |  |
| Date:      | 12 January 2021                                                                     |

# WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647. Singapore 542224  
Email: winsongkk@hotmail.com Contact: 9747 0063  
Company Register No. 53326249J

## ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S : SHEEWIN TRAVELLERS LLP  
C/O AUTO BULLOX  
53 Ubi Avenue 1, #01-25  
Paya Ubi Industrial Park. Singapore 408934

Date : 12 January 2021  
Our Ref : WG/TP/2021-05

### REFERENCE PARTICULARS

Date of Accident : 22 December 2020  
Date of Inspection : 30 December 2020

Type of Inspection : Third Party Claim  
Date of Re-Inspn : 07 January 2021

### VEHICLE PARTICULARS

Registration No : SLQ7175B  
Make : KLA  
Model : FORTE K3 1.6A  
Year : 2017

Engine No : G4FGGH634431  
Chassis No : KNAFJ411MH57175  
Odometer : 112562km  
Colour : Blue

### CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition : Good  
Foot Brake : Serviceable  
Hand Brake : Serviceable

General Body Work : Good  
Steering : Serviceable  
Lightings : Serviceable

### TYRE CONDITION (Remaining estimated life of tyre in mm)

|                 | <u>Make</u>   | <u>Size</u> |
|-----------------|---------------|-------------|
| Front Near side | : Bridgestone | 195/65R16   |
| Front Off Side  | : Bridgestone | 195/65R16   |
| Rear Near Side  | : Bridgestone | 195/65R16   |
| Rear off Side   | : Bridgestone | 195/65R16   |

| <u>Thread Balance</u> |
|-----------------------|
| 5 mm                  |
| 5 mm                  |
| 5 mm                  |
| 5 mm                  |

### GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damage at the rear right portion.  
For details, refer to assessment for repairs and photographs attached.

### ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was **S\$7,300.00** nett at lump sum basis.(Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Nine ( 09 ) working days.

Enclosed Twenty-six ( 26 ) photographs depicting damage to the vehicle.

Inspection conducted at : AUTO BULLOX  
53 Ubi Avenue 1, #01-25 . Paya Ubi Industrial Park. Singapore 408934

In accordance to your instruction, we have **not authorise** repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

VEHICLE NO : SLQ7175B  
MODEL : FORTE K3 1.6A

Our Ref : WG/TP/2021-05

**ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS**

**DESCRIPTION OF PARTS AND NATURE OF REPAIRS**

| A) | SPARE PARTS              | QTY<br>PC/SET | ASSESSED<br>CONDITION |          | ORIGINAL<br>QUOTATION | REVISED<br>QUOTATION |
|----|--------------------------|---------------|-----------------------|----------|-----------------------|----------------------|
| 01 | REAR BUMPER              | 1             | CRACKED               | \$       | 900.00                | \$ 900.00            |
| 02 | REAR BUMPER RETAINER     | 2             | NECESSARY             | \$       | 180.00                | \$ 180.00            |
| 03 | REAR FENDER RH           | 1             | DENTED                | \$       | 1,530.00              | \$ 1,530.00          |
| 04 | REAR WINDSCREEN MOULDING | 1             | NECESSARY             | \$       | 190.00                | \$ 190.00            |
| 05 | REAR DOOR PANEL RH       | 1             | DENTED                | \$       | 1,430.00              | \$ 1,430.00          |
| 06 | REAR DOOR PROTECTOR RH   | 1             | NECESSARY             | \$       | 210.00                | \$ 210.00            |
| 07 | FRONT DOOR PANEL RH      | 1             | REPAIR                | \$       | -                     | \$ -                 |
| 08 | FRONT DOOR PROTECTOR RH  | 1             | NECESSARY             | \$       | 210.00                | \$ 210.00            |
|    |                          |               |                       | \$       | 4,650.00              | \$ 4,650.00          |
|    |                          |               |                       | Less 10% | \$ 465.00             | \$ 465.00            |
|    |                          |               |                       | \$       | <b>4,185.00</b>       | <b>\$ 4,185.00</b>   |

**B) S/NETT ITEM**

|    |                    |       |           |    |                 |                    |
|----|--------------------|-------|-----------|----|-----------------|--------------------|
| 09 | RIM                | 1     | GRAZED    | \$ | 1,200.00        | \$ 900.00          |
| 10 | REAR BUMPER CLIP   | 1 SET | NECESSARY | \$ | 60.00           | \$ 50.00           |
| 11 | JOINT SEALANT      | 1     | NECESSARY | \$ | 150.00          | \$ 120.00          |
| 12 | WINDSCREEN SEALANT | 1     | NECESSARY | \$ | 150.00          | \$ 120.00          |
|    |                    |       |           | \$ | <b>1,560.00</b> | <b>\$ 1,190.00</b> |

**Parts Total :**

|    |                 |    |                 |
|----|-----------------|----|-----------------|
| \$ | <b>5,745.00</b> | \$ | <b>5,375.00</b> |
|----|-----------------|----|-----------------|

**C) LABOUR CHARGES & MISC**

|    |                                                      |    |          |    |          |
|----|------------------------------------------------------|----|----------|----|----------|
| 13 | CHECK REAR WIRING AND LIGHTNING SYSTEM               | \$ | 60.00    | \$ | 50.00    |
| 14 | REMOVE AND REFIT REAR LINING, TRIM AND GARNISH       | \$ | 200.00   | \$ | 180.00   |
| 15 | COMPUTERISED AND CHECK REAR WHEEL ALIGNMENT          | \$ | 180.00   | \$ | 150.00   |
| 16 | REMOVE AND REFIT REAR WINDSCREEN                     | \$ | 180.00   | \$ | 150.00   |
| 17 | TRANSFER PARTS, ATTACHMENT FROM OLD REAR DOOR TO NEW | \$ | 250.00   | \$ | 200.00   |
| 18 | PANEL BEATING ON AFFECTED AREAS                      | \$ | 1,800.00 | \$ | 1,500.00 |
| 19 | SPRAY PAINTING ON AFFECTED AREAS                     | \$ | 1,600.00 | \$ | 1,400.00 |
| 20 | APPLY ANTI RUST ON AFFECTED AREAS                    | \$ | 120.00   | \$ | 100.00   |

**Labour Total :**

|    |                 |    |                 |
|----|-----------------|----|-----------------|
| \$ | <b>4,390.00</b> | \$ | <b>3,730.00</b> |
|----|-----------------|----|-----------------|

**Total Parts and Labour :**

|    |                  |    |                 |
|----|------------------|----|-----------------|
| \$ | <b>10,135.00</b> | \$ | <b>9,105.00</b> |
|----|------------------|----|-----------------|

**FINAL LUMP SUM ADJUSTMENT**

|    |                 |
|----|-----------------|
| \$ | <b>7,300.00</b> |
|----|-----------------|

#### POINT OF IMPACT

The impact was confined to the rear right portion of the vehicle.  
The damages appeared to be consistent as per the accident report statement.  
Please refer the attached schedule and photographs for details.

#### ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

#### CONCLUSION


The repairer has agreed to undertake repair the vehicle at a lump sum basis of **\$7,300.00 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

97

Yours faithfully  
WG APPRAISAL SERVICES



Winson Goh  
Automotive Appraiser


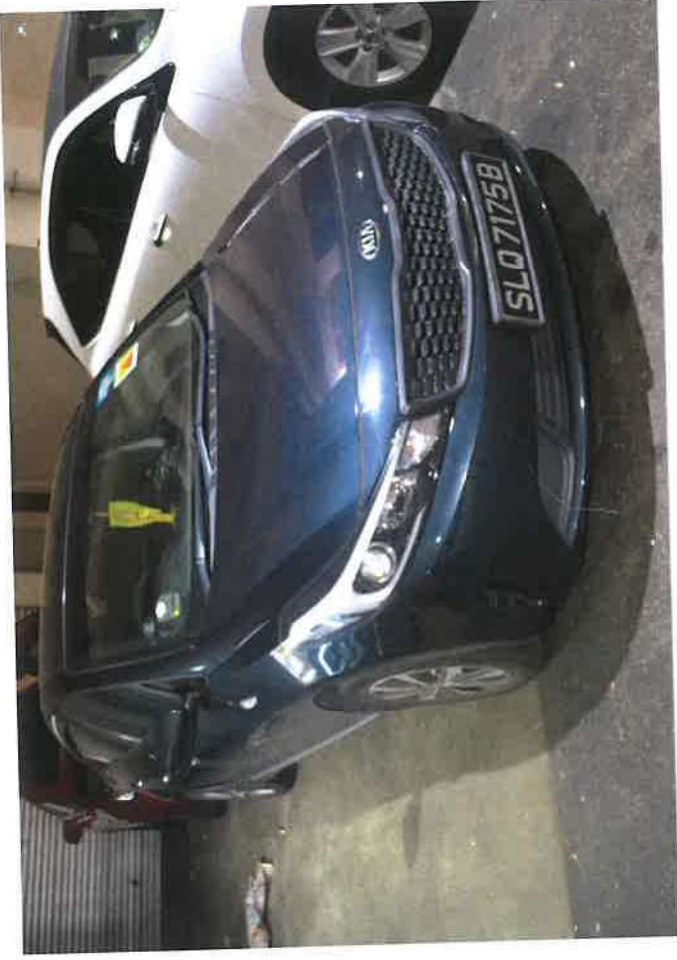










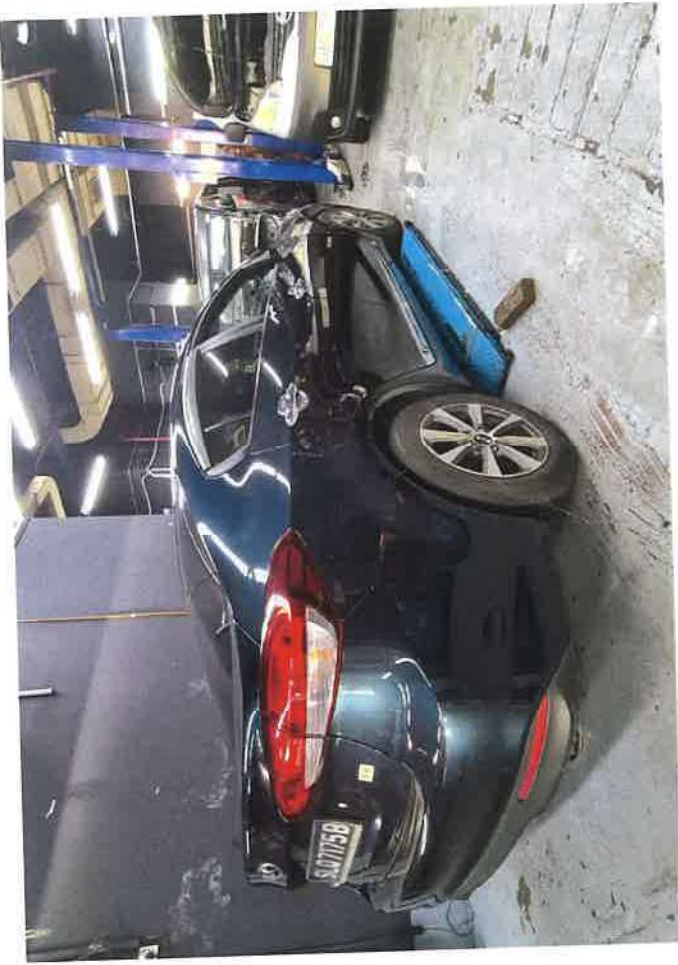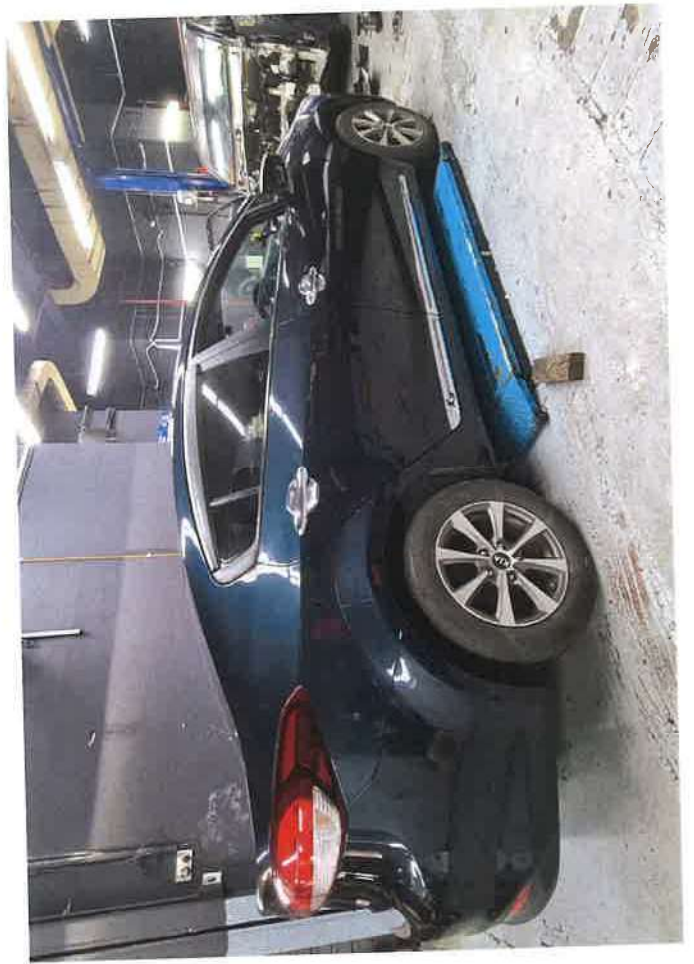



## AUTO BULLOX PTE LTD

53 Ubi Avenue 1#01-25, Paya Ubi Industrial Park, Singapore 408934  
Tel: 6841 5383 Fax: 6841 6043 Email: motoricarzgarage@gmail.com  
Register No.: 201919765N

---

Date: 15/01/2021

Name: SHEEWIN TRAVELLERS LLP  
Address: 331 Bukit Batok Street 33 #05-233  
Singapore 650331  
Vehicle No: SLQ7175B  
Make/Model: Kia Forte K3 1.6A  
Accident Date: 22/12/2020

### **FINAL BILL FOR VEHICLE NO: SLQ7175B**

Supply of parts, labour charges, panel beat and spray painting.  
(Lump Sum Repair)

**\$7,300.00**

**Total (SGD)**

**\$7,300.00**

  
**AUTO BULLOX PTE LTD**