

REF: CS/CTI21005836/Aqf3

ASS. REC. BY ADRIAN

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OE / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLZ 9947E

at Workshop m/s _____

of _____

Insured: GBE 7817P

Policy No. DMCVSNW00019232100

Claims No. SNM21D202773/C2

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 5 days Res: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLZ 9947E

Yr Reg: 2018 May.

Type: ☒ M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or Eclipse Cross

Make: Mit ~~Outlander~~

C.C. 1499

Colour: Bronze

A/C: Insured / Std / Nil / NA

Sp. Reading: 53781

T/Radio: Insured / Std / Nil / NA

Eng/No: _____

C/No: JMAXTGKINJ2001801

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ Inorder / Jammed / Leaked / Burnt orBrake: ☒ Inorder / Jammed / Leaked / Burnt orModi: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size: F: 225/55R18

R: 225/55R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU ☒ PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 06 mm

R/Bal. 06 mm

L/Bal. 06 mm

L/Bal. 06 mm

D.O.A. _____

D.O.I. 20/05/21.

Survey held at

Cycle and Carriage Ubi.

Des. of Damages: Frt / ☒ Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

TP China.

21/5/2021@4.16pm Revise to CTI via Merimen.

MV:

PV:

Nett:

Final fig \$9687, 5 days (Red \$5853, 38%)

Date/Time, File Pass to?

1) 14/07 Typist

Date/Time, File Return to?

2) _____

Report Format:

MER-TP

_____ / LBJ: \$ 9687

Days Of Repair: 5

Resurvey No. of Trip: 1

Add Fee:

☐ Site Insp (\$)☐ Interview (\$)☐ Tech. Invs (\$)☐ Weekend (\$)

Survey Fee:

Transportation:

S + P + SI

Photo:

Other:

TOTAL

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	14/05/2021 12:25 (SGT)
Date of Accident	13/05/2021 12:49 (SGT)
Exact Location of Accident	New Upper Changi Rd, Singapore
Additional Location Information	JUNCTION OF CHAI CHEE ROAD
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLZ9947E
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	LIM CHENG VERN
NRIC No	SXXXX058G
Email Address	wolfinmoon14@yahoo.co.uk
Mobile Phone No	(Phone) +65-96536567
Alternative Phone No	(Home) +65-96536567

VEHICLE PARTICULARS

Manufacturer	Mitsubishi
Model	Eclipse cross
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1500

INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	1800058559-01
Cover Note Number	-

DRIVER

Name of Driver	LIM CHENG VERN
NRIC No	SXXXX058G

Date Of Birth	16/12/1973
Occupation	Indoor
Date Of Driving Pass	20/01/2005
Driving experience	16 YEARS AND 4 MONTHS
Gender	Male
Mobile Number	(Phone) +65-96536567
Alt. Phone Number	(Home) +65-96536567
Email Address	wolfinmoon14@yahoo.co.uk
Address	Blk 478 Siglap Road #03-61 Singapore
Address complement	-
Postcode	454852
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO THE ATTACHMENT

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBE7817P
Vehicle Manufacturer	Toyota
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	KOH BOON CHEW
NRIC No	SXXXX722H
Contact Number	-
Address	-

Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	2

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that :

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date &
Time 14 MAY 2021 12:10 PM

Driver's Signature (If driver is not the policyholder) / Date
& Time



Witnessed by Reporting Centre
Personnel

Sketch Plan

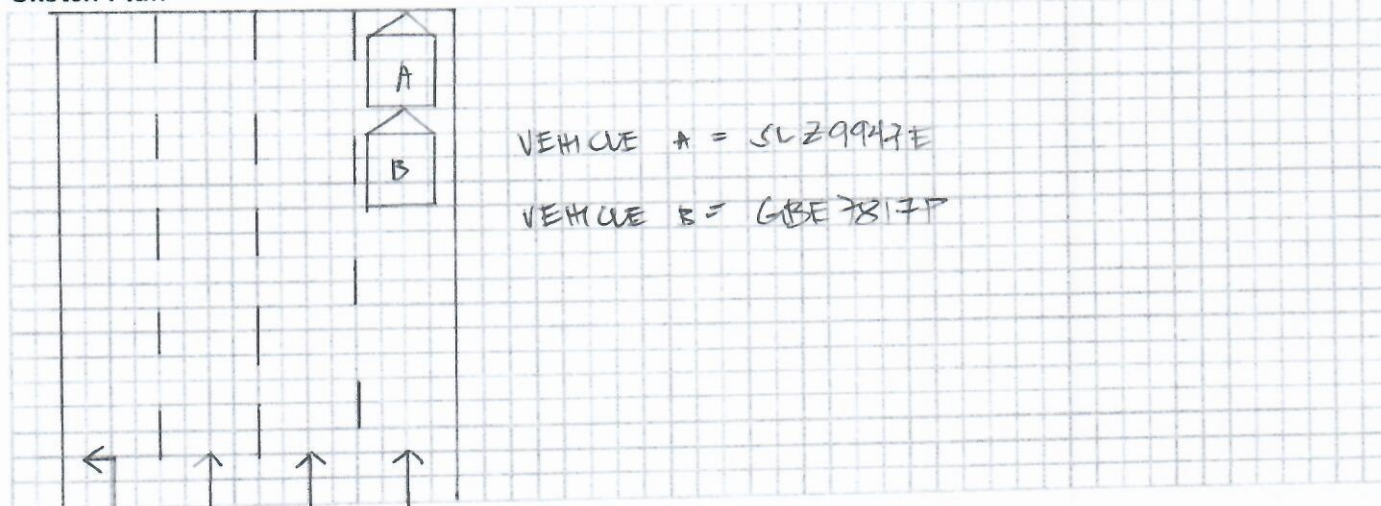

Describe Circumstances of the Accident

I was driving along New Upper Changi Road (towards east). As I approached the traffic junction, the lights turned amber and I proceeded to brake and slow down my car. I stopped my car just before the junction.

Lorry GBE7817P was following very closely behind my car and didn't stop on time, rear ending my car from behind.

Declaration

We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date &
Time 14 MAY 2021 12:10pm

Driver's Signature (If driver is not the policyholder) / Date
& Time



Witnessed by Reporting Centre
Personnel



CYCLE & CARRIAGE AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : LIM CHENG VERN
Period of Insurance : 25 May 2020 To 24 May 2021
Engine No. : 4B40DL7315
Chassis No. : JMAXTGK1WJZ001801

Vehicle No. : SLZ9947E
Policy No. : 1800058559-01
Endorsement No. :
Issued Date : 05 May 2020

ABOUT THE COVER

Make/Model : MITSUBISHI Eclipse Cross 1.5
Engine Capacity/Tonnage : 1,499.00 CC Sum Insured : Market Value First Year of Registration : 2018
Driver Restriction : NA Off Peak Car : No Insuring with COE/PARF : Yes
Person or Classes of Persons Entitled to Drive* :

a) The Policyholder

b) Any other person who is driving on the Policyholder's order or with his/her permission.

This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Inexperienced Driver Excess" ("IDR") if You are or Your Authorised Driver (named or unnamed) has less than 2 years' driving experience.

Age Condition : 40 years old and above

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1500cc - 1600cc

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189), Section 95 of the Road Transport Act, 1987 (Malaysia) and Road Transport (Amendment) Act 2019, are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$800 Theft - \$0 Flood Cover - \$800

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

LIM CHENG VERN - \$800 (Own Damage), \$800 (Flood Cover)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1.Cycle & Carriage Body & Paint Centre Add: 209 Pandan Gardens Singapore 609339 65684501

2.Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 330 Ubi Rd 3 Singapore 408650 67461000

3.Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 20 Leng Kee Rd Singapore 159094 64708688

4.Cycle & Carriage Authorised Service Centre (For accident reporting & windscreen claim only) Add: 600 Sin Ming Ave Singapore 575733 69328000

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: Standard Chartered Bank (Singapore) Limited

I/We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia), Road Transport (Amendment) Act 2019 and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

INSURER ENQUIRY

Find insurer

Vehicle reg. no.

GBE7817P

Date of Accident

13/05/2021 

Reset

% RESULT & RECEIPT

TP Insurer Enquiry

Insurance **China Taiping Insurance (Sing...**Period of Insurance **29/03/2021 - 28/03/2022**Requested By **Renemer Bagang (Cycle & Car...**Requested Date **14/05/2021 12:05****Payment details**Request Amount: **S\$1.87**GST Amount: **S\$0.13**Total Amount Due (GST Inclusive): **S\$2****General Insurance Association**

Records Management Centre

GST Registration No: **M400017735**



CYCLE & CARRIAGE

CYCLE & CARRIAGE-FULCO MOTOR DEALER PTE LTD

EUNOS LINK SERVICE CENTRE

330 Ubi Road 3 Singapore 408650 Tel: 67461000 Fax: 64875857



ESTIMATE

Invoice Name & Address	Owner Name & Vehicle Info	
CHINA TAIPING INSURANCE (SINGAPORE) 3 Anson Road #16-00 Springleaf Tower Singapore 079909 Attn: Claims Dept. Contact No 63896111	Cust No/Name	KCV08581/Mr Lim Cheng Vern
	Reg No/Reg Date	SLZ9947E / 25/05/2018
	Date In/Mileage	14/05/2021/ 53565
	Chassis No	JMAXTGK1WJZ001801
	Engine No	4B40DL7315
	Make/Model	MIT/ECLIPSE CROSS 1.5 T/C 2WD SUNR
	Colour/Trim	C02 / BK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
F0000018	Credit	14/05/2021/ 14:34	DS	303 / Renemer	11902			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
M	JJ5805A627	LWR GLASS, TAILGATE W	new		1.00	524.00	0.00	524.00
M	JJ5805A484	LWR DAM, TAILGATE	?		1.00	13.00	0.00	13.00
M	JJ5805A492	SPACER, TAILGATE	}		2.00	8.00	0.00	16.00
M	JJ5805A624	SPACER, TAILGATE		new	2.00	8.00	0.00	16.00
M	JJ6127A086	CLIP, TAILGATE			2.00	3.00	0.00	6.00
M	JJ5805A545	PIN, TAILGATE WINDOW	new		1.00	4.00	0.00	4.00
M	JJ5801B824	PANEL ASSY, TAILGATE	Deanted		1.00	984.00	0.00	984.00
M	JJ90810W022P	GARNISH TAILGATE	new behind (photo)		1.00	490.00	0.00	490.00
M	JJMZ576678EX	GARNISH CHROME, TAILG	new		1.00	111.00	0.00	111.00
M	JJMN170768	MARK, THREE-DIA	new		1.00	58.00	0.00	58.00
M	JJ7415A714	MARK, ECLIPSE CROSS	new		1.00	87.00	0.00	87.00
M	JJ5815A090	W/STRIP, TAILGATE OPE	new		1.00	194.00	0.00	194.00
M	JJ5808A099	STRIKER, TAILGATE LAT	new		1.00	20.00	0.00	20.00
M	JJ5808A119	LATCH, TAILGATE	new		1.00	385.00	0.00	385.00
M	JJ6410F379	FACE, RR BUMPER	behind		1.00	556.00	0.00	556.00
M	JJMR200300	CLIP, BUMPER	new		10.00	4.00	0.00	40.00
M	JJ6410C989	LH BRKT, R/BMPR FACE	new		1.00	25.00	0.00	25.00
M	JJ6410C990	RH BRKT, R/BMPR FACE	new		1.00	25.00	0.00	25.00
M	JJ6410F208XA	EXTENSION, RR BUMPER	behind new		1.00	152.00	0.00	152.00
M	JJ6415A069HA	LH COVER, RR BUMPER	?		1.00	117.00	0.00	117.00
M	JJ6415A070HA	RH COVER, RR BUMPER	?		1.00	117.00	0.00	117.00
M	JJMZ576675EX	REAR BUMPER GARNISH	behind		1.00	443.00	0.00	443.00
M	JJMZ576676EX	REAR CORNER EXTENSIO	new		1.00	266.00	0.00	266.00
M	JJMZ576679EX	REAR BUMPER PROTECTO	new		1.00	181.00	0.00	181.00
M	JJ8336A159	LH LAMP ASSY, BACKUP	new		1.00	118.00	0.00	118.00
M	JJ8337A144	RH RR, FOG LAMP ASSY	new		1.00	132.00	0.00	132.00
M	JJ8651A279	LH SENSOR, CORNER CLE	?		1.00	333.00	0.00	333.00
M	JJ8651A280	RH SENSOR, CORNER CLE	?		1.00	333.00	0.00	333.00
M	JJ8651A277	CTR SENSOR, BACK DIST	?		2.00	329.00	0.00	658.00
M	JJ6410D224	REINFORCEMENT, RR BUM	?		1.00	497.00	0.00	497.00
M	JJ8637A176	BUZZER, KEYLESS OPER	?		1.00	91.00	0.00	91.00
M	JJ8637B115	ANTENNA, KEYLESS OPE	?		1.00	96.00	0.00	96.00
Z	NOTES							

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE·FULCO MOTOR DEALER PTE LTD
EUNOS LINK SERVICE CENTRE

330 Ubi Road 3 Singapore 408650 Tel: 67461000 Fax: 64875857

**ESTIMATE**

Invoice Name & Address	Owner Name & Vehicle Info	
CHINA TAIPING INSURANCE (SINGAPORE) 3 Anson Road #16-00 Springleaf Tower Singapore 079909 Attn: Claims Dept. Contact No 63896111	Cust No/Name	KCV08581/Mr Lim Cheng Vern
	Reg No/Reg Date	SLZ9947E / 25/05/2018
	Date In/Mileage	14/05/2021/ 53565
	Chassis No	JMAXTGK1WJZ001801
	Engine No	4B40DL7315
	Make/Model	MIT/ECLIPSE CROSS 1.5 T/C 2WD SUNR
	Colour/Trim	C02 / BK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No			
F0000018	Credit	14/05/2021/ 14:34	DS	303 / Renemer	11902			
Description of Goods / Services					Qty	Unit Price	Disc%	Amount

ACCIDENT ON 13/05/2021 ALONG NEW UPPER CHANGI ROAD
 OWNER CLAIMING THIRD PARTY
 REQUIRED REPLACEMENT CAR
 TP#: GBE7817P TP INS: CHINA TAIPING

Adrian Lj
R/p 20/05/21.
05 days.

Estimate

Confirm & accepted by

Parts	7,880.00
Labour	0.00
Standard Menu	0.00
Specialist Job	7,610.00
Others(Lub,etc)	0.00
Sundry	50.00
Total(w/o GST)	15,540.00

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE

CYCLE & CARRIAGE-FULCO MOTOR DEALER PTE LTD

EUNOS LINK SERVICE CENTRE

330 Ubi Road 3 Singapore 408650 Tel: 67461000 Fax: 64875857



ESTIMATE

Invoice Name & Address	Owner Name & Vehicle Info	
CHINA TAIPING INSURANCE (SINGAPORE) 3 Anson Road #16-00 Springleaf Tower Singapore 079909 Attn: Claims Dept. Contact No 63896111	Cust No/Name	KCV08581/Mr Lim Cheng Vern
	Reg No/Reg Date	SLZ9947E / 25/05/2018
	Date In/Mileage	14/05/2021/ 53565
	Chassis No	JMAXTGK1WJZ001801
	Engine No	4B40DL7315
	Make/Model	MIT/ECLIPSE CROSS 1.5 T/C 2WD SUNR
	Colour/Trim	CO2 / BK

Account No	Terms	Date/Time Printed	CSE	Operator	WIP No
F0000018	Credit	14/05/2021/ 14:34	DS	303 / Renemer	11902
Description of Goods / Services		Qty	Unit Price	Disc%	Amount
S MIPNT88088	DIAGNOSTIC/SCANNING				✓ 250.00
S MIPNT88088	TO CHECK ALL LIGHTING/WIRING SYSTEM ON REAR ACCIDENT AFFECTED AREAS				80 100.00
S MIPNT88088	TO REPLACE TAILGATE GLASS UPPER & LWR				✓ 300.00
S MIPNT88088	TO INSTALL RIKECOOL SOLAR FILM ON NEW TAILGATE GLASS UPPER & LOWER				✗ ? 220.00
S MIPNT88088	TO APPLY SEALANT KIT ON NEW TAILGATE GLASS UPPER & LOWER				✓ 100.00
S MIPNT88088	TO TRANSFER TAILGATE COMPONENTS & MECHANISM PARTS				✓ 640.00
S MIPNT88088	TO REMOVE & RE-INSTALL ALL CARPETS/TRIMMING TO FACILITATE REPAIR ON REAR ACCIDENT AFFECTED AREAS				320 640.00
S MIPNT88088	TO REPLACE TAILGATE, REAR BUMPER UPPER, EXTENSION BUMPER, CLIPS, BRACKETS, BUMPER GARNISH, PROTECTOR, SENSOR, REINFORCEMENT, LATCH, ETC -TO REPAIR REAR END PANEL STRAIGHTEN, REFORM, ALIGN ON REAR ACCIDENT AFFECTED AREAS				1280 2560.00
S MIPNT98088	SPRAY PAINTING ON REAR ACCIDENT AFFECTED AREAS				1100 2200.00
S MIPNT88088	TO APPLY ZERTONA PAINT PROTECTION				? 550.00
S MIPNT88088	REAR LICENSE PLATE WITH CASING				✗ 50.00
M SUNDRY	C & C LOGO				✓ 50.00
M JJ5805A632	UPR GLASS, TAILGATE W <i>HEM</i>	1.00	706.00	0.00	✗ 706.00
M JJMR462285	STOPPER, WINDSHIELD G <i>HEM</i>	2.00	3.00	0.00	✓ 6.00
M JJMR957780	SPACER, QTR WINDOW <i>HEM</i>	4.00	8.00	0.00	✓ 32.00
M JJMB814447	FASTENER, WINDSHIELD <i>HEM</i>	8.00	6.00	0.00	✓ 48.00

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.