

ASS. REC. BY:

REF:

AIG/ CS/AIG21005959/Kqf3

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. 3550125673SG

Sum Insured: _____ Excess: 1900

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 879k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 5-6 days Res.: Yes or No

Lum Sum: 1.8-1 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Date / Time Action / Instruction

19/05/21 @4.57pm revert to AIG via Merimen.

28/05/21 @3.50pm Kok Chong informed C/A via Merimen.

28/05/21 @5.04pm Informed Candy C/A & ex.\$1900 by email.

Kenneth confirmed final fig \$6408, 6 days (Red \$2781.75, 30%)

Date/Time, File Pass to?

11/06/08 Typist

Date/Time, File Return to?

2)

Report Format: MER-OD

Lump Sum / I.B.I.: (\$ 6408)

☐ : Prell. Report☐ : Final Report

Days Of Repair: 6

Resurvey No. of Trip: 1

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S - RS. \$

Fees

Others

TOTAL

Veh No: GBH32372 Yr Regn: 041 18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or (A)

Make: M Vito 114 CDiC 2143

Colour: White A/C: Insured / Std / NI / NA

Sp. Reading: 94445 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WDF44780323331950

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: NII / S/Rim / STD / VRim or

Tyre Size: F: _____

R: 205/65R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Royal

Front Rear

R/Bal. 9 mm R/Bal. 9 mm

L/Bal. 9 mm L/Bal. 9 mm

D.O.A. 11/5/21 D.O.I. 19/5/2021

Survey held at

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.



TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 1

M/S : AIG ASIA PACIFIC INSURANCE PTE. LTD.

78 SHENTON WAY #07-16
AIG BUILDING
SINGAPORE 079120

ATTN : MOTOR CLAIM DEPT
TEL : 6419 3000

FAX : 6415 3723

YOUR REF NO :
CLAIM TYPE : OWN DAMAGE
ACCIDENT DATE : 11/05/2021

ESTIMATE

NO : QUOT202105-000047(00)
DATE : 19/05/2021
POLICY NO : 999995580
VEH REG NO : GBH3237Z
MAKE/MODEL : MERCEDES BENZ VITO 114 CDI
PANEL VAN LONG AT ABS 5DR
CHASSIS NO : WDF44760323351950
ENGINE NO : 65195034274306
REG. DATE : 2018

Estimate Repair Cost to Vehicle No : GBH3237Z

Description	Quantity	Unit Price	Amount
		S\$	S\$
PARTS			
1 Rear windscreen glass	1	620.00	620.00 ✓
2 Tailgate	1	1,450.00	1,450.00 ✓
3 Tailgate lock	1	195.00	195.00 X
4 Tailgate weatherstrip	1	180.00	180.00 ✓
5 Tailgate centre trim	1	28.00	28.00 ✓
6 Tailgate centre trim rivets	5	5.50	27.50 ✓
7 Tailgate inner trimboard	1	85.00	85.00 ✓
8 Tailgate trimboard clips	15	5.50	82.50 ✓
9 Tailgate centre logo	1	48.00	48.00 ✓
10 Tailgate 'VITO' emblem	1	52.00	52.00 ✓
11 Tailgate '114 CDI' emblem	1	62.00	62.00 ✓
12 Tailgate 'C & C' emblem	1	38.00	38.00 ✓
13 Rear end panel (outer)	1	252.00	252.00 ?
14 Rear end panel top garnish	1	152.00	152.00 ✓
15 Rear bumper	1	980.00	980.00 ✓
16 Rear bumper reinforcement	1	135.00	135.00 ?
17 Rear bumper reflector - LH	1	55.00	55.00 X
18 Rear bumper clips	15	5.50	82.50 ✓
19 Taillamp assy - LH	1	550.00	550.00 ✓
20 Taillamp assy lower garnish - LH	1	98.00	98.00 X
			5,172.50
		Add 10%	517.25
			5,689.75
SPECIAL NET			
21 Rear windscreen sealant	1	60.00	60.00 ✓
22 Tailgate "70km/h" sticker	1	25.00	25.00 ✓
23 Tailgate '6 pax' sticker	1	25.00	25.00 ✓
24 Rear bumper reverse sensor(set)	1	280.00	280.00 X
25 Rear number plate	1	40.00	40.00 X
			430.00
LABOUR			
26 To remove and refit rear windscreen glass	1	150.00	150.00 ✓
27 To transfer damaged tailgate interior mechanism to new tailgate	1	120.00	120.00 ✓
28 To remove and refit rear bumper sensor	1	100.00	100.00 ✓

SINGAPORE ACCIDENT STATEMENT

NOTICE

- report correctly the details of the accident to speed up the claims process.
 This Form must be completed by the Policyholder and/or the Authorised Driver.
 Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
 5. Any false reporting may be referred to the Police for investigation.
 6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 12/05/2021 00:17 (SGT)
 Date of Accident 11/05/2021 13:20 (SGT)
 Exact Location of Accident 160 Mariam Way, Singapore 507084
 Additional Location Information -
 Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBH3237Z
 INSURED/POLICYHOLDER
 Is company? Yes
 Name Of Registered Owner DAIMLER FLEET MANAGEMENT SINGAPORE PTE. LTD
 Company Reg No 1XXXXX778Z
 Email Address faizal.mohamed@daimler.com
 Mobile Phone No (Phone) +65-68498118
 Alternative Phone No (Office) +65-68498118

VEHICLE PARTICULARS

Manufacturer Mercedes
 Model Vito
 Variant -
 Exact purpose for which vehicle was being used at time of accident Employment
 Are you claiming under your own insurance policy for repair to your vehicle? Yes
 Vehicle Category Commercial vehicle
 Transmission Auto
 CC 0

INSURANCE COMPANY

Name of Insurance Company AIG Asia Pacific Insurance Pte. Ltd.
 Type of Coverage Comprehensive
 Fleet Policy Yes
 Policy Number 999995580
 Cover Note Number -


DRIVER

Name of Driver OOI HOONG TAT
 NRIC No SXXXX590D

SKETCH PLAN

x *al*
A: GBH 3237Z

B: PILLAR
(FIXED OBJECT).

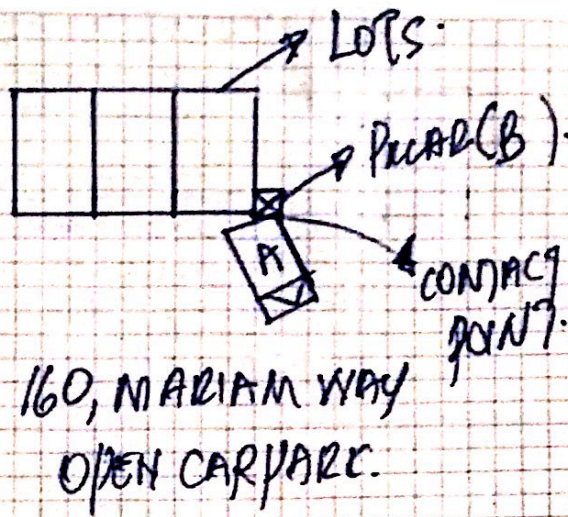

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO ATTACHED STATEMENT.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

al
Driver's Signature
(If driver is not the policyholder)
Date & Time:

VERIFY BY AJAX MARS (ARC)
REPORTING OFFICER
HASHIM BIN KAMARI

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

REPUBLIC OF SINGAPORE

DRIVING LICENCE



Licence Number: **S8561590D**

Name:

OOI HOONG TAT

Birth Date: **05 May 1985**

Issue Date: **10 May 2016**



REPUBLIC OF SINGAPORE

IDENTITY CARD NO. **S8561590D**



Name

OOI HOONG TAT

黄弘达

Race

CHINESE

Date of birth

05-05-1985

Sex

M

Country/Place of birth

MALAYSIA

