



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2106737

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 29/09/2021
Reference CC4/LPC21005993/Upa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKZ 8805A
Insured Veh. YM 6180J
Claim No. 21/21/21/VC00/024585
Policy No. Z/21/VC00/110737
Accident Date 17/05/2021
Inspection Date 31/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21005993/Upa3q2 Date: 29/09/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YM 6180J	Veh. Inspected	SKZ 8805A	
Policy No.	Z/21/VC00/110737	Coverage (\$)	0.00	
Claim No.	21/21/21/VC00/024585	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	20/05/2021	
2. Vehicle Particulars & Condition				
Make & Model	HONDA ODYSSEY (A)	c.c	2356	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	JHMRC1890GC201766	Colour	BLACK	
Odometer	163109 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	MICHELIN	6 mm	
L/H Front Tyre	215/55 R17	MICHELIN	6 mm	
R/H Rear Tyre	215/55 R17	MICHELIN	6 mm	
L/H Rear Tyre	215/55 R17	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/05/2021	Inspection Date	31/05/2021	
Survey held at	KAH MOTOR CO SDN BERHAD 15 UBI ROAD 4 SINGAPORE 408610			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKZ 8805A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	GLASS ASSY ,L.FR CORNER (SN)	SHATTERED	294.82	294.82
1	GLASS SEALANT (SN)	NECESSARY	60.00	60.00
1	FENDER COMPL.FR (SN)	BADLY DENTED	438.75	438.75
1	MOLDING ASSYL.FR.CORNER (SN)	DISTORTED	70.12	70.12
1	FENDER ASSYL.FR.INNER (SN)	DISTORTED	96.52	96.52
4	CLIP ABUMPER (SN)	NECESSARY	7.80	7.80
5	CLIPINNER FENDER (SN)	NECESSARY	13.12	10.50
1	ENCLOSUREL.FR.FENDER (SN)	DISTORTED	21.07	21.07
14	CLIP,BUMPER (SN)	NECESSARY (10 PCS ONLY)	24.15	24.15
1	DISK ALUMINIUM WHEEL 17X7J (CUT) (SN)	NOT CONSISTENT WITH THE IMPACT	731.77	-
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
1	V-KOOL SOLAR FILM (SN)	NECESSARY	120.00	120.00
1	GARNISH ASSY,L.FR.PILLAR (ADDITIONAL) (SN)	DISTORTED	63.60	63.60
			1,991.72	1,227.33
	<u>LABOUR</u>			
	WHEEL ALIGNMENT.	NOT NECESSARY	180.00	-
	INSPECT FR LIGHTING MECHANISMS & FOCUS .		180.00	120.00
	TO VACUUM & CLEAR SHATTERED GLASS .		450.00	100.00
	RESET VEHICLE SMART ENTRY SYSTEM.		520.00	350.00
	PERFORM SETTING ON MULTI VIEW CAMERAS & SMART.		520.00	350.00
	REPLACE RR.L QTR GLASS .		450.00	250.00
	REPLACE FR L FENDER ,REPAIR DOOR ,ALIGN FR BUMPER .		2,800.00	1,300.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS .		2,800.00	1,340.00
			7,900.00	3,810.00
	GRAND TOTAL		9,891.72	5,037.33

Report Ref No. CC4/LPC21005993/Upa3q2



RECOMMENDED COST OF REPAIRS			5,037.33
-----------------------------	--	--	----------

Report Ref No. CC4/LPC21005993/Upa3q2

A handwritten signature in black ink, appearing to be 'Chua' followed by a stylized 'K' and 'S'.

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 8805A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

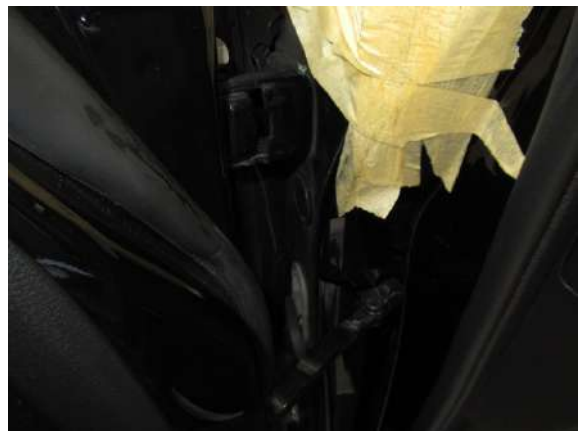



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 8805A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

