

ASS. REC. BY:

REF:

C72/

Kenneth

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

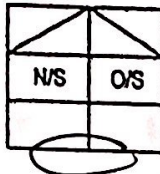

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Report: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 05 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: 05/28 Person Contacted: \_\_\_\_\_ Vehicle: IN / OUTVeh No: STK 6439D Yr Regn: 08, 08Type: M. Car M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Honda Fit c.c. 1339Colour: M. Blue A/C: Insured / Std / NI / NASp. Reading: 139141 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: GE6. 1053765Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: NII / 8/Rim / STD A/Rim orTyre Size: F: Mic 195/50R15

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 8 mmR/Bal. 6 mmL/Bal. 8 mmL/Bal. 6 mmD.O.A. 4/5/21D.O.I. 24/5/2021

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐ : Prel. Report☐ : Final Report

1) Date/Time, File Return to?

2) \_\_\_\_\_

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)☐ : Interview (\$ \_\_\_\_\_)☐ : Tech Invs (\$ \_\_\_\_\_)☐ : Weekend (\$ \_\_\_\_\_)

Survey Fee:

Transportation:

S - RS, SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$ \_\_\_\_\_)



# 金興(龔)汽車私人有限公司

160 Sin Ming Drive, #02-20,  
 Sin Ming AutoCity, Singapore 575722  
 Tel: 6452 7018 Fax: 6458 3895  
 Email: service@kkimhin.com.sg

Vehicle Insured : SLG 2532 P  
 Accident Date : 04-May-2021

No. : 31831

Date : 24-May-2021

Our Ref : 021184 (CHINA) / SANDRA

PAGE : 1

AIK CZE LOONG JOEL (MR)  
 Singapore

*NOT Withheld  
 C/Pay &  
 Return After Paint 5days*

## ESTIMATED COST OF REPAIR FOR HONDA FIT 1.3G (A) (2008) SJF6439D

1 pc rear bumper		By 497.20	✓
1 pc rear bumper tow cover		Mr 23.30	✓
2 pcs rear bumper side retainer (LH & RH)	@ S\$ 16.50	Sn 33.00	X
8 pcs rear bumper clips	@ S\$ 3.50	Mr 28.00	✓
1 pc rear bumper tow inner bracket		R 96.20	X
1 pc tailgate		By 771.20	✓
1 pc tailgate lock		Mr 189.20	✓
1 pc tailgate weatherstrip		Di Mr 92.30	50% Sn
1 pc tailgate 'Fit' emblem		Mr 45.20	✓
1 pc tailgate glass moulding		Mr 98.20	✓
1 pc rear end panel		By 276.50	✓
1 pc rear end panel top garnish		By 60.80	✓
1 pc spare tyre top board		Return 190.70	✓
1 pc spare tyre panel		R 737.20	X
2 pcs taillamp assy (LH & RH)	@ S\$206.20	Sn 412.40	X
		3,551.40	
	Less 20% :	-710.28	
		2,841.12	

1 pc tailgate glass sealant  
 1 pc tailgate glass damping seal  
 1 pc reverse sensor assy

Mr 40.00 sn ✓  
 Mr 20.00 sn ✓  
 Mr 220.00 sn  
*200% Sn*

To remove, cut out damaged parts,  
 panel beating, welding, align,  
 refix and to renew affected parts.

800.00 600

**LKK Auto Consultants** hence notify  
 the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Page 2 ...

any key to continue..



CO. REG. NO: 199402370D  
GST NO: M2-0123250-3

AUTO PTE LTD

## 金興(龔)汽車私人有限公司

160 Sin Ming Drive, #02-20,  
Sin Ming AutoCity, Singapore 575722  
Tel: 6452 7018 Fax: 6458 3895  
Email: service@kkimhin.com.sg

Vehicle Insured : SLG 2532 P  
Our Ref : 021184

Page : 2  
No. : 31831

To apply undersealing	80.00 601
To remove and refit rear upholstery trimming, roof lining, seats, speaker board in order to facilitate repairing works	180.00 601
To transfer tailgate's fittings	80.00 601
To remove and refit reverse sensor assy.	60.00 501
To putty and respray on affected portions.	800.00 601
Total :	<u>S\$ 5,121.12</u>

Singapore Dollars FIVE THOUSAND ONE HUNDRED TWENTY  
ONE AND CENTS TWELVE Only

Note: Amount quoted above is subject to prevailing GST at time of tax invoice.



# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission ..... 05/05/2021 14:04 (SGT)  
Date of Accident ..... 04/05/2021 14:15 (SGT)  
Exact Location of Accident ..... Singapore  
Additional Location Information ..... ALEXANDRA ROAD  
Country/State of Loss ..... Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number ..... SJF6439D

### INSURED/POLICYHOLDER

Is company? ..... No  
Name Of Registered Owner ..... AIK CZE LOONG JOEL  
NRIC No ..... S7702203A  
Email Address ..... joelaik@hotmail.com  
Mobile Phone No ..... (Phone) +65-98179009  
Alternative Phone No ..... +65-98179009

### VEHICLE PARTICULARS

Manufacturer ..... Honda  
Model ..... Fit  
Variant ..... -  
Exact purpose for which vehicle was being used at time of accident ..... Private use  
Are you claiming under your own insurance policy for repair to your vehicle? ..... No - Claiming third party  
Vehicle Category ..... Private car  
Transmission ..... Auto  
CC ..... 1400

### INSURANCE COMPANY

Name of Insurance Company ..... NTUC Income Insurance Co-operative Ltd  
Type of Coverage ..... Comprehensive  
Fleet Policy ..... No  
Policy Number ..... -  
Cover Note Number ..... -


### DRIVER

Name of Driver ..... AIK CZE LOONG JOEL  
NRIC No ..... S7702203A



# SKETCH PLAN

BRITTON ROAD

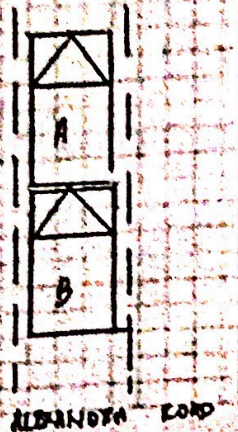

A - SJF6439P  
B - SLG2532P

## DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 04/05/2021 at around 1415hrs, while I was stationary along Alexandra Road due to a red light, SLG2532P suddenly collided into my rear. No injuries were sustained in the accident.

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time: 5/6/2021

1240

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name: HANUS SHAY

NRIC/FIN No.: 892269228B