

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543 Email: mirage1195@gmail.com

SINGLE JOINT EXPERT REPORT

(Traffic Accident involving motor vehicles SKZ49T & XE4219A ON 11 August 2020)

Report no : 306M0921.SJE
Vehicle no : SKZ49T

1 REFERENCE

Appointed by : The State Courts Singapore
Thru' M/s Bonnie Kwok LLC
101 Upper Cross Street
#08-12 People's Park Centre
Singapore 058358
Date of request : 13 September 2021
Your Reference : BK.20227.21.P
Defendant's lawyer's Ref : CLS.2021.222739
MC/MC Suit No. : 5888/2021
Repairer : M/s Precise Auto Service
Date of Accident : 11 August 2020

2 VEHICLE DATA

(a) Plaintiff's Vehicle

Vehicle no : **SKZ49T**
Make/model : Porsche Macan 2.0
Chassis no : WP1ZZZ95ZFLB12872
Engine no. : 84781
Year of registration : 2015
Colour : Black (sticker)

(b) Defendant's Vehicle

Vehicle no : XE4219A
Make/model : Mercedes Benz AROCS 3336K 6X4 3300 S-Cab (Auto, ABS)

3 AVAILABLE INFORMATION

This report is prepared based on the following information:

- (a) the Plaintiff's GIA report;
- (b) the Plaintiff's survey report by M/s Premier Appraiser Services;
- (c) the Defendant's GIA report;
- (d) the Defendant's survey PRI inspection report by M/s LKK Auto Consultants Pte Ltd dated 21/08/2020;
- (e) two video footages (front and rear) of the accident;
- (f) paper re-survey report by M/s LKK Auto Consultants Pte Ltd dated 28 May 2021; and
- (g) the PRI Reinspection photos by M/s LKK Auto Consultants Pte Ltd.
- (h) Wheel alignment reports for Plaintiff's vehicle before and after the repairs;
- (i) Verification proof of the part prices from part stockist; and
- (j) Invoice for the installation of car body vinyl wrap from CR Design & Solutions LP.

4 BRIEF DESCRIPTION OF THE ACCIDENT

Side swipe collision in which both vehicles had side-swiped each other along the sides of the respectively vehicles.

Report no : 306M0921.SJE
Vehicle no : SKZ49T

5 **CONCLUSIONS**


After reviewing and analysing the contents of the documents listed in para. 3 of this report, I am of the opinion that a fair and reasonable assessment would be as follows:

(a) Cost of repair based on lump sum repair basis	=	\$12,600.00
(b) Number of days required to complete the repairs	=	6.00

I confirm that insofar as the facts stated in my report are within my own knowledge I have made clear they are and I believe them to be correct, and that the opinions I have expressed represent my accurate and complete professional opinion.

I also confirm that in preparing this report, I am aware that my primary duty is to the Court and not the person(s) from whom I have received my instructions or by whom I am paid.

Yours faithfully

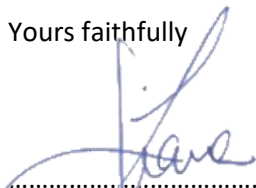

.....
Liaw Leong San
Licensed Automotive Appraiser

Dated: 14 December 2021

6 ASSESSMENT OF DAMAGE AND COSTS

Report no: 306M0921.SJE
Vehicle no: SKZ49T

A SPARE PARTS

	<u>Description</u>	<u>Qty</u>	<u>Premier</u> <u>Amount (\$)</u>	<u>LKK</u> <u>Amount (\$)</u>	<u>SJE</u> <u>Amount (\$)</u>	<u>Comment</u>
1	Rear bumper	1	3,960.00	2,008.00	3,009.70	Reasonable
2	Rear bumper clips	10	65.00	30.00	101.70	Reasonable
3	Rear bumper o/s side retainer	1	75.00	75.00	200.97	Reasonable
4	o/s rear fender splash shield	1	290.00	290.00	399.70	Reasonable
5	o/s rear fender splash shield clips	8	52.00	30.00	81.36	Reasonable
6	o/s rear shock absorber	1	1,130.00	--	1,499.70	Damaged
7	o/s rear shock absorber mounting	1	380.00	--	0.00	Disallowed as nature of damage is unspecified
8	o/s rear knuckle arm	1	1,680.00	--	1,577.60	Damaged
9	o/s rear upper arm	1	1,080.00	--	1,234.60	Damaged
10	o/s rear lower arm	1	620.00	--	1,400.71	Damaged
11	o/s rear control arm	1	1,470.00	--	1,009.60	Damaged
12	o/s rear wheel bearing hub	1	1,270.00	--	0.00	Disallowed as nature of damage is unspecified
13	Tyre pressure sensor	1	480.00	--	0.00	Disallowed as nature of damage is unspecified
	Subtotal of the above:		12,552.00	2,433.00	10,515.64	
	Discount 5%		627.60	121.65	525.78	
	<i>Subtotal 1:</i>		<i>11,924.40</i>	<i>2,311.35</i>	<i>9,989.86</i>	
14	o/s rear wheel rim	1	2,200.00	2,200.00	2,200.00	Not disputed
15	o/s rear tyre (Pay 70%)	1	840.00	--	0.00	Insufficient photo evidence to show damage
	<i>Subtotal 2:</i>		<i>3,040.00</i>	<i>2,200.00</i>	<i>2,200.00</i>	
	Total costs for parts :		14,964.40	4,511.35	12,189.86	

B LABOUR

16	Labour charges to repair, panel beat and straighten damaged parts and replace the above-mentioned parts.	750.00	300.00	600.00	Estimated 2 days for repair at \$300/day.
17	To dismantle/replace o/s rear suspension & undercarriage parts.	320.00	--	320.00	Necessary as job was required to rectify the suspension and undercarriage parts.

Report no: 306M0921.SJE
 Vehicle no: SKZ49T

18	To replace o/s rear wheel rim & tyre include wheel balancing.	120.00	30.00	30.00	Not disputed.
19	To conduct wheel alignment (<i>before/after</i>).	240.00	60.00	120.00	Fair and reasonable amount for 2 alignment at \$60/alignment.
20	To check & reset electrical system.	300.00	200.00	300.00	Fair and reasonable.
21	To putty, apply primer & spray-paint the affected areas.	800.00	600.00	600.00	Fair and reasonable.
22	To supply/install Vinyl sticker for rear bumper, rear fender & rear door.	1,800.00	600.00	1,600.00	Fair and reasonable.

Total Labour cost:

4,330.00	1,790.00	3,570.00
----------	----------	----------

Total Repair Cost:

19,294.40	6,301.35	15,759.86
------------------	-----------------	------------------

Recommended Cost of Repair:

16,400.00	5,000.00	12,600.00
-----------	----------	-----------

Estimated number of days for the repairs:

8.00	5.00	6.00
------	------	------

Remark:

Both the surveyors had recommended that the repairs be carried out a Lump Sum Repair Basis which means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543 Email: mirage1195@gmail.com

M/s Bonnie Kwok LLC
101 Upper Cross Street
#08-12 People's Park Centre
Singapore 058358

Invoice no:	POS0306/21
Date:	14 December 2021
Report no:	306M0921.SJE
Vehicle :	SKZ49T

INVOICE

No	Item Description	Qty	Unit Price	Total Amount (\$)
01	Being charges for the preparation of the Single Joint Expert report.			300.00
SGD(\$): Three hundred only			Grand Total:	300.00

"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES

.....
Authorised Signature