

ASS. REC. BY:

REF:

C72/21008149/Kt

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

10 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLR 2333P

Yr Regn:

08.17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Prius

c.c

1797

Colour

M. Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

188146

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

ZVW 50. 6046773

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

R:

185/60R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

3

mm

L/Bal.

7

mm

L/Bal.

3

mm

D.O.A.

18/5/21

D.O.I.

27/5/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

FR O/S & U/C

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

17/11/2021 8:16, 2001

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$)

Add Fee:

☐

Site Insp (\$)

☐

Interview (\$)

☐

Tech Invs (\$)

☐

Weekend (\$)

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	970Z
Vehicle Details	
Vehicle No.:	SLR2333P
Vehicle to be Exported:	Yes
Intended Deregistration Date:	25 May 2021
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8S CVT
Primary Colour:	Silver
Manufacturing Year:	2016
Engine No.:	2ZR6860386
Chassis No.:	ZVW506046773
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$27,401.00
Original Registration Date:	04 Aug 2017
First Registration Date:	04 Aug 2017
Transfer Count:	1
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	03 Aug 2027
PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	03 Aug 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$47,501.00
COE Rebate Amount:	\$29,407.00
Total Rebate Amount:	\$33,157.00

The information contained herein is correct as at 22 May 2021

OK

Merimen Submitted

Ding Auto Pte Ltd (Co.Reg.No:201311788Z)

176 Sin Ming Drive #04-06, Sin Ming Autocare

Singapore 575721

Tel: 64521208 Fax: 64520614 Email: ding@dingauto.sg;kenneth.ding@dingauto.sg

INSURER: **China Taiping Insurance (Singapore) Pte. Ltd. (HQ)**

PARTICULARS OF CLAIM

Claim Type:	OD (Own Damage)	Ref. No:	
Policy No:	DMHCSNA00004192100	Date of Loss:	18/05/2021
Vehicle Reg. No.:	SLR2333P	Driveable?	
Driver Age/Info:	/ MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	AUTOBAHN RENT A CAR PTE LTD		
Driver:	RICHARD GOH SIANG WEI		

Make/Model:	TOYOTA PRIUS HYBRID, 1.8 CVT (A)	Vehicle Reg. Date:	04/08/2017
Vehicle Colour:	Silver		
Engine No:	2ZR6860386	Chassis No:	ZVW506046773
Odometer:	0 KM		

Paint Type:
Total Loss? **NO**
Est. Duration of Repair (day) ~~15~~ **10 days**

Present Location: **DING AUTO PTE LTD (HQ)**

COST OF CLAIMS	Amount
Parts	16,044.00
Miscellaneous Items	0.00
Labour	982.80
Paintwork Labour	558.22
Towing	0.00
Gross Total (\$)	17,585.02
Nett Amount (\$)	18,815.97

This claim is handled by: **DING SING HUI, KENNETH**

Generated using **Merimen e-Claims Internet Estimation & Adjusting System**



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 22/05/2021 14:08 (SGT)
Date of Accident 18/05/2021 11:55 (SGT)
Exact Location of Accident Punggol Rd, Singapore
Additional Location Information
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLR2333P

INSURED/POLICYHOLDER

Is company? Yes
Name Of Registered Owner AUTOBAHN RENT A CAR PTE LTD
Company Reg No 2XXXXX970Z
Email Address LUSIONT96@GMAIL.COM
Mobile Phone No (Phone) +65-68354800
Alternative Phone No (Office) +65-68354800

VEHICLE PARTICULARS

Manufacturer Toyota
Model Prius
Variant
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private hire
Transmission Auto
CC 1798

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMHCSNA00004192100
Cover Note Number

DRIVER

Date Of Birth	06/05/1995
Occupation	Indoor
Date Of Driving Pass	16/08/2017
Driving experience	3 YEARS AND 9 MONTHS
Gender	Male
Mobile Number	(Phone) +65-86681418
Alt. Phone Number	-
Email Address	RICHARDHUIJING0814@GMAIL.COM
Address	BLK 295A COMPASSVALE CRESCENT #08-207 SINGAPORE
Address complement	-
Postcode	541295
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collided into Property
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	1
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other material or property damaged?	No
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

PASSENGER 1

Name	NG HUI JING
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Sengkang Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18003438999
Alt. Police Station Phone No	(Fax) +65-63438939
Police Station Address	2 Sengkang Square #01-02
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

PLEASE REFER TO POLICE REPORT (REPORT NO.T/20210518/2058)

ATTACHMENT(S)

Are accident photos available for attachment?	No
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10,#01-20
575645



Insurer Reference: SLR2333P
Repairer Reference: 041433
Date calculated: 05/06/2021 2:22 PM

Full Report
Registration: SLR2333P
Printed: 05/06/2021 2:27 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:	SLR2333P	Date of Incident:	18/05/21
Estimated Repair Time:	15	Hire Car Start:	
Actual Repair Days:	15	Hire Car End:	

Vehicle Details


Vehicle
Manufacturer: TOYOTA
Model: PRIUS IV
Sub Model: BASE MODEL
Model Sheet Number: 70 P5 01
Registration: SLR2333P
VIN number:
Odometer:
Model Specs
1.8 LTR 90 KW HYBRID FRONT DRIVE

Vehicle Condition

Vehicle Status
Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

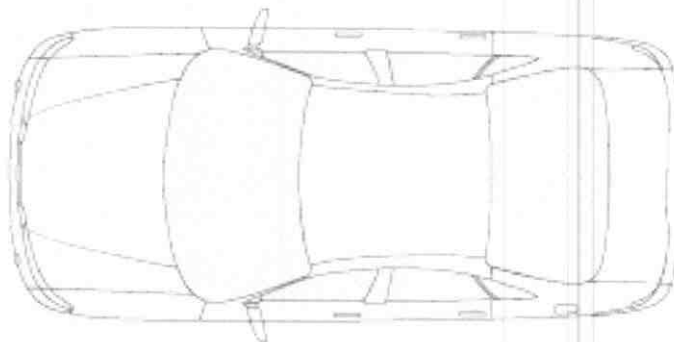

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
043233D	ADJUST FRONT CAMBER (ADD/WORK)		2.0	8.40
043233)	ALIGN VEHICLE FRONT		5.0	21.00
043233)	ALIGN VEHICLE REAR		7.0	29.40
B020	RENEW FRONT BUMPER		15.0	63.00
	INCLUDES: R + R FRONT BUMPER, RADIATOR			
	GRILLE AND NECESSARY ATTACHED PARTS			
B040)	R + R LEFT HEADLAMP		1.0	4.20
	(BUMPER REMOVED)			
	DOES NOT INCLUDE: ADJUST HEADLAMP			
B040)	RENEW RIGHT HEADLAMP ASSY		2.0	8.40
	(BUMPER REMOVED)			
	NOT INCLUDED: ADJUST HEADLAMPS			
NO NUMBER	ADJUST HEADLAMPS		2.0	8.40
B110	RENEW R/F WING		7.0	29.40
	(BUMPER AND HEADLAMP REMOVED)			
	INCLUDES: R + R WING,			
	CONVERT ATTACHED PARTS			
B100	R + R LEFT FRONT WING		5.0	21.00
	(BUMPER AND HEADLAMP REMOVED)			
	INCLUDES: WHEELHOUSE LINER AND REQUIRED			
	ATTACHED PARTS R + R			
B131)	RENEW R/FRONT PANEL CARRIER		2.0	8.40
B140)	R + R LOWER FRONT PANEL CROSSMEMBER		2.0	8.40
B131)	RENEW L/RADIATOR CARRIER		3.0	12.60
B131)	RENEW R/RADIATOR CARRIER		3.0	12.60
B125	RENEW UPPER FRONT PANEL CROSSMEMBER		4.0	16.80
B010)	R + R FRONT BUMPER REINFORCEMENT		3.0	12.60
B010)	R + R FRONT BUMPER LOWER REINFORCEMENT		2.0	8.40
B020)	RENEW FRONT ACTIVE AIR INTAKE GRILLE		2.0	8.40
B161)	RENEW R/F WHEELHOUSE EXTENSION		13.0	54.60
B060	R + R BONNET		3.0	12.60
B080	R + R BONNET HINGE/S		1.0	4.20
851091)	R + R WINDSCREEN WASHER TANK		1.0	4.20
B085)	R + R WATER BOX CLOSING PANEL		3.0	12.60
B085	R + R COWL TRIM GRILLE		2.0	8.40
	INCLUDES: R + R BOTH WIPER ARMS			
M250	R + R BOOT FLOOR PANEL COVER		1.0	4.20
B210	RENEW R/F DOOR		30.0	126.00
B210	R + R RIGHT FRONT DOOR WINDOW FRAME SEAL		2.0	8.40
M010)	R + R CONDENSER		8.0	33.60
NO NUMBER	R + R CONDENSER/EVAPORATOR PIPE		2.0	8.40
NO NUMBER	R + R LEVELLING SYSTEM SENSOR		1.0	4.20
B100	R + R L/SILL TRIM		3.0	12.60
B100	R + R R/SILL TRIM		3.0	12.60
M020	RENEW RADIATOR		19.0	79.80
112111)	R + R OIL PAN		14.0	58.80
M240	R + R REAR EXHAUST TUBE		2.0	8.40
NO NUMBER	SWIVEL JOINT DETACH + REFILL		1.0	4.20
451011)	R + R POWER STEERING RACK		2.0	8.40
451011)	RENEW POWER STEERING GEAR (REMOVED)		2.0	8.40
420091A)	R + R R/F WHEEL/TYRE		2.0	8.40
473101)	DETACH + REFIT FRONT BRAKE CALIPER		1.0	4.20

Code	Description	WU	Price SGD
473301)	RENEW FRONT BRAKE PADS	3.0	12.60
896081)	R + R R/F ABS SENSOR	1.0	4.20
896081)	R + R LEFT AND RIGHT FRONT ABS SENSOR	1.0	4.20
431151)	R + R L/F STRUT	1.0	4.20
431151)	R + R R/F STRUT	1.0	4.20
431011)	DETACH + REFIT L/F LOWER SUSPENSION ARM	1.0	4.20
431151)	DETACH + REFIT L/F FRONT SUSPENSION STRUT	1.0	4.20
431151)	DETACH + REFIT R/F FRONT SUSPENSION STRUT	1.0	4.20
431101)	RENEW RIGHT FRONT COIL SPRING	1.0	4.20
431601)	R + R FRONT STABILIZER	1.0	4.20
NO NUMBER	R + R FRONT AXLE CARRIER	4.0	16.80
431011)	R + R LEFT FRONT LOWER CONTROL ARM	2.0	8.40
431011)	R + R RIGHT FRONT LOWER CONTROL ARM	2.0	8.40
434601)	R + R COMPLETE L/F AXLE SHAFT	1.0	4.20
434601)	R + R R/F AXLE SHAFT	1.0	4.20
434211)	R + R R/F STEERING KNUCKLE	4.0	16.80
004466)	BLEED HYDRAULIC BRAKE SYSTEM	3.0	12.60
004466)	VENT FRONT BRAKE SYSTEM	3.0	12.60
420018)	R + R LEFT REAR WHEEL	1.0	4.20
420018)	R + R RIGHT REAR WHEEL	1.0	4.20
420091A)	R + R RIGHT REAR TYRE/WHEEL	2.0	8.40
420091)	BALANCE WHEEL/S	4.0	16.80
421041A)	R + R REAR WHEEL HUB	2.0	8.40
482071)	R + R R/R UPPER CONTROL ARM	1.0	4.20
NO NUMBER	R + R R/R AXLE CARRIER REAR	3.0	12.60
473201A)	DETACH + REFIT REAR BRAKE CALIPER	4.0	16.80
482201)	R + R REAR SHOCK ABSORBER STRUTS	4.0	16.80
482151)	R + R LEFT REAR COIL SPRING	2.0	8.40
482041)	DETACH + REFIT REAR LOWER CONTROL ARM	3.0	12.60
NO NUMBER	R + R REAR AXLE CARRIER	5.0	21.00
002359N)	ELECTRIC AXLE GEARBOX OIL DRAIN /REFILL	4.0	16.80

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	25.10	251.0	1,054.20
Total of Labour			1,054.20

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description	WU Price SGD
	R/F WING NEW PART PAINTING	10.0
	R/RADIATOR BRACKET SURFACE PAINT	4.0
	L/LWR RADIATOR BRKT SURFACE PAINT	4.0
	LWR FRT PNL C-MEMBER SURFACE PAINT	4.0
	UPP FRT PNL C-MEMBER SURFACE PAINT	4.0
	R/F PANEL SUPPORT SURFACE PAINT	4.0
	R/F INN W-HOUSE EXT SURFACE PAINT	4.0
	RIGHT FRONT DOOR NEW PART PAINTING	15.0
	L/F BUMPER COVER NEW PART PAINT K1R	3.0
	R/F BUMPER COVER NEW PART PAINT K1R	3.0
	FRONT BUMPER NEW PART PAINT K1R	11.0
	R/SILL PANELLING NEW PART PAINT K1R	7.0

Paint Material Per Part

Code	Description	Price SGD
0283	FRONT BUMPER NEW PART PAINT K1R	48.16
2186	R/SILL PANELLING NEW PART PAINT K1R	20.94

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			75.0	
Preparation Main Work Metal		0.80	8.0	33.60
Preparation Comp. Work Plastic		0.30	3.0	12.60
Total	10 WU/h	8.60	86.0	361.20

Material Cost - Paint

	Price SGD
New Part Painting	97.13
New Part Painting - Plastic K1R	69.80
Surface-/Blend Paint	2.99
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	197.02

Spare Parts

prices as at 2015-06-01/01				
Code	Description	Part Number	Part Source	Price SGD
✓ 1015	AIR CHANNEL GUIDE	16592 37020	Original	✓ 175.00
✓ 7517	BMC RESERVOIR CAP	47230 47090	Original	✓ 40.00
0471	BONNET	53301 47110	Original	240.00
0481	BONNET INSULATION	53341 47041	Original	120.00
0493	BONNET LOCK	53510 47130	Original	60.00
✓ 4465	CONDENSER	88460 10320	Original	✓ 575.00
✓ 0283	FRONT BUMPER	52119 47962	Original	✓ 185.00
✓ 0410	FRONT GRILLE	53101 47081	Original	✓ 130.00
✓ 0253	FRONT LWR AIR GRILLE	53112 47240	Original	✓ 65.00
8784	FRONT LWR ENGINE CVR	51420 47030	Original	✓ 105.00
0421	FRONT MANUFACT	75310 47060	Original	✓ 35.00
	BADGE			
7261	FRONT STABILISER	48811 47080	Original	✓ 300.00
7011	FRT AXLE CARRIER	51201 47071	Original	✓ 850.00
0346	FRT BUMPER ABSORBER	52611 47140	Original	✓ 275.00
0340	FRT BUMPER REINF	52021 47110	Original	✓ 215.00
0349	FRT LWR BUMP ABSORB	52618 47090	Original	✓ 105.00
7035	L/DRIVE SHAFT CPL	43420 47040	Original	✓ 695.00
7083	L/F AXLE JOINT	43330 19115	Original	✓ 90.00
0277	L/F BUMPER COVER	52128 47906	Original	✓ 12.00
0343	L/F BUMPER COVER	52113 47060	Original	✓ 48.00
0341	L/F BUMP REINF BRKT	52103 47010	Original	✓ 58.00
7077	L/F CPL SPRING STRUT	48520 80490	Original	✓ 185.00
0475	L/F HINGE	53420 47130	Original	✓ 30.00
7053	L/F LWR AXLE ARM	48069 47060	Original	✓ 175.00
7271	L/F STABI ROD	48820 47040	Original	✓ 50.00
8783	LOWER ENGINE	51410 47020	Original	✓ 220.00
	PROTECT			

Paint Material Per Part

Code	Description	Price SGD
0742	R/F WING NEW PART PAINTING	16.93
0990	R/RADIATOR BRACKET SURFACE PAINT	1.06
0997	L/LWR RADIATOR BRKT SURFACE PAINT	0.35
1001	LWR FRT PNL C-MEMBER SURFACE PAINT	2.82
1017	UPP FRT PNL C-MEMBER SURFACE PAINT	2.46
1024	R/F PANEL SUPPORT SURFACE PAINT	0.88
1186	R/F INN W-HOUSE EXT SURFACE PAINT	0.53
1482	RIGHT FRONT DOOR NEW PART PAINTING	35.06
0277	L/F BUMPER COVER NEW PART PAINT K1R	0.35
0278	R/F BUMPER COVER NEW PART PAINT K1R	0.35
0283	FRONT BUMPER NEW PART PAINT K1R	48.16
2186	R/SILL PANELLING NEW PART PAINT K1R	20.94

Labour Cost - Paint

	Factor	42.00 SGD/h	Hrs	WU	Price SGD
	Time Paint			73.0	
	Preparation Main Work Metal		0.80	8.0	33.60
	Preparation Comp. Work Plastic		0.30	3.0	12.60
Total		10 WU/h	8.40	84.0	352.80

Material Cost - Paint

	Price SGD
New Part Painting	51.99
New Part Painting - Plastic K1R	69.80
Surface-/Blend Paint	8.10
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	156.99

Spare Parts

prices as at 2015-06-01/01					Price SGD
Code	Description	Part Number	Part Source		
1015	AIR CHANNEL GUIDE	16592 37020	Original		✓ 175.00
7737	AIR INT GRILLE ACTIV	53019 47020	Supplementary	cra	✓ 240.00
7517	BMC RESERVOIR CAP	47230 47090	Original		✓ 40.00
4484	COND/EVAPORATOR PIPE	88710 47160	Supplementary	bent	✓ 310.00
4465	CONDENSER	88460 10320	Original		✓ 575.00
7180	FRONT BRAKE PAD SET	04465 47080	Supplementary	X svc	X 78.00
0283	FRONT BUMPER	52119 47962	Original		✓ 185.00
0410	FRONT GRILLE	53101 47081	Original		X 130.00
0253	FRONT LWR AIR GRILLE	53112 47240	Original		✓ 65.00
8784	FRONT LWR ENGINE CVR	51420 47030	Original		✓ 105.00
0431	FRONT MANUFACT BADGE	75310 47060	Original		✓ 35.00
7261	FRONT STABILISER	48811 47080	Original		✓ 300.00
7011	FRT AXLE CARRIER	51201 47071	Original		✓ 850.00
0346	FRT BUMPER ABSORBER	52611 47140	Original		✓ 275.00
0349	FRT LWR BUMP ABSORB	52618 47090	Original		✓ 105.00
0339	FRT LWR BUMPER REINF	52132 47010	Supplementary	bent	✓ 205.00

Code	Description	Part Number	Part Source	Price SGD
1000	HEADLAMP MODULE RH	HEADLAMP MODULE	Supplementary	CM ? 350.00 ✓
7035	L/DRIVE SHAFT CPL	43420 47040	Original	X 695.00
7083	L/F AXLE JOINT	43330 19115	Original	X 90.00
0277	L/F BUMPER COVER	52128 47906	Original	X 12.00
0343	L/F BUMPER COVER	52113 47060	Original	X 48.00
0341 ✓	L/F BUMP REINF BRKT	52103 47010	Original	X 58.00
7077	L/F CPL SPRING STRUT	48520 80490	Original	X 185.00
7053	L/F LWR AXLE ARM	48069 47060	Original	X 175.00
7271 ✓	L/F STABI ROD	48820 47040	Original	X 50.00
0841	L/F WHEELHOUSE COVER	53876 47110	Original	X 100.00
0997	L/LWR RADIATOR BRKT	53249 47010	Supplementary	Dis ? 65.00 —
7773 ✓	L/LWR RADIATOR HOSE	16571 37210	Supplementary	Cur ? 120.00 —
9093 ✓	L/R STABI ROD	48830 47010	Supplementary	bent 60.00
9235 ✓	LEVELLING SYS SENSOR	89408 47020	Supplementary	CRP 335.00 ✓
8783 ✓	LOWER ENGINE PROTECT	51410 47020	Original	220.00 ✓
8065 ✓	LOWER SUMP	12102 37010	Original	225.00 ✓
1001 ✓	LWR FRT PNL C-MEMBER	53028 47010	Supplementary	✓ bent 185.00
1524 ✓	R/A-PILLAR COVER	60117 47020	Original	48.00 ✓
7024 ✓	R/AXLE BEAM BRACKET	51107 47020	Original	120.00 ✓
7106	R/DAMPER PLATE	48157 47030	Original	90.00 X
7036 ✓	R/DRIVE SHAFT CPL	43410 47040	Original	660.00 ✓
7246 ✓	R/F ABS SENSOR	89542 47040	Supplementary	short ? 162.00 ✓
7084 ✓	R/F AXLE JOINT	43330 19115	Original	90.00 ✓
7134	R/F BRAKE BACK PLATE	47781 47040	Original	58.00 X
7148	R/F BRAKE CALIPER	47730 47060	Supplementary	SVC X 395.00
7142	R/F BRAKE DISC	43512 47060	Original	168.00 X
7166	R/F BRAKE HOSE	90947 02H46	Original	55.00 X
0318 ✓	R/F BUMPER BRACKET	52115 47050	Original	35.00 X
0278 ✓	R/F BUMPER COVER	52127 47907	Original	12.00 X
0344	R/F BUMPER COVER	52112 47060	Original	48.00 X
0342 ✓	R/F BUMP REINF BRKT	52102 47020	Original	58.00 X
7116	R/F COIL SPRING	48131 47160	Original	95.00 X
9386 ✓	R/F CONTROL ARM FRT	48710 47010	Original	85.00 X
7078 ✓	R/F CPL SPRING STRUT	48510 80814	Original	185.00 X
0476	R/F HINGE	53410 47130	Original	30.00 X
0578 ✓	R/F INDICATOR BULB	90981 15024	Original	10.00 X
0580 ✓	R/F INDIC BULB HOLD	90075 60028	Original	20.00 X
1186	R/F INN W-HOUSE EXT	53705 47901	Original	360.00 X
7054 ✓	R/F LOWER AXLE ARM	48068 47060	Original	175.00 X
1024 ✓	R/F PANEL SUPPORT	53213 47050	Supplementary	bent 90.00
7228	R/FR TYRE	195/65 R 15 .. H	Original	150 SN 600 ✓ 250.00
7202 ✓	R/FR WHEEL	42611 47470	Original	600.00 ✓
7104	R/F S-ABSORB BOOT	48045 47011	Original	80.00 ✓
7272 ✓	R/F STABI ROD	48820 47040	Original	50.00 ✓
7082 ✓	R/F STEERING KNUCKLE	43211 47040	Original	400.00 ✓
7092 ✓	R/F STRUT BEARING	48609 47060	Original	78.00 ✓
7108	R/F UPP DAMPING RING	48619 47020	Original	120.00 X
0748 ✓	R/F UPPER WING SEAL	53807 47020	Supplementary	✓ nec 22.00
0842 ✓	R/F WHEELHOUSE COVER	53875 47070	Original	100.00 ✓
7132 ✓	R/F WHEEL HUB	43550 47020	Original	215.00 ✓
0742 ✓	R/F WING	53801 47080	Original	230.00 ✓
0812 ✓	R/F WING BADGE	75374 47140	Original	35.00 ✓

Code	Description	Part Number	Part Source	Price SGD
0792 ✓	R/F WING BRACKET	53835 47050	Original	45.00 ✓
0844 ✓	R/F WING INSULATOR	53827 47050	Original	85.00 ✓
0990 ✓	R/RADIATOR BRACKET	53202 47901	Supplementary ✓	dis 36.00 ✓
9322 ✓	R/R AXLE STEERING	48760 47010	Original	210.00 ✓
9124 ✓	R/R LWR CONTROL ARM	48730 47010	Original	245.00 ✓
9126 ✓	R/R RR AXLE SUPPORT	42304 47050	Original	450.00 ✓
9566 ✓	R/RR TYRE	195/65 R 15 .. H	Original	150 250.00 ✓
9552 ✓	R/RR WHEEL	42611 47470	Original	600.00 ✓
9202 ✓	R/R SPRING LEG	48530 80789	Original	165.00 ✓
9094 ✓	R/R STABI ROD	48830 47010	Supplementary ✓	dis 60.00 ✓
9326 ✓	R/R UPP CONTROL ARM	48770 47010	Original	185.00 ✓
9182 ✓	R/R WHEEL HUB CPL	42450 76020	Original	220.00 ✓
7094 ✓	R/S-ABSORB BOOT	48684 52010	Original	35.00 ✓
2186 ✓	R/SILL PANELLING	75850 47910	Original	290.00 ✓
7312 ✓	R/TIE ROD BALL JOINT	45046 49255	Original	48.00 ✓
7761 ✓	RADIATOR CPL	16400 37311	Original	575.00 ✓
7767 ✓	RADIATOR SHROUD	16711 37160	Original	95.00 ✓
9071 ✓	REAR AXLE SUBFRAME	51206 47012	Supplementary ✓	bent 1,080.00 ✓
0534 ✓	RIGHT BONNET STOP	90541 15037	Original	10.00 ✓
1482 ✓	RIGHT FRONT DOOR	67001 47153	Original	650.00 ✓
0562 ✓	RIGHT HEADLAMP ASSY	81145 47691	Original	720.00 ✓
7300 ✓	STEERING GEAR CPL	45510 47140	Original	600.00 ✓
1017 ✓	UPP FRT PNL C-MEMBER	53205 47900	Original	360.00 ✓
1014 ✓	UPP RADIATOR COVER	53289 47072	Original	110.00 ✓
1436 ✓	WASHER CONTAINER	85315 47160	Original	78.00 ✓
1437 ✓	WASHER PUMP	85330 47090	Original	150.00 ✓
1439 ✓	WASH RESERVOIR TUBE	85319 47160	Original	45.00 ✓

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	19,272.00
Total	19,272.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	19,272.00	19,272.00
Labour Time Base 10 WU/h		
Total 251.0 WU X 42.00 SGD/h	1,054.20	
Total of Labour		1,054.20
Paint Work Time Base 10 WU/h		
Labour Cost 84.0 WU X 42.00 SGD/h	352.80	
Material Cost	156.99	
Total Paint Including Material		509.79
Repair Cost Excludes GST		20,835.99
GST (+7.0%)		1,458.52
Repair Cost Included GST		22,294.51

11 Sep @ 16, 200h B4 ex ass

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Code	Description	WU	Price SGD
431151)	DETACH + REFIT R/FRONT SUSPENSION STRUT	1.0	4.20
431101)	RENEW RIGHT FRONT COIL SPRING	1.0	4.20
431601)	R + R FRONT STABILIZER	1.0	4.20
NO NUMBER	R + R FRONT AXLE CARRIER	4.0	16.80
431011)	R + R LEFT FRONT LOWER CONTROL ARM	2.0	8.40
431011)	R + R RIGHT FRONT LOWER CONTROL ARM	2.0	8.40
434601)	R + R COMPLETE L/F AXLE SHAFT	1.0	4.20
434601)	R + R R/F AXLE SHAFT	1.0	4.20
434211)	R + R R/F STEERING KNUCKLE	4.0	16.80
004466)	BLEED HYDRAULIC BRAKE SYSTEM	3.0	12.60
004466)	VENT FRONT BRAKE SYSTEM	3.0	12.60
420018)	R + R LEFT REAR WHEEL	1.0	4.20
420018)	R + R RIGHT REAR WHEEL	1.0	4.20
420091A)	R + R RIGHT REAR TYRE/WHEEL	2.0	8.40
420091)	BALANCE WHEEL/S	4.0	16.80
421041A)	R + R REAR WHEEL HUB	2.0	8.40
482071)	R + R R/R UPPER CONTROL ARM	1.0	4.20
NO NUMBER	R + R R/R AXLE CARRIER REAR	3.0	12.60
473201A)	DETACH + REFIT REAR BRAKE CALIPER	4.0	16.80
4732201)	R + R REAR SHOCK ABSORBER STRUTS	4.0	16.80
482151)	R + R LEFT REAR COIL SPRING	2.0	8.40
482041)	DETACH + REFIT REAR LOWER CONTROL ARM	3.0	12.60
NO NUMBER	R + R REAR AXLE CARRIER	5.0	21.00
002359N)	ELECTRIC AXLE GEARBOX OIL DRAIN /REFILL	4.0	16.80
Labour Cost		Hrs	WU
Panel / Mechanical Labour		23.40	234.0
Total of Labour			982.80

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h
Code	Description	WU	Price SGD
	BONNET NEW PART PAINTING	18.0	
	R/F WING NEW PART PAINTING	10.0	
	UPP FRT PNL C-MEMBER SURFACE PAINT	4.0	
	R/F INN W-HOUSE EXT SURFACE PAINT	4.0	
	RIGHT FRONT DOOR NEW PART PAINTING	15.0	
	L/F BUMPER COVER NEW PART PAINT K1R	3.0	
	R/F BUMPER COVER NEW PART PAINT K1R	3.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	R/SILL PANELLING NEW PART PAINT K1R	7.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	45.14
0742	R/F WING NEW PART PAINTING	16.93
1017	UPP FRT PNL C-MEMBER SURFACE PAINT	2.46
1186	R/F INN W-HOUSE EXT SURFACE PAINT	0.53
1482	RIGHT FRONT DOOR NEW PART PAINTING	35.06
0277	L/F BUMPER COVER NEW PART PAINT K1R	0.35
0278	R/F BUMPER COVER NEW PART PAINT K1R	0.35

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
043233D	ADJUST FRONT CAMBER (ADD/WORK)		2.0	8.40
043233)	ALIGN VEHICLE FRONT		5.0	21.00
043233)	ALIGN VEHICLE REAR		7.0	29.40
B020	RENEW FRONT BUMPER		15.0	63.00
	INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS			
B040)	R + R LEFT HEADLAMP (BUMPER REMOVED)		1.0	4.20
	DOES NOT INCLUDE: ADJUST HEADLAMP			
B040)	RENEW RIGHT HEADLAMP ASSY (BUMPER REMOVED)		2.0	8.40
	NOT INCLUDED: ADJUST HEADLAMPS			
NO NUMBER	ADJUST HEADLAMPS		2.0	8.40
B110	RENEW R/F WING (BUMPER AND HEADLAMP REMOVED)		7.0	29.40
	INCLUDES: R + R WING, CONVERT ATTACHED PARTS			
B100	R + R LEFT FRONT WING (BUMPER AND HEADLAMP REMOVED)		5.0	21.00
	INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R			
B125	RENEW UPPER FRONT PANEL CROSSMEMBER		4.0	16.80
B010)	R + R FRONT BUMPER REINFORCEMENT		3.0	12.60
B010)	R + R FRONT BUMPER LOWER REINFORCEMENT		2.0	8.40
B161)	RENEW R/F WHEELHOUSE EXTENSION		13.0	54.60
B070	RENEW BONNET		5.0	21.00
	INCLUDES: R + R BONNET, ATTACH PARTS ASSEMBLE AND IF NEC RENEW			
B080	R + R BONNET HINGE/S		1.0	4.20
851091)	R + R WINDSCREEN WASHER TANK		1.0	4.20
B085)	R + R WATER BOX CLOSING PANEL		3.0	12.60
B085	R + R COWL TRIM GRILLE		2.0	8.40
	INCLUDES: R + R BOTH WIPER ARMS			
M250	R + R BOOT FLOOR PANEL COVER		1.0	4.20
B010	RENEW R/F DOOR		30.0	126.00
B010	R + R RIGHT FRONT DOOR WINDOW FRAME SEAL		2.0	8.40
M010)	R + R CONDENSER		8.0	33.60
NO NUMBER	R + R LEVELLING SYSTEM SENSOR		1.0	4.20
B100	R + R L/SILL TRIM		3.0	12.60
B100	R + R R/SILL TRIM		3.0	12.60
M020	RENEW RADIATOR		19.0	79.80
112111)	R + R OIL PAN		14.0	58.80
M240	R + R REAR EXHAUST TUBE		2.0	8.40
NO NUMBER	SWIVEL JOINT DETACH + REFILL		1.0	4.20
451011)	R + R POWER STEERING RACK		2.0	8.40
451011)	RENEW POWER STEERING GEAR (REMOVED)		2.0	8.40
420091A)	R + R R/F WHEEL/TYRE		2.0	8.40
473101)	DETACH + REFIT FRONT BRAKE CALIPER		1.0	4.20
431151)	R + R L/F STRUT		1.0	4.20
431151)	R + R R/F STRUT		1.0	4.20
431011)	DETACH + REFIT L/F LOWER SUSPENSION ARM		1.0	4.20
431151)	DETACH + REFIT L/F FRONT SUSPENSION STRUT		1.0	4.20

Code	Description	Part Number	Part Source	Price SGD
8065	LOWER SUMP	12102 37010	Original	225.00
1524	R/A-PILLAR COVER	60117 47020	Original	48.00
7024	R/AXLE BEAM BRACKET	51107 47020	Original	120.00
7106	R/DAMPER PLATE	48157 47030	Original	90.00
7036	R/DRIVE SHAFT CPL	43410 47040	Original	660.00
7084	R/F AXLE JOINT	43330 19115	Original	90.00
7134	R/F BRAKE BACK PLATE	47781 47040	Original	58.00
7142	R/F BRAKE DISC	43512 47060	Original	168.00
7166	R/F BRAKE HOSE	90947 02H46	Original	55.00
0318	R/F BUMPER BRACKET	52115 47050	Original	35.00
0278	R/F BUMPER COVER	52127 47907	Original	12.00
0344	R/F BUMPER COVER	52112 47060	Original	48.00
0342	R/F BUMP REINF BRKT	52102 47020	Original	58.00
7116	R/F COIL SPRING	48131 47160	Original	95.00
9386	R/F CONTROL ARM FRT	48710 47010	Original	85.00
7078	R/F CPL SPRING STRUT	48510 80814	Original	185.00
0476	R/F HINGE	53410 47130	Original	30.00
0578	R/F INDICATOR BULB	90981 15024	Original	10.00
0580	R/F INDIC BULB HOLD	90075 60028	Original	20.00
1186	R/F INN W-HOUSE EXT	53705 47901	Original	360.00
7134	R/F LOWER AXLE ARM	48068 47060	Original	175.00
7228	R/FR TYRE	195/65 R 15 .. H	Original	250.00
7202	R/FR WHEEL	42611 47470	Original	600.00
7104	R/F S-ABSORB BOOT	48045 47011	Original	80.00
7272	R/F STABI ROD	48820 47040	Original	50.00
7082	R/F STEERING KNUCKLE	43211 47040	Original	400.00
7092	R/F STRUT BEARING	48609 47060	Original	78.00
7108	R/F UPP DAMPING RING	48619 47020	Original	120.00
0842	R/F WHEELHOUSE COVER	53875 47070	Original	100.00
7132	R/F WHEEL HUB	43550 47020	Original	215.00
0742	R/F WING	53801 47080	Original	230.00
0812	R/F WING BADGE	75374 47140	Original	35.00
0792	R/F WING BRACKET	53835 47050	Original	45.00
0844	R/F WING INSULATOR	53827 47050	Original	85.00
9322	R/R AXLE STEERING	48760 47010	Original	210.00
9124	R/R LWR CONTROL ARM	48730 47010	Original	245.00
9126	R/R RR AXLE SUPPORT	42304 47050	Original	450.00
9566	R/RR TYRE	195/65 R 15 .. H	Original	250.00
912	R/RR WHEEL	42611 47470	Original	600.00
9202	R/R SPRING LEG	48530 80789	Original	165.00
9326	R/R UPP CONTROL ARM	48770 47010	Original	185.00
9182	R/R WHEEL HUB CPL	42450 76020	Original	220.00
7094	R/S-ABSORB BOOT	48684 52010	Original	35.00
2186	R/SILL PANELLING	75850 47910	Original	290.00
7312	R/TIE ROD BALL JOINT	45046 49255	Original	48.00
7761	RADIATOR CPL	16400 37311	Original	575.00
7767	RADIATOR SHROUD	16711 37160	Original	95.00
0534	RIGHT BONNET STOP	90541 15037	Original	10.00
1482	RIGHT FRONT DOOR	67001 47153	Original	650.00
0562	RIGHT HEADLAMP ASSY	81145 47691	Original	720.00
7300	STEERING GEAR CPL	45510 47140	Original	600.00
1017	UPP FRT PNL C-MEMBER	53205 47900	Original	360.00
1014	UPP RADIATOR COVER	53289 47072	Original	110.00
1436	WASHER CONTAINER	85315 47160	Original	78.00
1437	WASHER PUMP	85330 47090	Original	150.00

Code	Description	Part Number	Part Source	Price SGD
1439	WASH RESERVOIR TUBE	85319 47160	Original	45.00
f: OEM Parts				0.00
n: Non-OEM Parts				16,044.00
u: Used parts				16,044.00
Savings				
Subtotal				
Total				16,044.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	16,044.00	16,044.00
Labour Time Base 10 WU/h		
Total 234.0 WU X 42.00 SGD/h	982.80	
Total of Labour		982.80
Paint Work Time Base 10 WU/h		
Labour Cost 86.0 WU X 42.00 SGD/h	361.20	
Material Cost	197.02	
Total Paint Including Material		558.22
Repair Cost Excludes GST		17,585.02
GST (+7.0%)		1,230.95
Repair Cost Included GST		18,815.97

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 25 May 2021)
 Parts: 144 TOYOTA PRIUS HYBRID 1.8 CVT (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Ding Auto Pte Ltd/SLR2333P/25/05/2021 13:59
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1	NA	*AIR CHANNEL GUIDE 1015	0.00	0.00	Dis *175.00 F
2	1	NA	*BMC RESERVOIR CAP 7517 ✓	0.00	0.00	mi *40.00 F
3	1	NA	*BONNET	0.00	0.00	R *240.00 F
4	1	NA	*BONNET INSULATION	0.00	0.00	SL *120.00 F
5	1	NA	*BONNET LOCK	0.00	0.00	R *60.00 F
6	1	NA	*CONDENSER 4465 ✓	0.00	0.00	Ry *575.00 F
7	1	NA	*FRONT BUMPER 0283 ✓	0.00	0.00	Tn *185.00 F
8	1	NA	*FRONT GRILLE 0410 ✓	0.00	0.00	Rn *130.00 F
9	1	NA	*FRONT LWR AIR GRILLE 0253 ✓	0.00	0.00	Dis *65.00 F
10	1	NA	*FRONT LWR ENGINE CVR 7734 ✓	0.00	0.00	Tn *105.00 F
11	1	NA	*FRONT MANUFACT BADGE 0431 ✓	0.00	0.00	Rn *35.00 F
12	1	NA	*FRONT STABILISER 7261 ✓	0.00	0.00	Ry *300.00 F
13	1	NA	*FRT AXLE CARRIER 7011 ✓	0.00	0.00	Ry *850.00 F
14	1	NA	*FRT BUMPER ABSORBER 0346 ✓	0.00	0.00	CMF Sme *275.00 F
15	1	NA	*FRT BUMPER REINF	0.00	0.00	R *215.00 F
16	1	NA	*FRT LWR BUMP ABSORB 0349 ✓	0.00	0.00	CM *105.00 F
17	1	NA	*L/DRIVE SHAFT CPL 7035 ✓	0.00	0.00	R R *695.00 F
18	1	NA	*L/F AXLE JOINT 7083 ✓	0.00	0.00	Ry *90.00 F
19	1	NA	*L/F BUMPER COVER 0277	0.00	0.00	Rn *12.00 F
20	1	NA	*L/F BUMPER COVER 0343	0.00	0.00	NIP Rn *48.00 F
21	1	NA	*L/F BUMP REINF BRKT 0341 ✓	0.00	0.00	Ry *58.00 F
22	1	NA	*L/F CPL SPRING STRUT 7077 ✓	0.00	0.00	Rn Ry *185.00 F
23	1	NA	*L/F HINGE	0.00	0.00	R *30.00 F
24	1	NA	*L/F LWR AXLE ARM	0.00	0.00	SL Rn *175.00 F
25	1	NA	*L/F STABI ROD 7271 ✓	0.00	0.00	Ry *50.00 F
26	1	NA	*LOWER ENGINE PROTECT 7733 ✓	0.00	0.00	CM *220.00 F
27	1	NA	*LOWER SUMP 8065 ✓	0.00	0.00	CM *225.00 F
28	1	NA	*R/A-PILLAR COVER 7524 ✓	0.00	0.00	SL *48.00 F
29	1	NA	*R/AXLE BEAM BRACKET 7024 ✓	0.00	0.00	Dis *120.00 F
30	1	NA	*R/DAMPER PLATE	0.00	0.00	SL *90.00 F
31	1	NA	*R/DRIVE SHAFT CPL 7036 ✓	0.00	0.00	Ry *660.00 F
32	1	NA	*R/F AXLE JOINT 7084 ✓	0.00	0.00	Ry *90.00 F
33	1	NA	*R/F BRAKE BACK PLATE 7134	0.00	0.00	R *58.00 F
34	1	NA	*R/F BRAKE DISC 7042 7166	0.00	0.00	SL *168.00 F
35	1	NA	*R/F BRAKE HOSE	0.00	0.00	SL *55.00 F
36	1	NA	*R/F BUMPER BRACKET 0318 ✓	0.00	0.00	mi *35.00 F
37	1	NA	*R/F BUMPER COVER 0278 ✓	0.00	0.00	mi *12.00 F
38	1	NA	*R/F BUMPER COVER 0344	0.00	0.00	NIP *48.00 F
39	1	NA	*R/F BUMP REINF BRKT 58 0342 ✓	0.00	0.00	Ry *58.00 F
40	1	NA	*R/F COIL SPRING	0.00	0.00	SL *95.00 F
41	1	NA	*R/F CONTROL ARM FRT 9286 ✓	0.00	0.00	Ry *85.00 F
42	1	NA	*R/F CPL SPRING STRUT 7077 ✓	0.00	0.00	Ry *185.00 F
43	1	NA	*R/F HINGE 0476	0.00	0.00	R *30.00 F
44	1	NA	*R/F INDICATOR BULB 0578 ✓	0.00	0.00	mi *10.00 F
45	1	NA	*R/F INDIC BULB HOLD 0580 ✓	0.00	0.00	mi *20.00 F
46	1	NA	*R/F INN W-HOUSE EXT 1186	0.00	0.00	R *360.00 F
47	1	NA	*R/F LOWER AXLE ARM 7054	0.00	0.00	Ry *175.00 F

48	1	NA	*R/FR TYRE		0.00	0.00	150 Pn	*250.00 F	609n
49	1	NA	*R/FR WHEEL 7288 ✓		0.00	0.00	Od	*600.00 F	✓
50	1	NA	*R/F S-ABSORB BOOT		0.00	0.00	Ry	*80.00 F	✓
51	1	NA	*R/F STABI ROD 7272 ✓		0.00	0.00	Ry	*50.00 F	✓
52	1	NA	*R/F STEERING KNUCKLE 7032 ✓		0.00	0.00	Ry	*400.00 F	✓
53	1	NA	*R/F STRUT BEARING 7092 ✓		0.00	0.00	Mc	*78.00 F	✓
54	1	NA	*R/F UPP DAMPING RING		0.00	0.00	Ln	*120.00 F	X
55	1	NA	*R/F WHEELHOUSE COVER 0842 ✓	7108	0.00	0.00	n/r	*100.00 F	✓
56	1	NA	*R/F WHEEL HUB 7132 ✓		0.00	0.00	Ry	*215.00 F	✓
57	1	NA	*R/F WING 0742 ✓		0.00	0.00	Ry	*230.00 F	✓
58	1	NA	*R/F WING BADGE 0312 ✓		0.00	0.00	Mc	*35.00 F	✓
59	1	NA	*R/F WING BRACKET 0792 ✓		0.00	0.00	Ry	*45.00 F	✓
60	1	NA	*R/F WING INSULATOR 0844 ✓		0.00	0.00	n/r	*85.00 F	✓
61	1	NA	*R/R AXLE STEERING 9322 ✓		0.00	0.00	Ry	*210.00 F	✓
62	1	NA	*R/R LWR CONTROL ARM 9124 ✓		0.00	0.00	Ry	*245.00 F	✓
63	1	NA	*R/R RR AXLE SUPPORT 9126 ✓		0.00	0.00	Ry	*450.00 F	✓
64	1	NA	*R/RR TYRE 0552 ✓	150SN	0.00	0.00	Pn	*250.00 F	609n
65	1	NA	*R/RR WHEEL 9552 ✓		0.00	0.00	Od	*600.00 F	✓
66	1	NA	*R/R SPRING LEG 9202 ✓		0.00	0.00	n/r	*165.00 F	✓
67	1	NA	*R/R UPP CONTROL ARM 9326 ✓		0.00	0.00	n/r	*185.00 F	✓
68	1	NA	*R/R WHEEL HUB CPL 9132 ✓		0.00	0.00	Ry	*220.00 F	✓
69	1	NA	*R/S-ABSORB BOOT		0.00	0.00	Ln	*35.00 F	X
70	1	NA	*R/SILL PANELLING 2136 ✓	7094	0.00	0.00	CM	*290.00 F	✓
71	1	NA	*R/TIE ROD BALL JOINT 7312 ✓		0.00	0.00	Ry	*48.00 F	✓
72	1	NA	*RADIATOR CPL 7767 ✓		0.00	0.00	Ry	*575.00 F	✓
73	1	NA	*RADIATOR SHROUD 7767 ✓		0.00	0.00	CM	*95.00 F	✓
74	1	NA	*RIGHT BONNET STOP 0584 ✓		0.00	0.00	Ln	*10.00 F	X
75	1	NA	*RIGHT FRONT DOOR 0580 ✓		0.00	0.00	Ry	*650.00 F	✓
76	1	NA	*RIGHT HEADLAMP ASSY 0562 ✓		0.00	0.00	Br	*720.00 F	✓
77	1	NA	*STEERING GEAR CPL 7300 ✓		0.00	0.00	n/r/Im	*600.00 F	✓
78	1	NA	*UPP FRT PNL C-MEMBER 1017 ✓		0.00	0.00	Ry	*360.00 F	✓
79	1	NA	*UPP RADIATOR COVER 1014 ✓		0.00	0.00	CM	*110.00 F	✓
80	1	NA	*WASHER CONTAINER 1436 ✓		0.00	0.00	n/r	*78.00 F	✓
81	1	NA	*WASHER PUMP 1437 ✓		0.00	0.00	CM	*150.00 F	✓
82	1	NA	*WASH RESERVOIR TUBE 1439 ✓		0.00	0.00	Ln	*45.00 F	X
83	1	NA	*SUNDRY PARTS		0.00	0.00		*- F	

F=Franchise part.

Total Parts (\$\$)

16,044.00

Ding Auto Pte Ltd/SLR2333P/25/05/2021 13:59. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
Paintwork Labour			
1	Total Paint Labour	New	361.20
2	Total Paint Materials	New	197.02
Labour Items			
3	Total Panel/Mechanical Labour	New	982.80
Gross Labour Cost (S\$)			1,541.02

Ding Auto Pte Ltd/SLR2333P/25/05/2021 13:59. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >