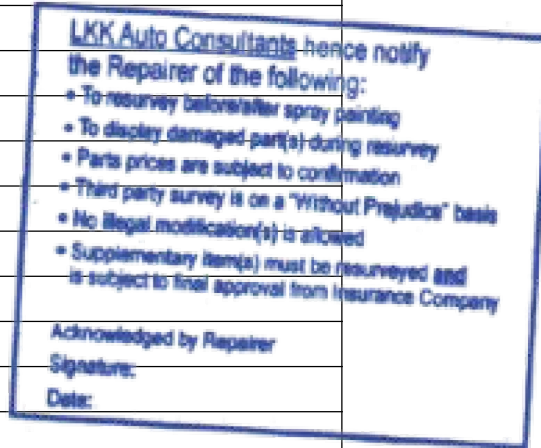



Section A - Accident Details

Registration Number	SHF365X
Case Reference Number	TAX/06/21/2002
Registration Date	19/12/2017
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	SOH BOON THYE
Type of Accident	Head to Rear
Accident Date and Time	1/6/2021 10:50 AM
Accident Reported Date and Time	1/6/2021 2:03 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24111121
Special Instruction to ARC, if any	TP/ REAR PORTION /QBE - LKK
Prepared Date and Time	2/6/2021 8:54 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	


Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,245.00	\$800.00
Total Spray Cost	\$2,036.00	\$900.00
Total Spare Part Cost	\$12,424.35	\$4,421.42
Total Other Cost	\$1,675.00	\$445.00
TOTAL COST	\$17,380.35	\$6,566.42
Lump Sum Total	\$17,400.00	\$6,550.00 (L/S)
Number of Repair Days	9.0	8.0
Prepared / Adjusted By	Ang Bang Kien	RASUL (LKK) / QBE
ARC / Surveyor Sign Off Date	08/06/2021 3:41 PM	08/06/2021 11:54 AM
Signature		
Remarks	Total number of repair days = 8 days. SUP = +2 days	resurvey after repair / lump sum

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-2106-0384	Invoice Number	
Quotation Date	23.06.2021	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REMOVE AND REFIT REAR END PANEL	\$400.00	\$200.00 ✓
TO REPAIR REAR PORTION	\$845.00	\$600.00 ✓
Total Labour	\$1,245.00	\$800.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY BUMPER BEAM	\$180.00	\$100.00 ✓
TO RESPRAY REAR PANEL	\$200.00	\$200.00 ✓
TO RESPRAY REAR BUMPER	\$378.00	\$200.00 ✓
TO RESPRAY BUMPER BEAM	\$180.00	\$0.00
TO RESPRAY REAR PANEL	\$180.00	\$0.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$0.00
TO RESPRAY REAR SPOILER	\$180.00	\$100.00 ✓
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$100.00 ✓
TO RESPRAY TAIL GATE	\$378.00	\$200.00 ✓
Total Spray Painting & Panel Beating	\$2,036.00	\$900.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO TRANSFER REAR TAILGATE MECHANISM	\$180.00	\$80.00 ✓
TO REMOVE AND REFIX REAR WINDSCREEN	\$180.00	\$120.00 ✓
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$0.00
TO REMOVE AND REFIX TAILGATE GLASS	\$120.00	\$60.00 ✓
TO REMOVE AND REFIX REAR WINDSCREEN	\$120.00	\$0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$350.00	\$0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$125.00	\$125.00 ✓
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$60.00 ✓
TO REMOVE AND REFIT WIRE HARDESS	\$120.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$1,675.00	\$445.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
			SENSOR REVERSE	0.00	\$180.00	0.00	\$0.00	Replace	Check
		8999730100	ANTENNA, ELECTRICAL KEY	0.00	\$60.30	0.00	\$0.00	Replace	Check

X SVC
X SVC

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 22/06/2021

User ID : PohSuan

	81551472 81	LENS & BODY, REAR COMBINATION LAMP , RH	0.00	\$438.10	0.00	\$0.00	Replace	Check	X	svc
	81561471 51	LENS & BODY, REAR COMBINATION LAMP , LH	0.00	\$438.10	0.00	\$0.00	Replace	Check	X	svc
	81581470 10	LENS & BODY ASSY , RR BUMPER , RH	0.00	\$486.80	0.00	\$0.00	Replace	Check	X	svc
	81591470 10	LENS & BODY ASSY , RR BUMPER , LH	0.00	\$486.80	0.00	\$0.00	Replace	Check	X	svc
	81497470 20	COVER, REAR COMBINATION LAMP, RH	0.00	\$54.00	0.00	\$0.00	Replace	Check	X	svc
	81498470 20	COVER, REAR COMBINATION LAMP, LH	0.00	\$54.00	0.00	\$0.00	Replace	Check	X	svc
	58398470 50	COVER, REAR FLOOR UNDER , RH	0.00	\$169.50	0.00	\$0.00	Replace	Not Given	X	svc
	68810470 61	TAIL GATE BACK DOOR HINGE ASSY, RH & LH	0.00	\$59.10	0.00	\$0.00	Replace	Check	X	svc
	75055470 10	MOULDING SUB-ASSY, ROOF DRIP SIDE FINISH,	1.00	\$52.70	25.00	\$39.53	Replace	Replace	√	nec
	64716471 30C0	END PANEL , COVER, DECK TRIM, REAR	0.00	\$122.80	0.00	\$0.00	Replace	Check	X	svc
	64718470 80C0	END PANEL , COVER, DECK TRIM SERVICE HOLE	0.00	\$47.00	0.00	\$0.00	Replace	Check	X	svc
	58311471 30	SPARE TYRE PANEL , PAN, REAR FLOOR	0.00	\$564.80	0.00	\$0.00	Replace	Not Given	X	svc
	82185471 50	WIRE, TAIL GATE BACK DOOR , NO.2	0.00	\$246.80	0.00	\$0.00	Replace	Not Given	X	svc
	82184474 90	WIRE, TAIL GATE BACK DOOR	0.00	\$246.80	0.00	\$0.00	Replace	Not Given	X	svc
	81006470 30	LAMP SET, STOP CENTER	0.00	\$186.50	0.00	\$0.00	Replace	Not Given	X	svc
	76085479 16	SPOILER SUB-ASSY, REAR	1.00	\$1,322.10	100.00	\$0.00	Replace	Repair	R	
	75403480 10	EMBLEM SUB-ASSY REAR	1.00	\$46.30	25.00	\$34.73	Replace	Replace	√	nec
	69430520 50	TAIL GATE STRIKER ASSY, BACK DOOR	0.00	\$24.90	0.00	\$0.00	Replace	Not Given	X	svc
	69321470 10	TAIL GATE LOCK COVER , BACK DOOR	0.00	\$25.30	0.00	\$0.00	Replace	Not Given	X	svc
	69350470 50	TAIL GATE LOCK ASSY, BACK DOOR	0.00	\$452.10	0.00	\$0.00	Replace	Not Given	X	svc
	689600W 860	TAIL GATE STAY ASSY , BACK DOOR , LH	0.00	\$235.00	0.00	\$0.00	Replace	Not Given	X	svc
	689500W 860	TAIL GATE STAY ASSY , BACK DOOR , RH	0.00	\$235.00	0.00	\$0.00	Replace	Not Given	X	svc
	67751471 10C0	TAILGATE TRIM , LOWER	0.00	\$218.50	0.00	\$0.00	Replace	Not Given	X	svc
	67938470 60C0	TAILGATE TRIM , LH	0.00	\$92.10	0.00	\$0.00	Replace	Not Given	X	svc
	64790470 60C0	TAILGATE TRIM , UPPER	0.00	\$50.50	0.00	\$0.00	Replace	Not Given	X	svc
	64801470 31	TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR	1.00	\$725.90	25.00	\$544.43	Replace	Replace	√	br
	68105472 91	TAIL GATE GLASS SUB- ASSY, BACK DOOR	0.00	\$1,569.70	0.00	\$0.00	Replace	Not Given	X	svc
	75442471 30	NAME PLATE (PRIUS) , LUGGAGE COMPARTMENT	1.00	\$52.30	25.00	\$39.23	Replace	Replace	√	nec
	75441470 90	NAME PLATE (HYBRID) , LUGGAGE COMPARTMENT	1.00	\$52.30	25.00	\$39.23	Replace	Replace	√	nec
	75056470 10	MOULDING SUB-ASSY, ROOF DRIP SIDE FINISH,	1.00	\$52.70	25.00	\$39.53	Replace	Replace	√	nec
	75607470 10	MOULDING SUB-ASSY, ROOF TOP	1.00	\$637.40	25.00	\$478.05	Replace	Replace	√	nec
	64995470 50	BOX, DECK FLOOR, RH	0.00	\$304.00	0.00	\$0.00	Replace	Check	X	svc
	64997470 60	BOX, DECK FLOOR, LH	0.00	\$303.40	0.00	\$0.00	Replace	Check	X	svc
	58415471 10C2	BOARD, REAR FLOOR, NO.1	0.00	\$502.20	0.00	\$0.00	Replace	Check	X	svc
		SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Check	X	svc
	58307470 90	END PANEL SUB-ASSY, BODY LOWER BACK	0.00	\$629.80	0.00	\$0.00	Replace	Check	X	svc
		STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	√	nec
		SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	√	nec
	82185471 50	WIRE, TAIL GATE BACK DOOR , NO.2	0.00	\$246.80	0.00	\$0.00	Replace	Not Given	X	svc
	82184474 90	WIRE, TAIL GATE BACK DOOR	0.00	\$246.80	0.00	\$0.00	Replace	Not Given	X	svc
	64721470 50C0	TAILGATE BOARD , COVER	0.00	\$24.10	0.00	\$0.00	Replace	Not Given	X	svc
	67750470 80C0	TAILGATE BOARD ASSY	0.00	\$251.50	0.00	\$0.00	Replace	Not Given	X	svc

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 22/06/2021

User ID : PohSuan

	67937470 60C0	TAILGATE TRIM , RH	0.00	\$92.10	0.00	\$0.00	Replace	Check	X svc
		SEALANT W/SCREEN	3.00	\$37.00	0.00	\$111.00	Replace	Replace	√ nec
	76801471 10A1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-	1.00	\$891.20	25.00	\$668.40	Replace	Replace	√ de
	56117501 40	TAIL GATE DAM, BACK DOOR GLASS UPPER	0.00	\$27.90	0.00	\$0.00	Replace	Not Given	X svc
	67881470 50	TAIL GATE WEATHERSTRIP, BACK DOOR	0.00	\$360.70	0.00	\$0.00	Replace	Not Given	X svc
	67005474 40	TAIL GATE PANEL SUB- ASSY, BACK DOOR	1.00	\$929.60	100.00	\$0.00	Replace	Repair	R
	66259470 10	COVER, REAR FLOOR UNDER CENTER	0.00	\$222.60	0.00	\$0.00	Replace	Check	X svc
	52023470 30	REAR BUMPER REINFORCEMENT	1.00	\$318.80	25.00	\$239.10	Replace	Replace	√ bt
	52159479 13	COVER, RR BUMPER ASSY	1.00	\$423.90	25.00	\$317.93	Replace	Replace	√ de
		PIXEL STICKER	2.00	\$60.00	0.00	\$120.00	Replace	Replace	√ nec
	52566479 00	FILLER, RR BUMPER , LH	0.00	\$119.90	0.00	\$0.00	Replace	Check	X svc
	52565479 00	FILLER, RR BUMPER , RH	0.00	\$119.90	0.00	\$0.00	Replace	Not Given	X svc
	52169470 20	COVER, GUARD RR BUMPER LOWER	0.00	\$14.80	0.00	\$0.00	Replace	Not Given	X svc
	52453470 10	GUARD, RR BUMPER, LOWER	1.00	\$558.30	25.00	\$418.73	Replace	Replace	√ de
	52161160 10	CLIPS PIECE, FRT & RR BUMPER	10.00	\$1.50	25.00	\$11.25	Replace	Replace	√ nec
	52191470 30	SEAL, RR BUMPER ARM, RH & LH	2.00	\$11.00	25.00	\$16.50	Replace	Replace	√ nec
	52461470 10	PAD, RR BUMPER, CTR	3.00	\$2.20	25.00	\$4.95	Replace	Replace	√ nec
	52462470 10	PAD, RR BUMPER, RH & LH , 3	2.00	\$3.80	25.00	\$5.70	Replace	Replace	√ nec
	52462470 20	PAD, RR BUMPER, RH & LH , 2	2.00	\$3.80	25.00	\$5.70	Replace	Replace	√ nec
	52462470 30	PAD, RR BUMPER, RH & LH , 1	2.00	\$3.80	25.00	\$5.70	Replace	Replace	√ nec
Total				\$16,464.00		\$3,169.09			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	
		64716471 30C0	END PANEL , COVER, DECK TRIM, REAR	1.00	\$122.80	25.00	\$92.10	Replace	Replace	√ de
		64730472 40C2	PANEL ASSY, DECK TRIM SIDE, RH	1.00	\$344.70	25.00	\$258.53	Replace	Replace	√ de
		64740471 90C2	PANEL ASSY, DECK TRIM SIDE, LH	1.00	\$344.70	25.00	\$258.53	Replace	Replace	√ de
		81006470 30	LAMP SET, STOP CENTER	1.00	\$186.50	10.00	\$167.85	Replace	Replace	√ cra
		68810470 61	TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2.00	\$59.10	25.00	\$88.65	Replace	Replace	√ bt
		64997470 60	BOX, DECK FLOOR, LH	1.00	\$303.40	25.00	\$227.55	Replace	Replace	√ cra
		58307470 90	END PANEL SUB-ASSY, BODY LOWER BACK	1.00	\$629.80	25.00	\$472.35	Replace	Replace	√ bt
			SEALANT W/SCREEN	2.00	\$37.00	0.00	\$74.00	Replace	Replace	√ nec
		56117501 40	TAIL GATE DAM, BACK DOOR GLASS UPPER	1.00	\$27.90	25.00	\$20.93	Replace	Replace	√ bt
		67005474 40	TAIL GATE PANEL SUB- ASSY, BACK DOOR	1.00	\$929.60	25.00	\$697.20	Replace	Replace	√ bt
Total					2,985.50		2,357.69			

5,526.78
 -20%
 4421.42 L/S \$6,550/-
 + 800.00
 + 1345.00
 6,566.42