

ASS. REC. BY:

REF:

C72/21006567/Ke

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

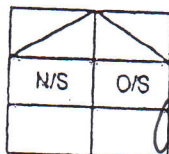

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

1 1/2 days

Res.: Yes or No

Lum Sum:

1.B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHD 5343L

Yr Regn:

01, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Pro

c.c

1798

Colour

M.P. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

170819

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDK B31U 203 078888

Gen. Cond:

Good / Fair / Poor / Burnt

Steering:

Inorder / Jammed / Leaked / Burnt or

Brake:

Inorder / Jammed / Leaked / Burnt or

Modl:

NII / S/Rim / STD / Rim or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Pailun

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

4/6/21

D.O.I.

8/6/2021

Survey held at

Des. of Damages:

Frt / Rear / O/S / N/S / UIC / Rooftop or

O/S Rear

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

11/6 854d Car

Date/Time, File Pass to?

☐

Prell. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format:

Lump Sum / I.B.I. (\$

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD5343L**AAD2106-022***Not Authorised
Recovery B4 paint*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

08 JUN 2021

SHD5343L

JTDKB3FU203078888

TOYOTA

PRIUS

04/06/2021

CHINA

11/01/2019

PART**LIST**

1	LENS AND BODY, REAR LAMP, RH	\$	Sn	502.00	} X
1	LENS & BODY, REAR COMBINATION LAMP, RH	\$	Sn	451.80	
1	FENDER SUB-ASSY, FRONT RH	\$	R	977.80	
1	PANEL SUB-ASSY, QUARTER, RH	\$	R	871.50	
1	LINER, REAR WHEEL HOUSE, RH	\$	Sn	139.80	
1	COVER, REAR BUMPER	\$	R	442.60	
1	FILLER, REAR BUMPER EXTENSION, RH	\$	Sn	123.70	
1	GUARD, REAR BUMPER, CENTER	\$	Sn	576.30	
1	REINFORCEMENT SUB-ASSY, REAR BUMPER	\$	R	332.70	
TOTAL		\$		4,418.20	
25%		\$		1,104.55	
		\$		3,313.65	

Special Nett

1	FENDER LINER CLIP	\$	nn	75.00	X
1	FENDER CLIP	\$	na	75.00	X
1	REAR BUMPER CLIP	\$	nn	65.00	X
1	END PANEL INNER TRIM CLIP	\$	nn	60.00	X
1	TYRE	\$	Sn	350.00	X
1	RIM	\$	Sn	1,879.40	X
1	HUM CAP	\$	Sn	211.50	X
TOTAL		\$		2,715.90	

TOTAL PARTS \$ 6,029.55**LABOUR**

To Rust-Proofing and apply undercoat Of The Affected Areas. \$ nn 250.00 X

Trans-cab Auto Services Pte Ltd

AAD2106-022

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD5343L

Putty And Spray Painting Of The Affected Portion.	\$	1,800.00	4401
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	~ 380.00	X
To Check Electrical Lighting Concerned.	\$	~ 170.00	X
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	1,800.00	1001
To check steering geometry and computer wheel alignment	\$	~ 220.00	X
To transfer of rear fender panel fittings, attachment and perform water seepage test.	\$	~ 170.00	X
TOTAL	\$	4,790.00	
Over All Total	\$	10,819.55	

(PART-BY-PART) Repair Days~~10 Days~~

1 1/2 day

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: