

CL APPRAISER PTE LTD

24 Peshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

INVOICE

Leong Chin Wan
C/o: Karz Works Pte Ltd
53 Ubi Ave 1 Paya Ubi Ind Park
#01-23 Singapore 408934

Invoice No: CL/191338
Ref No: KWS/10/1904/TP
Date: 5 November 2019

DESCRIPTION

AMOUNT

OUR SERVICE FEE CHARGES:

- SURVEY INSPECTION FOR VEHICLE NO. FBH 5371 E
- RESURVEY INSPECTION
- DIGITAL PHOTOGRAPHS SERVICES
(INCLUSIVE OF STORAGE AND SUBMISSION OF DIGITAL PHOTOGRAPHS)
- TRANSPORTATION

GRAND TOTAL S\$ 531.00

E & O. E

All cheque payment should be "Crossed" and made payable to "CL APPRAISER PTE LTD"

We shall be grateful if you could forward our payment at your early convenience.



CL Appraiser Pte Ltd

CL APPRAISER PTE LTD

24 Peshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

VEHICLE INSPECTION REPORT

To: Leong Chin Wan
C/o: Karz Works Pte Ltd
53 Ubi Ave 1 Paya Ubi Ind Park
#01-23 Singapore 408934

Date : 5 November 2019
Our ref : KWS/10/1904/TP

Accident Date : 18 October 2019
Inspection Date : 23 October 2019
Repairer Name : Karz Works Pte Ltd
53 Ubi Ave 1 Paya Ubi Ind Park
#01-23 Singapore 408934

Type of Survey : Third Party

PARTICULARS OF VEHICLE

Registration No : FBH 5371 E
Make / Model : Yamaha FZ16
Chassis No : ME145S0B5D2008836
Engine No : 45SB008646

Year / Capacity : 2013 / 153 cc
Colour : Black
Mileage : 49801

CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front	: Pirelli	100/80 - 17	5 mm	Sport
Rear	: Pirelli	140/70 - 17	5 mm	Sport

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the front and o/s portion.
(Details refer to the photographs attached)

Enclosed number of photographs: 91 copies

REMARKS

This inspection was conducted entirely on a "**WITHOUT PREJUDICE**" basis
and we have not given authorization and instruction to the repairer to proceed with the repair

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle
and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$ 4,200.00** on a contractual basis.

Under normal circumstances, the repair period would be about 7 (Seven) working days.

Vehicle Registration No: FBH 5371 E

Our Ref No: KWS/10/1904/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

SPARE PARTS - LIST ITEMS

1	Front fender	Damage	\$ 70.00	\$ 70.00 BR
2	Fork inner tubes	Damage	\$ 440.00	\$ 440.00 BT
1	Front sport rim	Damage	\$ 450.00	\$ 300 450.00 CUT
1	Front brake disc	Damage	\$ 155.00	\$ 155.00 XNN
1	Front rim shaft	Necessary ✓	\$ 45.00	\$ 45.00
1	Meter assy	Damage	\$ 420.00	\$ 420.00 X SVC
21	Side mirrors RH - CUT	Damage	\$ 120.00	\$ 120.00 60
1	Headlamp	Damage	\$ 380.00	\$ 315 380.00 CUT
1	Lampstay	Damage	\$ 80.00	\$ 80.00 X SVC
1	Handle-bar	Damage	\$ 135.00	\$ 135.00 BT
21	Handle-bar balancers RH - CUT	Damage	\$ 56.00	\$ 56.00 28
1	Hand-grip (1 set)	Damage	\$ 50.00	\$ 50.00 NEC
1	Clutch lever	Damage	\$ 22.00	\$ 22.00 XNN
1	Brake lever	Damage	\$ 22.00	\$ 22.00 BR
21	Front signals RH - BR	Damage	\$ 100.00	\$ 100.00 50
1	Fuel tank side cover	Damage ✓	\$ 215.00	\$ 215.00
1	Top fairing - black	Damage ✓	\$ 210.00	\$ 210.00
21	Side fairings - Red RH	Damage	\$ 330.00	\$ 330.00 165
1	O/s side lower fairing - Black	Damage ✓	\$ 155.00	\$ 155.00
1	O/s side board	Damage ✓	\$ 85.00	\$ 85.00
1	Main stand	Damage	\$ 105.00	\$ 105.00 XNN
1	Front o/s footrest	Damage	\$ 38.00	\$ 38.00 XNN
1	Front o/s footrest bracket	Damage	\$ 90.00	\$ 90.00 X SVC
1	Brake pedal	Damage	\$ 45.00	\$ 45.00 XNN
1	Rear o/s footrest	Damage	\$ 42.00	\$ 42.00 XNN
1	Rear o/s tailboard	Damage	\$ 125.00	\$ 125.00 X R
1	Exhaust assy	Damage	\$ 450.00	\$ 450.00 X SVC
1	Exhaust end cap	Damage	\$ 48.00	\$ 48.00 CUT
1	Exhaust protector	Damage	\$ 65.00	\$ 65.00 CUT
1	Battery cover	Damage	\$ 55.00	\$ 55.00 CUT
			\$ 4,603.00	\$ 4,603.00
Less 10%			\$ 460.30	\$ 460.30
Total Cost - List Items			\$ 4,142.70	\$ 4,142.70

SCL APPRAISER PTE LTD

Vehicle Registration No: FBH 5371 E

Our Ref No: KWS/10/1904/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
List Items Total c/f			\$ 4,142.70	\$ 4,142.70

SPECIAL NETT ITEMS

1	Number plate (1set) <i>ft</i>	Damage	\$ 28.00	\$ 28.00 <i>15</i>
2	Fork oils	Necessary	\$ 30.00	\$ 30.00 <i>20</i>
2	Fork oil seals	Necessary	\$ 56.00	\$ 56.00 <i>30</i>
1	Steering cone (1 set)	Necessary	\$ 95.00	\$ 95.00 <i>80</i>
1	Front tyre (Depraciation)	Damage	\$ 150.00	\$ 75.00 <i>X 42</i>
1	Rear box	Damage	\$ 250.00	\$ 250.00 <i>180</i>
1	Rear box bracket	Damage	\$ 100.00	\$ 100.00 <i>X 50</i>
Total Cost - Special Nett items			\$ 709.00	\$ 634.00

Total cost of parts

\$ 4,851.70 \$ 4,776.70

SCL APPRAISER PTE LTD

Vehicle Registration No: FBH 5371 E

Our Ref No: KWS/10/1904/TP

S/No	Description	Repairer's Estimate	Revised Amount
	Total cost of parts c/f	\$ 4,851.70	\$ 4,776.70

LABOUR

1	To provide towing service.	\$ 50.00	\$ 50.00 30
2	To check electrical system, wire harness and focus headlamp.	\$ 80.00	\$ 50.00 20
3	To provide labour charges, workmanship to dismantle above damaged parts ; re-align body structure and damaged consistent to the accident.	\$ 380.00	\$ 320.00 250

GRAND TOTAL

\$ 5,361.70	\$ 5,196.70
-------------	-------------

5 days

C L APPRAISER PTE LTD

Vehicle Registration No: FBH 5371 E

Our Ref No: KWS/10/1904/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : S 4,200.00**


By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deem to be vaild.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.

C L APPRAISER PTE LTD

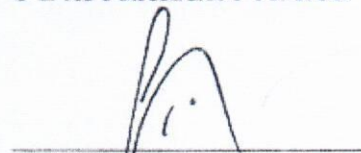

Cheong K H
Automotive Appraiser