



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2107819

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/11/2021
Reference CC6/CTI21006702/Urs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLQ 4970S
Insured Veh. XE 1762S
Claim No. SNM21D203386/LKKDS
Policy No. DMCVSNA00125972000
Accident Date 14/06/2021
Inspection Date 15/06/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21006702/Urs3q2	
			Date: 15/11/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 1762S		Veh. Inspected	SLQ 4970S
Policy No.	DMCVSNA00125972000		Coverage (\$)	0.00
Claim No.	SNM21D203386/LKKDS		Excess (\$)	0.00
Assign From			Assign Date	15/06/2021
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA C-HR (A)		c.c	1797
Engine No.	HIDDEN		Year of Reg.	2017
Chassis No.	ZYG102043008		Colour	GREY
Odometer	78801 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	GOOD			
3. Conditions of Tyres				
		Size	Make	Balance
R/H Front Tyre		215/60 R17	TRAVIA	7 mm
L/H Front Tyre		215/60 R17	TRAVIA	7 mm
R/H Rear Tyre		215/60 R17	TRAVIA	7 mm
L/H Rear Tyre		215/60 R17	TRAVIA	7 mm
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	14/06/2021		Inspection Date	15/06/2021
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLQ 4970S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	BENT / BUCKLED	1,488.20	1,248.80
1	BONNET LOCK	TWISTED	275.50	145.50
2	BONNET HINGES @\$145.00	NOT NECESSARY	290.00	-
1	BONNET INSULATOR	NOT NECESSARY	398.10	-
1	BONNET INSULATOR CLIPS	NOT NECESSARY	50.00	-
1	BONNET RUBBER BEADING	NECESSARY	66.20	66.20
1	BONNET STAND	NOT NECESSARY	109.10	-
1	FRONT BUMPER	DENTED	1,422.20	1,380.70
1	FRONT BUMPER LOWER	NOT NECESSARY	650.20	-
2	FRONT BUMPER SIDE RETAINERS @\$68.00	BENT	136.00	136.00
1	FRONT BUMPER LICENCE PLATE GARNISH	DEFORMED	142.50	85.50
1	FRONT BUMPER TOW COVER	NOT NECESSARY	48.00	-
2	FRONT BUMPER SIDE AIR SROOPS @\$105.00	NOT NECESSARY	210.00	-
1	FRONT BUMPER CENTRE GRILLE	TORN	166.20	166.20
1	FRONT BUMPER TOP BEAM	BENT	388.90	299.20
1	FRONT BUMPER REINFORCEMENT	BENT	855.20	476.30
2	FRONT BUMPER REINFORCEMENT BRACKETS @\$250.00	NOT NECESSARY	500.00	-
1	FRONT BUMPER SPONGE	TORN	108.20	108.20
1	FRONT BUMPER LOWER BEAM	NOT NECESSARY	520.20	-
2	FRONT BUMPER LOWER BEAM BRACKETS @\$190.00	NOT NECESSARY	380.00	-
1	FRONT BUMPER LOWER SPONGE	NOT NECESSARY	108.00	-
1	FRONT BUMPER UNDER COVER	NOT NECESSARY	288.20	-
2	FRONT BUMPER FOG LAMPS @\$495.00	NOT NECESSARY	990.00	-
2	FRONT BUMPER FOG LAMP COVERS @\$105.00	NOT NECESSARY	210.00	-
1	FRONT GRILLE OUTER	CRACKED	645.20	434.20
1	FRONT GRILLE BASE	CRACKED	520.20	485.20
1	FRONT GRILLE LOGO	SCRATCHED	450.00	450.00
1	FRONT GRILLE RADAR SENSOR	SHORTED / DAMAGED	1,885.20	1,295.00
1	FRONT GRILLE TOP RUBBER	NECESSARY	82.80	68.00
2	HEADLAMPS @\$1880.10	CRACKED	3,760.20	2,761.00

Report Ref No. CC6/CTI21006702/Urs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	HEADLAMP TOP PANELS @\$255.00	TO REPAIR SEE LABOUR	510.00	-
1	FRONT SUPPORT PANEL	BENT / TWISTED	662.20	662.20
1	FRONT SUPPORT PANEL TOP GARNISH	DISTORTED	455.90	210.30
2	FRONT SUPPORT SIDE PANELS @\$250.00	TO REPAIR SEE LABOUR	500.00	-
1	AIR CON CONDENSER	BENT / PUNCTURE	1,688.90	1,613.00
2	AIR CON CONDENSER SIDE GARNISHS @\$288.00	NOT NECESSARY	576.00	-
1	AIR CON FAN ASSY	NOT NECESSARY	665.20	-
1	AIR CON SUCTION HOSE	NOT NECESSARY	382.90	-
1	AIR CON DISCHARGE HOSE	NOT NECESSARY	388.90	-
1	RADIATOR	BENT /PUNCTURE	1,885.20	1,841.00
1	RADIATOR FAN ASSY	NOT NECESSARY	1,052.10	-
1	RADIATOR RESERVOIR TANK	NOT NECESSARY	281.60	-
1	RADIATOR TOP HOSE	NOT NECESSARY	100.80	-
1	FRONT WASHER TANK	NOT NECESSARY	363.50	-
1	FRONT WASHER TANK MOTOR	NOT NECESSARY	255.10	-
2	FRONT FENDERS @\$991.00	TO REPAIR SEE LABOUR	1,982.00	-
2	FRONT FENDER INNER SHIELDS @\$288.20	NOT NECESSARY	576.40	-
2	FRONT FENDER OUTER PROTECTORS @\$341.10	DEFORMED / TORN	682.20	482.00
2	FRONT FENDER 'HYBRIDS' EMBLEM @\$105.10	NECESSARY	210.20	210.20
1	AIR RESONATOR	NOT NECESSARY	185.60	-
1	AIR RESONATOR	NOT NECESSARY	1,200.50	-
1	FRONT BRACE PANEL	BENT	165.50	115.00
1	WIPER GARNISH	NOT NECESSARY	488.20	-
	LESS 25% DISCOUNT		-	-3,684.93
			32,403.40	11,054.77
	<u>SPECIAL NETT ITEMS</u>			
1	SET BONNET INSULATOR CLIPS (SN)	NECESSARY	50.00	50.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	FRONT BUMPER LICENCE PLATE (SN)	BENT	50.00	40.00
1	SET FRONT SUPPORT PANEL TOP GARNISH CLIPS (SN)	NECESSARY	50.00	40.00

Report Ref No. CC6/CTI21006702/Urs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOL RADIATOR COOLANT (SN)	NECESSARY	50.00	30.00
			250.00	210.00
	LABOUR			
	TO CHECK WIRING .		50.00	30.00
	TO SPRAY RUST PROOFING.		100.00	60.00
	TO REFILL AIR CON GAS .		120.00	100.00
	TO RESET & REPROGRAMME RADAR SYSTEM.		380.00	120.00
	TO MOUNT VEHICLE ON CAR O-LINER .	NOT NECESSARY	380.00	-
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF HEADLAMP TOP PANELS ,FRONT SUPPORT SIDE PANELS AND FRONT FENDERS.		1,080.00	800.00
	TO PUTTY & SPRAY PAINTING.		1,800.00	900.00
			3,910.00	2,010.00
GRAND TOTAL			36,563.40	13,274.77
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				10,500.00

Report Ref No. CC6/CTI21006702/Urs3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLQ 4970S

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLQ 4970S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

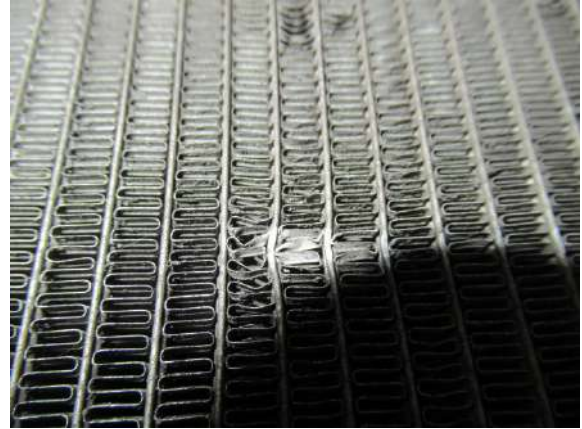



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

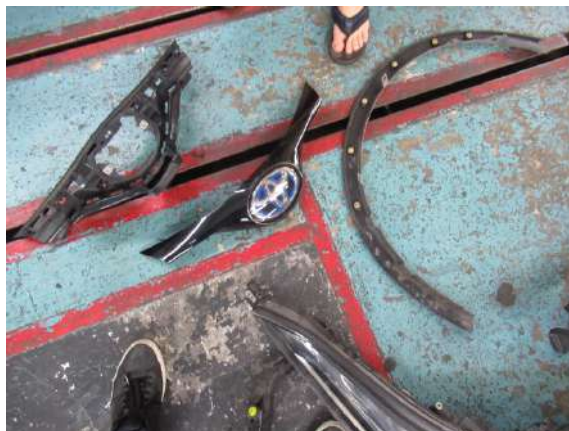



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

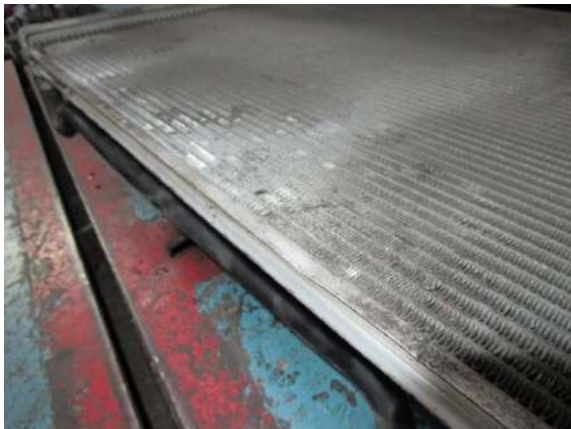



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLQ 4970S

RE-INSPECTION

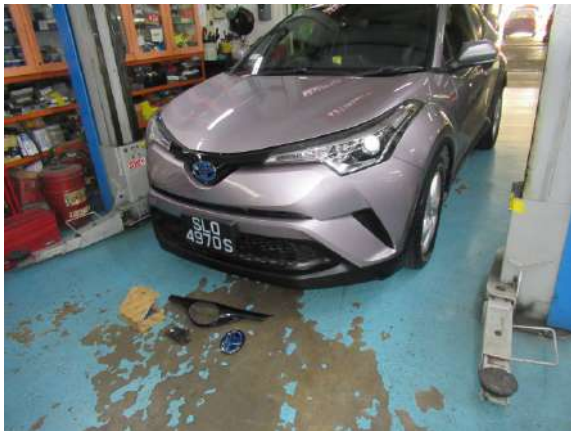



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

