

A.S.S. REC. BY:

Taufikh

REF:

CS/CT121066779/Tiqc

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

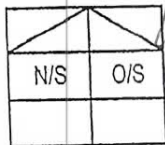
Claims No. **SNM21D202560/C02**

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: **6** days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

May

Veh No: **SMF7197J** Yr Regn: **2018 / Nov**Type: **M/Car** / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: **BMW 216i** c.c. **1499**Colour: **Black** A/C: Insured / Std / NI / NASp. Reading: **18832** T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: **WBA 6V12060E1705438**Gen. Cond: **Good** / Fair / Poor / BurntSteering: **Inorder** / Jammed / Leaked / Burnt orBrake: **Inorder** / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: **205/55R17**R: **4**

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. **6** mm R/Bal. **6** mmL/Bal. **6** mm L/Bal. **6** mmD.O.A. _____ D.O.I. **18/6/21 07pm**Survey held at **Yau Tee Auto**Des. of Damages: Frt / Rear / **O/S** / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

24/06/21@5.29pm revised to Adeline Chng via Merimen.

08/10/21@4.29pm Taufikh finalised with May LS \$5800, 6 days. (Red \$10078.55, 63%)

Date/Time, File Pass to?



: Preli. Report

1) 20/10 Typist



: Final Report

Date/Time, File Return to?

2)

Rep. Formel:

MER-TP

Lump Sum / LS

5800

Days Of Repair: **6**Resurvey No. of Trip: **1**

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Invs (\$



: Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

Yew Tee Automobile Tech Pte Ltd (Co.Reg.No.200311009C)

Synergy@kb 25 Kaki Bukit Road 4 #01-60/61

Singapore 417800

Tel: 67023113 Fax: 67023773 Email: YTKB

INSURER : CHINA TAIPING INSURANCE (SINGAPORE) PTE LTD**PARTICULARS OF CLAIM**

Claim Type:	TP	Ref. No:	YTKB/TP/2105/007
Policy No:	SD21V06406/VPC/R00	Date of Loss:	3/5/2021
Vehicle Reg. No.:	SMF7197J	Driveable?	no
Driver Age:		Third Party Vehicle No.:	SMC4487H
Any Injuries?	no	Contact No:	
Insured/Claimant:	PADMANABHAN RANGAPPA	Driver:	SIDHARTH DOKANIA

Make/Model:	BMW, 216I GRAN TOURER	Vehicle Reg. Date:	22 Nov 2018
Vehicle Colour:	BLACK	Engine Number:	36875367B38A15A
Chassis No:	WBA6V12060ED05438	Odometer:	
Total Loss?		Est. Duration of Repair(Day)	10

Description of Accident/loss CHANGE LANE
 Remarks:
 Present Location: Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)-YTKB

COST OF CLAIMS

	Amount
Parts	11,303.55
Miscellaneous Items	1,620.00
Labour	1,830.00
Paintwork Labour	1,125.00
Towing	0.00
Gross Total(\$):	15,878.55
GST 7.00%(\$):	1,111.50
Nett Amount(\$):	16,990.05

This claim is handled by: may chai

REPAIR DETAILS**Estimates On Parts**

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	FRONT RH DOOR	1,725.00	-10.00	1,552.50 <i>bt -</i>
2	1	FRONT RH DOOR OUTER HANDLE	142.50	-10.00	128.25 <i>Rp</i>
3	1	FRONT RH DOOR GLASS OUTER MOULDING	165.00	-10.00	148.50 <i>X</i>
4	1	FRONT RH DOOR GLASS REGULATOR	330.00	-10.00	297.00 <i>?</i>
5	1	FRONT RH SIDE MIRROR	642.00	-10.00	577.80 <i>cut -</i>
6	1	FRONT RH DOOR HINGE TOP	90.00	-10.00	81.00 <i>X?</i>
7	1	FRONT RH DOOR HINGE BOTTOM	69.00	-10.00	62.10 <i>X?</i>
8	1	FRONT RH DOOR INNER BOARD	0.00	-10.00	0.00 <i>X</i>
9	1	FRONT RH DOOR TOP CHROME	105.00	-10.00	94.50 <i>?</i>
10	1	REAR RH DOOR	1,725.00	-10.00	1,552.50 <i>bt -</i>
11	1	REAR RH DOOR HINGE TOP	90.00	-10.00	81.00 <i>X?</i>
12	1	REAR RH DOOR HINGE BOTTOM	90.00	-10.00	81.00 <i>X?</i>
13	1	REAR RH DOOR GLASS OUTER MOULDING	165.00	-10.00	148.50 <i>X</i>
14	1	REAR RH DOOR TOP CHROME	105.00	-10.00	94.50 <i>?</i>
15	1	REAR RH DOOR GLASS REGULATOR	480.00	-10.00	432.00 <i>?</i>
16	1	REAR RH DOOR INNER BOARD	0.00	-10.00	0.00 <i>X</i>
17	2	REAR RH DOOR GLASS	660.00	-10.00	594.00 <i>X</i>
18	1	REAR RH DOOR GLASS REGULATOR	480.00	-10.00	432.00 <i>?</i>
19	1	REAR RH DOOR GLASS REGULATOR MOTOR	210.00	-10.00	189.00 <i>X</i>
20	1	RH SIDE SKIRT	345.00	-10.00	310.50 <i>Rp</i>
21	1	FRONT RH FENDER	570.00	-10.00	513.00 <i>Rp</i>
22	1	FRONT RH FENDER EMBLEM	75.00	-10.00	67.50 <i>rp</i>
23	1	REAR RH FENDER	2,250.00	-10.00	2,025.00 <i>Rp</i>
24	1	REAR BUMPER	1,125.00	-10.00	1,012.50 <i>Rp</i>
25	1	REAR BUMPER RH SIDE RETAINER	78.00	-10.00	70.20 <i>X</i>
26	1	REAR BUMPER RH REFLECTOR	48.00	-10.00	43.20 <i>X</i>
27	1	REAR RH TAILLAMP	390.00	-10.00	351.00 <i>X</i>
28	1	FRONT RH DOOR RUBBER	202.50	-10.00	182.25 <i>? new - plus to -</i>
29	1	REAR RH DOOR RUBBER	202.50	-10.00	182.25 <i>? new -</i>
Total Parts (\$\$)					11,303.55

Estimates of Miscellaneous Items

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	FRONT RH DOOR STICKER	60.00	0.00	60.00 <i>na -</i>
2	1	REAR RH DOOR STICKER	60.00	0.00	60.00 <i>na -</i>
3	1	FRONT RH WHEEL RIM	350.00	0.00	350.00 <i>cut -</i>
4	1	REAR RH WHEEL RIM	350.00	0.00	350.00 <i>cut -</i>
5	1	FRONT RH TYRE	250.00	0.00	250.00 <i>X</i>
6	1	REAR RH TYRE	250.00	0.00	250.00 <i>X</i>
7	1	REAR BUMPER SENSOR	300.00	0.00	300.00
Sub Total (\$\$)					1,620.00

Estimates On Labour

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	To Reset Power Window.	120.00	0.00	120.00 <i>80</i>
2	1	To Remove and Refit Rear Bumper Sensor.	80.00	0.00	80.00 <i>30</i>

Estimates On Labour

No.	Qty	Particulars	Amount	%Disc	After Disc
3	1	To Computer Reset and Re-program all fault code.	350.00	0.00	350.00 <i>200</i>
4	1	To Transfer Door.	80.00	0.00	80.00 ✓
5	1	To Disconnect and Reconnect, Check Electrical wiring Harness Wire, Sockets, Replace Damaged Parts.	250.00	0.00	250.00
6	1	To Remove and Replace the above Damaged Parts, Straighten, Knock out, Realign and Repair including Cut and Weld body panels. To Re-adjust to the Original position using power tools.	950.00	0.00	950.00 <i>800</i>

Gross Labour Cost (S\$) 1,830.00

Estimates On Paint Work Labour

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	To Carry-Out Body Cavity Preservation.	80.00	0.00	80.00 <i>30</i>
2	1	To Supply Spray Terostat Sealant On The Cutting Areas.	45.00	0.00	45.00 <i>x</i>
3	1	To Spray painting on the Replaced and Repair Parts, Prepare Spray Such as Masking Tape the unaffected areas with paper, Cleaning and Sanding of Surfaces, Final Polishing and Waxing are also available.	1,000.00	0.00	1,000.00 ✓

Gross Labour Cost (S\$) 1,125.00

< END OF ESTIMATES >

Tanpin 97475749/67563561
 ~ WP 18/6/21 @ 2pm
 L/S Resurvey after repair
 6 days
 Tanpin @ lkhauto.com

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

673C

Vehicle Details

Vehicle No.:

SMF7197J

Vehicle to be Exported:

No

Intended Deregistration Date:

19 May 2021

Vehicle Make:

B.M.W.

Vehicle Model:

216I GRAN TOURER

Primary Colour:

Black

Manufacturing Year:

2018

Engine No.:

36875367B38A15A

Chassis No.:

WBA6V12060ED05438

Maximum Power Output:

80.0 kW (107 bhp)

Open Market Value:

\$30,824.00

Original Registration Date:

22 Nov 2018

First Registration Date:

22 Nov 2018

Transfer Count:

1

Actual ARF Paid:

\$35,154.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

21 Nov 2028

PARF Rebate Amount:

\$26,365.00

Intended COE Rebate Details

COE Expiry Date:

21 Nov 2028

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$28,457.00

COE Rebate Amount:

\$21,358.00

Total Rebate Amount:

\$47,723.00

The information contained herein is correct as at 19 May 2021

OK

1.2