



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV No. AC2106851

INV Date 04/10/2021

Reference CC4/FCI21006801/R1ra3q2

Code FCI2

#### PROFESSIONAL SERVICE FEE

Vehicle No. PC 89P  
Insured Veh. YP 559A  
Claim No. D21001807MFCV  
Policy No. D-21097582MFCV  
Accident Date 14/06/2021  
Inspection Date 17/06/2021

Description	Total
Survey Inspection	2,544.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Less: Discount	-1,964.00
<b>Subtotal</b>	<b>580.00</b>
<b>GST (7%)</b>	<b>40.60</b>
<b>Grand Total</b>	<b>620.60</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI21006801/R1ra3q2 Date: 04/10/2021 Code: FCI2	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>			
<b>Insured Veh.</b>	YP 559A	<b>Veh. Inspected</b>	PC 89P
<b>Policy No.</b>	D-21097582MFCV	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	D21001807MFCV	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	RACHEL WU	<b>Assign Date</b>	16/06/2021
<b>2. Vehicle Particulars &amp; Condition</b>			
<b>Make &amp; Model</b>	YUTONG ZK6930H AUTO	<b>c.c</b>	6690
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2015
<b>Chassis No.</b>	LZYTCTD63F1021842	<b>Colour</b>	MULTI COLOUR
<b>Odometer</b>	299539 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	NIL
<b>General</b>	FAIR		
<b>3. Conditions of Tyres</b>			
	<b>Size</b>	<b>Make</b>	<b>Balance</b>
<b>R/H Front Tyre</b>	275/70 R22.5	KAPSEN	8 mm
<b>L/H Front Tyre</b>	275/70 R22.5	KAPSEN	8 mm
<b>R/H Rear Tyre</b>	275/70 R22.5 (D)	KAPSEN	8/8 mm
<b>L/H Rear Tyre</b>	275/70 R22.5 (D)	KAPSEN	8/8 mm
<b>4. Description of Damages</b>			
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.		
<b>5. General Information</b>			
<b>Accident Date</b>	14/06/2021	<b>Inspection Date</b>	17/06/2021
<b>Survey held at</b>	60 Jalan Lam Huat, Carros Centre #02-32 S737869		
<b>Repairer</b>	THINK ONE AUTOCARE PTE LTD		
<b>5a. Remarks</b>			
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.		
<b>5b. Estimate Days of Repair</b>			
	ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>20 Working Days</b>



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. PC 89P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
2	ROOF TOP MIRROR C/W ARM ASSY LH+RH @\$1420.00	O/S CRACKED / N/S TO REPAIR SEE LABOUR	2,840.00	1,420.00
1	FRONT WINDSCREEN GLASS	BROKEN	4,855.00	4,000.00
2	FRONT WINDSCREEN INNER GARNISH R+L @\$398.00	NOT NECESSARY	596.00	-
1	SIDE PANEL RH	TO REPAIR SEE LABOUR	4,302.00	-
2	DOOR PILLAR LH +RH @\$788.00	TO REPAIR SEE LABOUR	1,576.00	-
1	FRONT PANEL	BENT	4,885.00	3,200.00
1	FRONT PANEL REINFORCEMENT	BENT	2,850.00	2,000.00
1	FLOOR PANEL REINFORCEMENT	NOT NECESSARY	1,200.00	-
1	FLOOR PANEL	NOT NECESSARY	1,500.00	-
1	FRONT CHASSIS CROSS MEMBER	NOT NECESSARY	2,995.00	-
1	DASHBOARD ASSY	NOT NECESSARY	3,600.00	-
1	DASHBOARD REINFORCEMENT	NOT NECESSARY	655.00	-
1	STEEDO METER ASSY	NOT NECESSARY	2,850.00	-
1	FRONT PANEL KEY CYLINDER	NOT NECESSARY	185.00	-
1	FRONT PANEL GRILLE	CRACKED	621.00	621.00
1	PANEL GRILLE LOGO	NECESSARY	215.00	180.00
1	WIPER MOTOR	NOT NECESSARY	1,152.00	-
1	WIPER LINKAGE	NOT NECESSARY	856.00	-
2	WIPER ARM @\$365.00	CUT	730.00	325.00
2	WIPER ARM COVER @\$65.00	O/S CRACKED / N/S NOT NECESSARY	130.00	65.00
2	WIPER BLADE @\$198.00	NECESSARY	396.00	250.00
2	FRONT HEADLAMP HID R+L @\$3250.00	O/S SCRATCHED / N/S NOT NECESSARY	6,500.00	1,620.00
2	FRONT HEADLAMP PANEL R+L @\$285.00	NOT NECESSARY	570.00	-
1	TOW HOOK	NOT NECESSARY	425.00	-
1	FRONT BUMPER	DEFORMED	3,202.00	1,680.00
2	FRONT BUMPER FOG LAMP R+L @\$425.00	NOT NECESSARY	850.00	-

Report Ref No. CC4/FCI21006801/R1ra3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER NUMBER PLATE BASE	BENT	220.00	50.00
1	FRONT BUMPER REINFORCEMENT	BENT	952.00	850.00
1	FRONT WIRE HARNESS TO FUSE BOX	CUT	1,552.00	1,100.00
1	FRONT AUTO DOOR LH	TO REPAIR SEE LABOUR	4,720.00	-
4	FRONT AUTO DOOR LOCK CATCH @\$80.00	NOT NECESSARY	320.00	-
1	FRONT AUTO DOOR LOWER ARM	BROKEN	799.00	799.00
1	FRONT AUTO DOOR MOTOR	NOT NECESSARY	1,855.00	-
1	FOOT STEP BOARD LH	TO REPAIR SEE LABOUR	350.00	-
1	REAR WINDSCREEN GLASS PANEL	DEFORMED	2,422.00	2,000.00
1	TAIL GATE	BENT	4,850.00	3,800.00
2	TAIL GATE DAMPER R+L @\$190.00	NOT NECESSARY	380.00	-
2	TAIL GATE HINGE R+L @\$85.00	NOT NECESSARY	170.00	-
2	TAIL GATE RUBBER STOPPER @\$15.00	NECESSARY	30.00	30.00
2	TAIL GATE LOCK KEY CYLINDER @\$115.00	NOT NECESSARY	230.00	-
1	TAIL GATE (ZK6930H) EMBLEM	NECESSARY	253.00	180.00
1	TAIL GATE (YUTONG) EMBLEM	NECESSARY	255.00	180.00
1	TAIL GATE PULL HANDLE	NOT NECESSARY	45.00	-
1	SIDE ENGINE COMPARTMENT REAR DOOR RH	TO REPAIR SEE LABOUR	1,445.00	-
2	SIDE ENGINE COMPARTMENT REAR DOOR LOCK @\$65.00	NOT NECESSARY	130.00	-
2	TAIL LAMP R+L @\$825.00	N/S NOT NECESSARY / O/S CRACKED	1,650.00	600.00
1	REAR CORNER PANEL RH	BUCKLED	4,832.00	2,200.00
1	REAR CORNER PANEL LAMP RH	NOT NECESSARY	115.00	-
1	REAR CORNER PANEL INNER SUPPORT BRACKET	NOT NECESSARY	350.00	-
1	REAR REFLECTOR	CRACKED	450.00	155.00
1	REAR BUMPER	DEFORMED	2,566.00	1,800.00
1	NUMBER PLATE LED LAMP	CRACKED	185.00	64.00
1	REAR BUMPER REINFORCEMENT	BENT	890.00	780.00
1	REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	85.00	-
1	REAR CHASSIS CROSS MEMBER	BENT	980.00	980.00

Report Ref No. CC4/FCI21006801/R1ra3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FULE FILTER FEED PUMP ASSY	BENT	650.00	69.00
1	ENGINE CRANKSHAFT PULLEY	CRACKED	1,855.00	950.00
1	ENGINE CRANKSHAFT PULLEY OIL SEAL	NOT NECESSARY	85.00	-
1	ENGINE FAN BELT	NOT NECESSARY	188.00	-
1	RADIATOR ASSY	BENT	2,995.00	2,500.00
1	RADIATOR FAN BLADE	NOT NECESSARY	455.00	-
1	FAN BLADE ROTOR ASSY	NOT NECESSARY	652.00	-
2	RADIATOR FAN BELT @\$45.00	CUT (1 PCS ONLY)	90.00	45.00
1	RADIATOR FAN BELT TENSIONER ASSY	NOT NECESSARY	355.00	-
1	RADIATOR FAN BELT TENSIONER BRACKET	NOT NECESSARY	452.00	-
1	ENGINE FAN BELT TENSIONER BEARING	NOT NECESSARY	482.00	-
2	AIR CON COMPRESSOR BELT @\$45.00	CUT	90.00	90.00
1	ENGINE ASSY	NOT NECESSARY	38,000.00	-
	LESS 10% DISCOUNT		-12,996.60	-3,458.30
			116,969.40	31,124.70
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRONT WINDSCREEN GLASS SEALANT /SEAL (SN)	NECESSARY	530.00	350.00
1	REAR WINDSCREEN GLASS SEALANT /SEAL (SN)	NECESSARY	450.00	280.00
4	PANEL JOINT SEAL @\$120.00 (SN)	NECESSARY	480.00	350.00
2	NUMBER PLATE FRONT & REAR (SN)	CRACKED	100.00	70.00
1	FRONT PANEL STICKER (ORIGINAL) (SN)	NECESSARY	550.00	300.00
1	REAR PANEL STICKER (ORIGINAL) (SN)	NECESSARY	550.00	300.00
1	TAIL GATE 60KM/H STICKER (SN)	NECESSARY	15.00	10.00
1	ERP BRACKET (SN)	NECESSARY	25.00	25.00
4	REVERSE SENSOR @\$100.00 (SN)	NOT NECESSARY	400.00	-
1	REAR WINDSCREEN GLASS PANEL LOGO (SN)	NECESSARY	220.00	80.00
			3,320.00	1,765.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	TP REMOVE DAMAGED FRONT /REAR BODY PARTS WITH ALL NECESSARY COMPONENTS /ATTACHMENTS APPLY HOT-WORKS WHERE NECESSARY REPAIR ,RESHAPE BODY DENTED PANELS IN ACCORDANCE WITH FACTORY SPECIFICATIONS REPLACE NEW PARTS REFIT AND ALIGN INTO POSITION REFIT ALL NECESSARY COMPONENTS/ATTACHMENTS.}		18,000.00	3,900.00
	INCLUSIVE OF THE REPAIR OF ROOF TOP MIRROR C/W ARM ASSY LH,SIDE PANEL RH,DOOR PILLAR LH +RH,FRONT AUTO DOOR LH,FOOT STEP BOARD LH AND SIDE ENGINE COMPARTMENT REAR DOOR RH .}		-	-
	TO SPRAY AINT REPLACED/ REPAIRED BODY PARTS INCLUSIVE OF PREPARATORY WORKS AND PAINTING MATERIALS.		5,000.00	2,800.00
	TO REMOVE ,REFIX DASHBOARD PANEL,COMPARTMENT SIDE BOARD ,UPHOLSTERY,INNER GARNISHES WITH ALL NECESSARY COMPONENTS/ATTACHMENTS.		500.00	300.00
	TO REMOVE,REFIX FRONT WINDSCREEN GLASS AND WATER TEST .		1,500.00	300.00
	TO REMOVE,REFIX REAR WINDSCREEN GLASS AND WATER TEST.		1,000.00	300.00
	TO REMOVE,REFIX REAR SIDE PANEL GLASS .		500.00	250.00
	TO REMOVE,REPLACE RADIATOR ,FAN BLADE ROTOR WITH ALL NECESSARY COMPANENTS.		280.00	100.00
	TO REMOVE,REPLACE ENGINE CRANKSHAFT PULLEY WITH ALL NECESSARY COMPONENTS /ATTACHMENTS.		250.00	100.00
	TO CHECK RESET ENGINE DIAGNOSIS SYSTEM CODE.	NOT NECESSARY	200.00	-
	TO CONDUCT FRONT HEADLAMP ALIGNMENT.		50.00	30.00
	TO INSTALL REVERSE SENSOR WITH ALL NECESSARY COMPONENTS.	NOT NECESSARY	100.00	-
	TOWING FRONT ACCIDENT SCENE TO CARROS CENTRE .		250.00	150.00
	TO REMOVE,REPLACE NEW ENGINE WITH ALL NECESSARY COMPONENTS /ATTACHMENTS.	NOT NECESSARY	1,200.00	-
			28,830.00	8,230.00
	<b>GRAND TOTAL</b>		<b>149,119.40</b>	<b>41,119.70</b>



<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>31,300.00</b>
---	--	--	------------------

Report Ref No. CC4/FCI21006801/R1ra3q2

**MOHAMMED RASUL BIN MOHD YUNUS**

**Automotive Assessor**

**HO LEONG CHUAN**

**Automotive Assessor**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. PC 89P

## INSPECTION






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

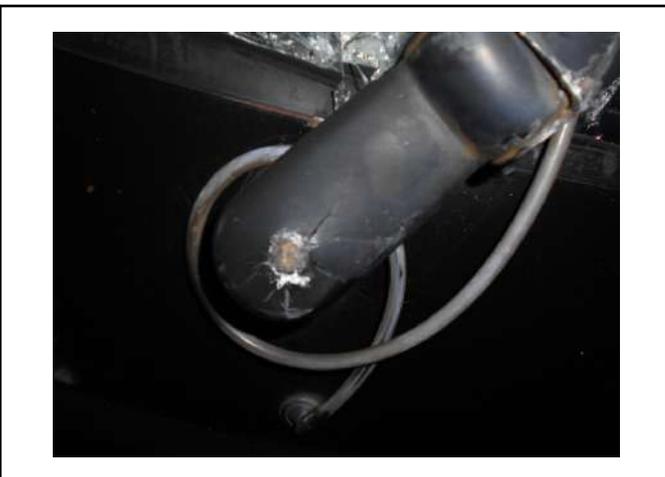



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

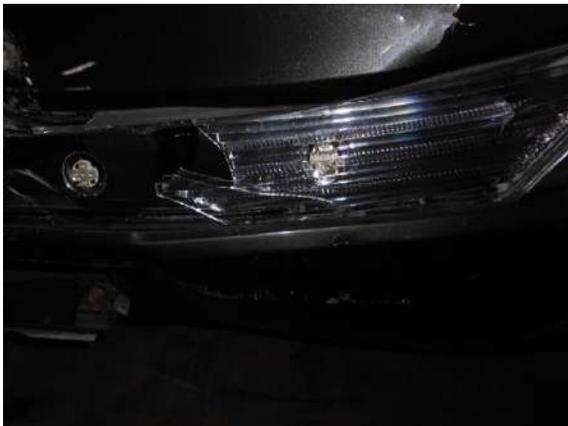



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

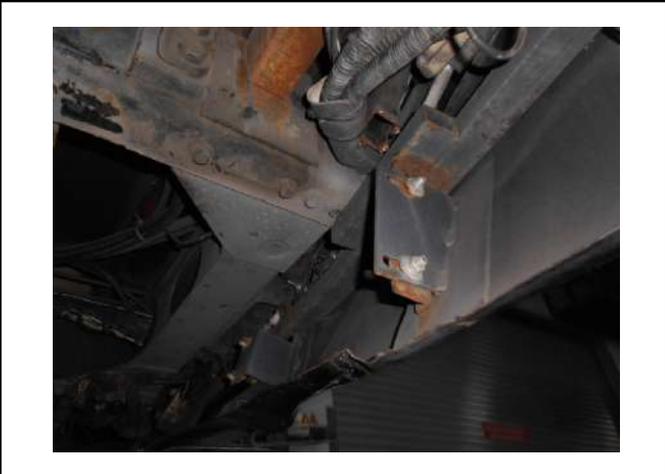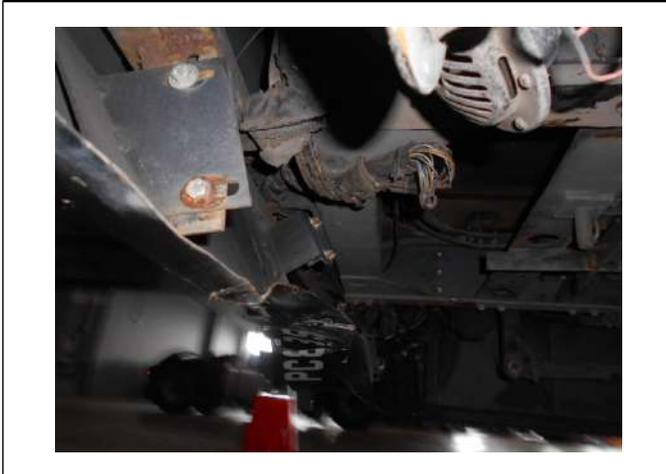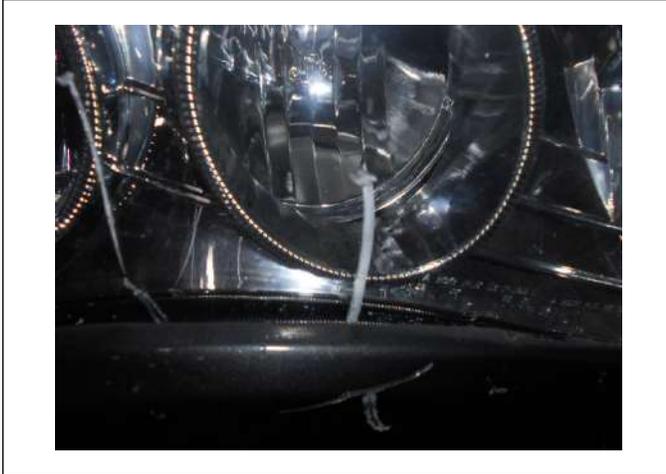



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

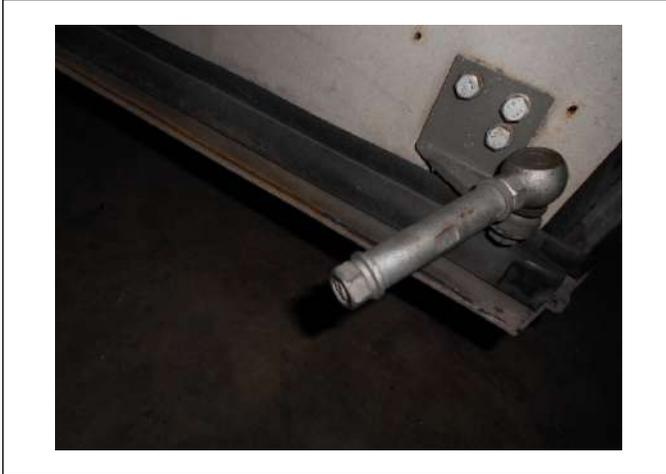



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

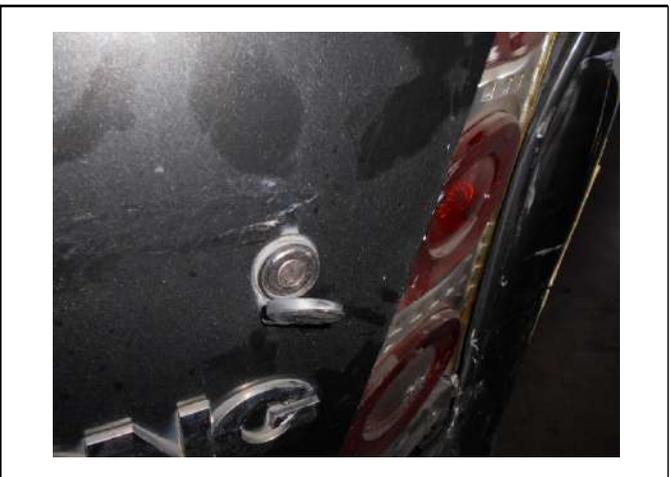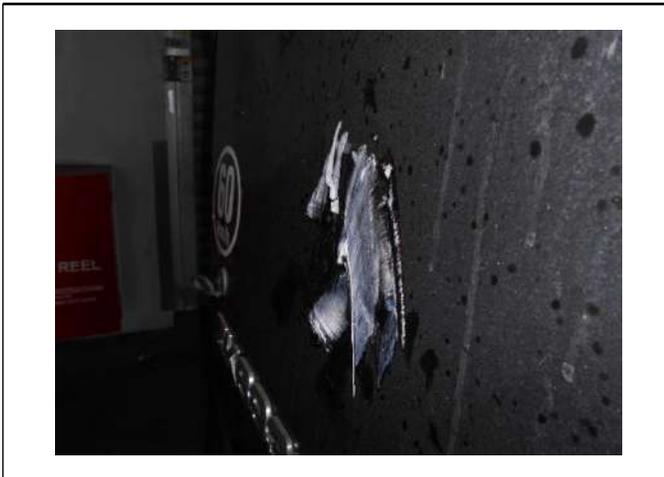




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

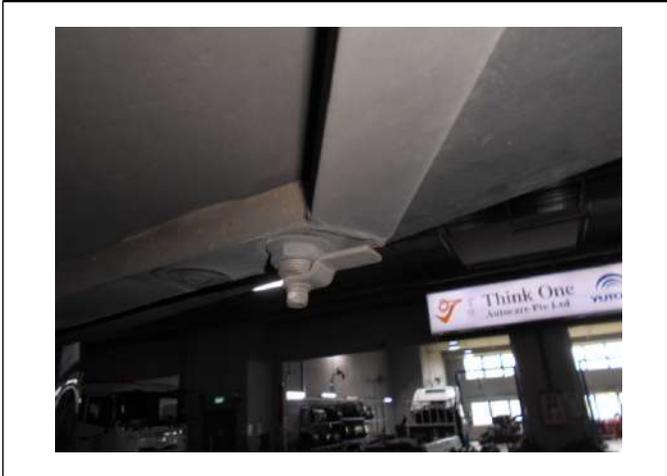





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

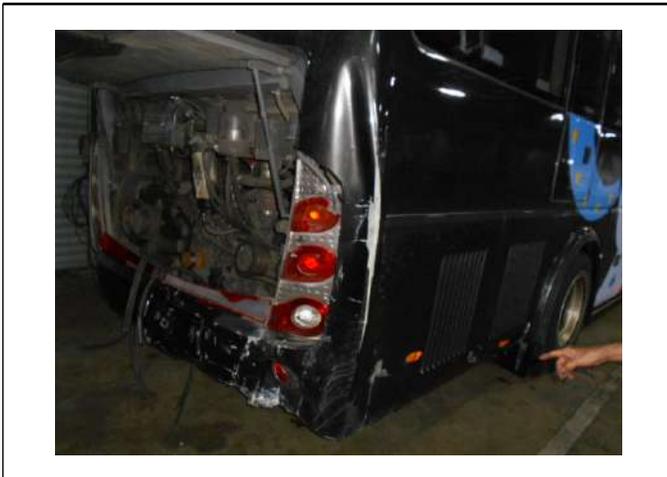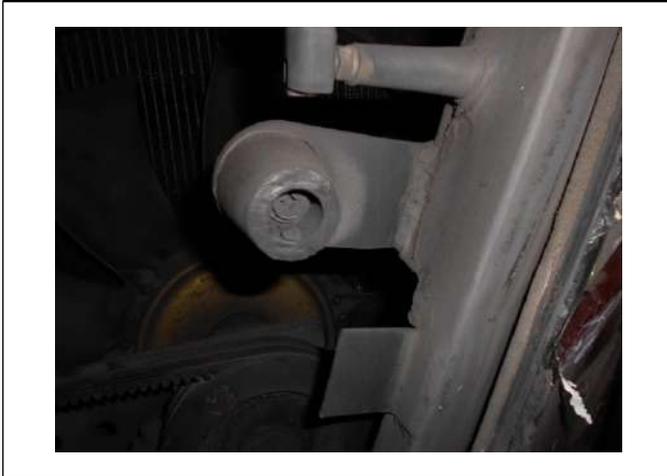



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

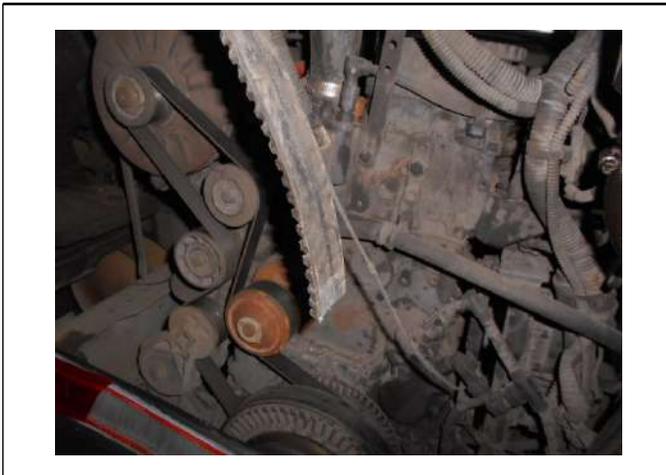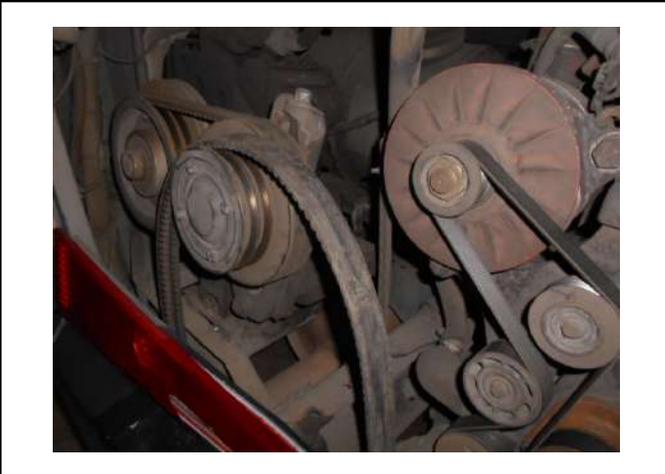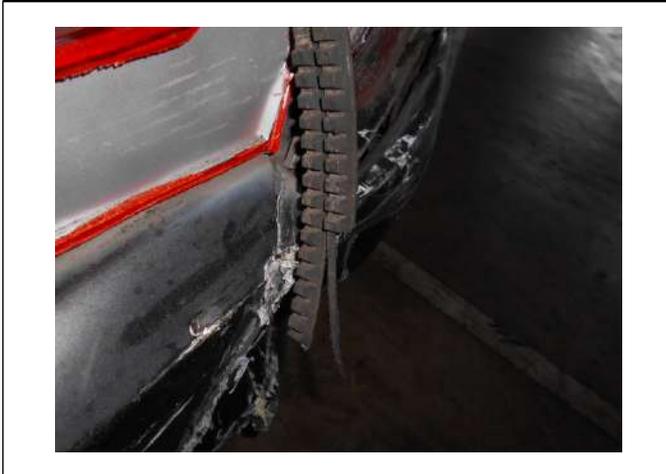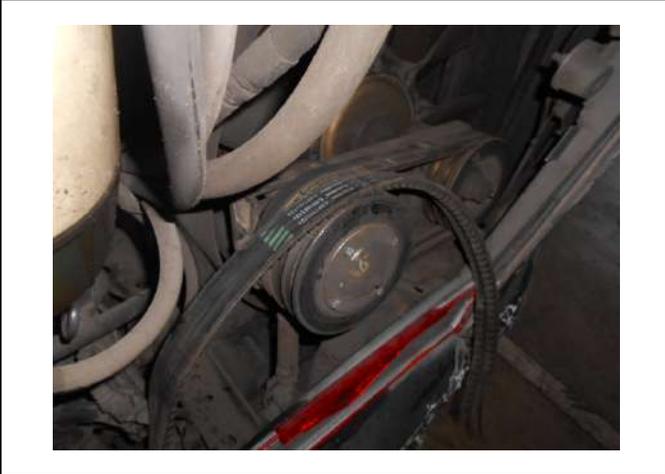





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

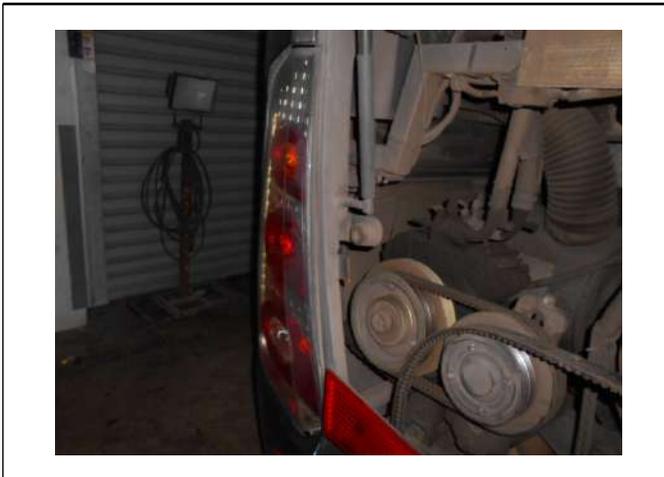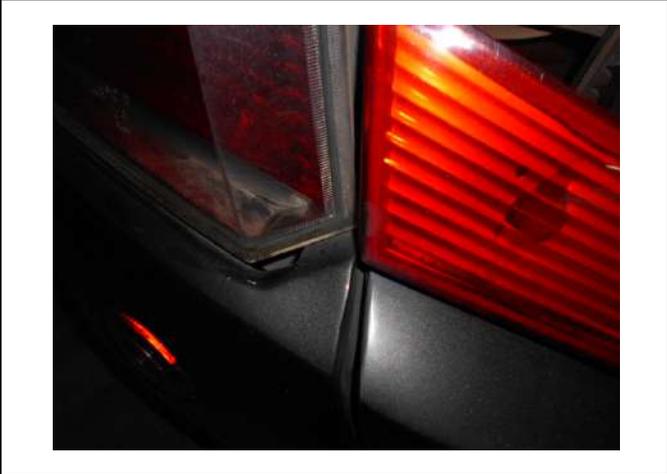




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

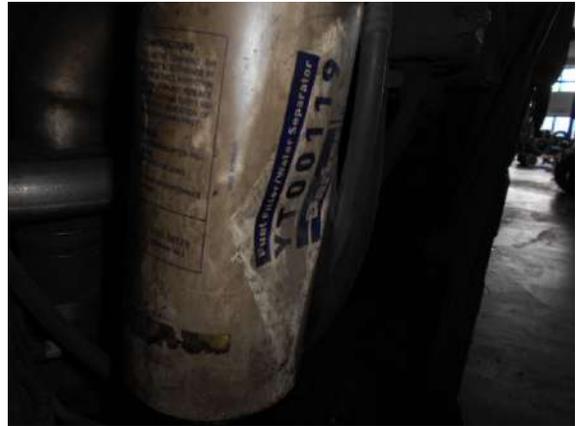



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. PC 89P

## RE-INSPECTION

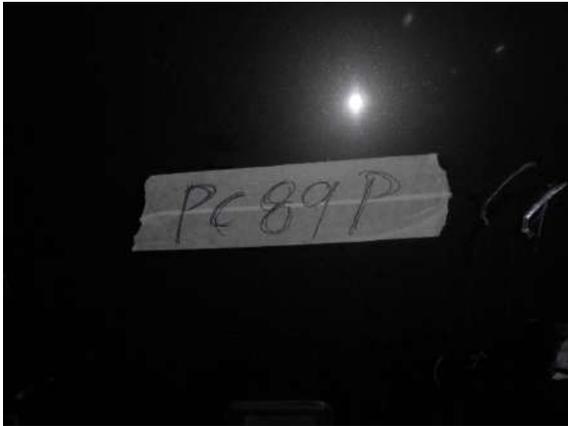



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

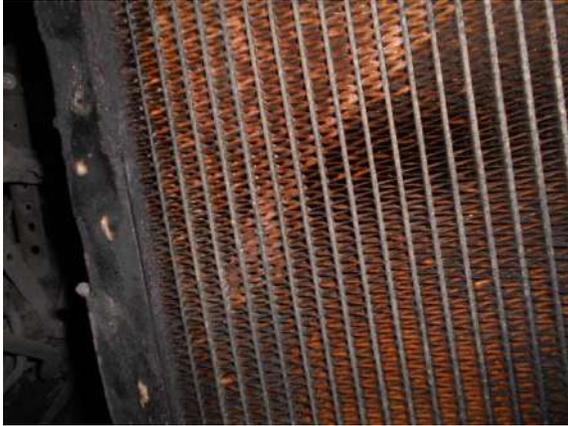




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

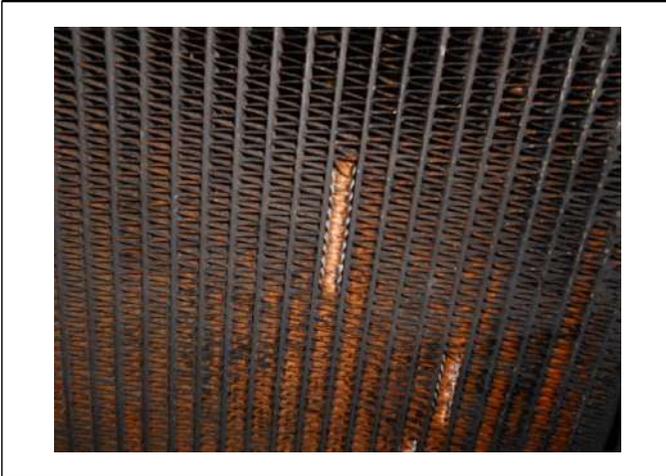



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

