



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2106461

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/09/2021
Reference CC6/CTI21006850/Urs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJY 1797C
Insured Veh. SLD 4070H
Claim No. SNM21D203467C02
Policy No.
Accident Date 18/06/2021
Inspection Date 21/06/2021

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21006850/Urs3q2	
			Date: 15/09/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLD 4070H	Veh. Inspected	SJY 1797C	
Policy No.		Coverage (\$)	0.00	
Claim No.	SNM21D203467C02	Excess (\$)	0.00	
Assign From		Assign Date	21/06/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA COROLLA ALTIS (A)	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2010	
Chassis No.	MR053ZEE106175298	Colour	GREY	
Odometer	138626 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	GENCOTIRE	6 mm	
L/H Front Tyre	195/65 R15	GENCOTIRE	6 mm	
R/H Rear Tyre	195/65 R15	GENCOTIRE	6 mm	
L/H Rear Tyre	195/65 R15	GENCOTIRE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR PORTION.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	18/06/2021	Inspection Date	21/06/2021	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJY 1797C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR DOOR N/S	BADLY DENTED	1,248.20	1,075.10
1	REAR DOOR OUTER PROTECTOR N/S	BENT	266.50	166.20
1	REAR DOOR OUTER PROTECTOR CHROME N/S	NECESSARY	105.30	102.50
1	REAR DOOR GLASS OUTER MOULDING N/S	NECESSARY	148.20	128.50
1	REAR DOOR GLASS REGULATOR MOTOR N/S	SHORTED / JAMMED	650.50	650.50
1	REAR DOOR INNER RUBBER N/S	NECESSARY	211.20	185.40
1	REAR DOOR INNER LOCK N/S	NOT NECESSARY	455.90	-
1	REAR DOOR INNER TRIM BOARD N/S	DEFORMED / CRACKED	861.10	645.10
1	SET REAR DOOR INNER TRIM BOARD CLIPS N/S	NECESSARY	50.00	50.00
1	SET REAR DOOR FRAME BLACK STICKER N/S	NECESSARY	85.00	85.00
1	ROCKER PANEL N/S	DENTED / BENT	745.50	695.10
1	ROCKER PANEL GARNISH N/S	TORN	755.20	688.20
1	REAR FENDER N/S	BENT / BUCKLED	1,429.20	1,219.10
1	REAR FENDER UNDER SHIELD N/S	NOT NECESSARY	288.90	-
1	REAR QUARTER PANEL N/S	NO SUCH PARTS	50.00	-
1	REAR WINDSCREEN MOULDING	NECESSARY	122.10	122.10
1	REAR BUMPER	DEEP CUT	566.20	466.20
1	REAR BUMPER SIDE RETAINER N/S	NECESSARY	66.50	66.50
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR ABSORBER N/S	BENT / TWISTED	322.20	292.50
1	REAR WHEEL HUB BEARING N/S	DAMAGED	655.80	485.50
1	REAR AXLE BEAM	NOT NECESSARY	1,781.10	-
1	REAR TYRE N/S	SERVICEABLE	200.00	-
	LESS 25% DISCOUNT		-	-1,793.38
			11,114.60	5,380.12
	<u>SPECIAL NETT ITEMS</u>			
1	REAR SPORT RIM N/S (SN)	CUT / BENT	850.00	400.00
			850.00	400.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO CHECK WIRING .		50.00	20.00
	TO DISMANTLE & REFIX REAR REVERSE SENSOR .		80.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN .		120.00	120.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY .		120.00	80.00
	TO DISMANTLE & REPLACED REAR UNDER CARRIAGE.		380.00	120.00
	TO CONDUCT WHEEL ALIGNMENT .		120.00	80.00
	TO SPRAY RUST PROOFING .		100.00	80.00
	TO TRANSFER REAR DOOR MECHANISM .		100.00	60.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.		1,500.00	1,000.00
	TO PUTTY & SPRAY PAINTING .		1,800.00	900.00
			4,370.00	2,510.00
	GRAND TOTAL		16,334.60	8,290.12
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITON)			6,600.00

Report Ref No. CC6/CTI21006850/Urs3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJY 1797C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

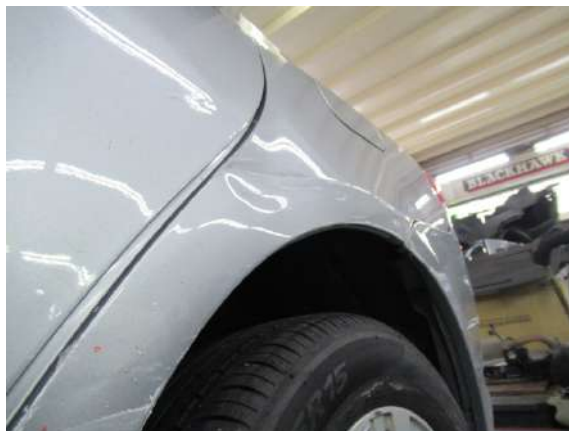



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJY 1797C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJY 1797C

RE-INSPECTION

