

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/TP/0522/2021/TF
DATE : 24-Jun-21
WIP : 32223

Cecilie.

\$27,138.04.

VEHICLE NOT IN WORKSHOP. KINDLY ARRANGE SURVEY ON 25/6/2021
YOUR INSURED VEH NO : SLN 574 U

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR. LOH HAK GUAN MARK
ADDRESS : 162 LENTOR LOOP
#02-02
SINGAPORE 789095
TELEPHONE : HP +65 97955548
TYPE OF CLAIM : THIRD PARTY CLAIM
POLICY NO : 10662775
VEHICLE NO : SCX 73 C
MODEL CODE : TT COUPE 2.0 TFSI
MODEL YEAR : 27/4/2016
ENGINE NO : CHH 090766
CHASSIS NO : TRUZZZFV9F1015951
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 18-Jun-21
PLACE OF ACCIDENT : BAYFRONT AVE

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SCX 73 C

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE AND REINSTALL REAR PARKING LID. CHECK FUNCTION.	S/N S	280.00	X.
2	TO RENEW LHS 1/4 GLASS TO FACILITATE FENDER RENEWAL.	S/N S	300.00	✓
3	TO INSTALL SOLAR FILM FOR 1/4 GLASS	S/N S	400.00	✓
4	TO CARRY OUT WATER SEEPAGE TEST ON 1/4 GLASS	S/N S	200.00 150.	
5	TO REMOVE AND REINSTALL REAR WIRE HARNESS FOR LIGHT, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT.	S/N S	1,400.00	✓
6	TO REMOVE AND TRANSFER LHS DOOR'S MULTI LOCK SYSTEM AND POWER WINDOW DEVICES. CHECK FUNCTION	S/N S	350.00 280.	
SUB TOTAL LABOUR CHARGES		:	\$ 2,930.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SCX 73 C

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO REMOVE AND REINSTALL REAR SEATS, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENTS TRIM AND SEAT BELTS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIR BAG ETC.	S/N \$ 1,400.00 ✓	
8	TO SET UP AND PALCE VEHICLE IN ALUMINIUM REPAIR FACILITY.	S/N \$ 1,800.00 ✓	
9	TO DISMANTLE AND REINSTALL REAR BUMPER. TO RENEW LHS DOOR AND LHS SILL PANEL TRIM. TO CUT OUT AN WELD LHS REAR FENDER. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	\$ 5400 6,300.00	Fender 3.5 Do
10	TO RESPRAY LHS REAR FENDER, LHS DOOR, LHS SILL PANEL TRIM, LHS SILL PANEL, DRAIN CHANNEL, ROOF CHANNEL, DOOR ENTRANCE AND REAR END PANELLING.	\$ 3125. 5,500.00	Fender : 3.5 Door : 1 Side Trin : 1 Handle 100
11	TO CARRY OUT ALUMINIUM PRIMER WORKS ON AFFECTED PANELS.	S/N \$ 900.00 ✓	3125
12	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 192.00 ✓	
TOTAL LABOUR CHARGES		: \$ 19,022.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SCX 73 C

		DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	REAR SECTIONAL PART - LH <i>Pistonhd</i>	1	\$ 6,536.00 ✓	\$5,228.80
2	REAR SIDE WINDOW - LH <i>nu</i>	1	\$ 472.00 ✓	\$377.60
3	PRIMER <i>Not Nee</i>	1	\$ 20.00 ✗	
4	REAR SILL TRIM STRIP - LH OUTER <i>nu</i>	1	\$ 255.00 ✓	\$203.60
5	REAR WHEEL SPOILER - LH <i>nu</i>	1	\$ 35.00 ✗	
6	MEMBER TRIM - LH <i>Defind</i>	1	\$ 699.00 ✓	\$551.20
7	MEMBER TRIM ATTACHEMENT PART <i>nu</i>	1	\$ 281.00 ✓	\$224.80
8	REAR MEMBER TRIM ADHESIVE TAPE <i>nu</i>	1	TBC <i>44</i> ✓	\$44.00
9	REAR DOOR - LH <i>Dented</i>	1	\$ 4,085.00 ✓	\$3,268.00
10	REAR DOOR SEAL - LH <i>nu</i>	1	\$ 205.00 ✓	\$164.00
11	BONDING AGENT <i>3 Not Nee</i>	1	\$ 49.00 ✗	
12	CLEANING SOLUTION <i>Not Nee</i>	1	\$ 68.00 ✗	
13	APPLICATOR <i>Not Nee</i>	1	\$ 8.00 ✗	
14	REAR DOOR ATTACHMENT <i>Not Nee</i>	1	\$ 105.00 ✗	
15	REAR DOOR CATCH - LH <i>Not Nee</i>	1	\$ 105.00 ✗	
16	INNER DOOR SEAL <i>Not Nee</i>	1	\$ 528.00 ✗	
17	REAR DOOR HANDLE - LH <i>Ryir</i>	1	\$ 374.00 ✗	
18	REAR DOOR HANDLE COVER CAP - LH <i>Ryir</i>	1	\$ 52.00 ✗	
19	REAR DOOR SLID VALVE - LH <i>3 Not Nee</i>	1	\$ 22.00 ✗	
20	REAR DOOR HANDLE SENSOR - LH <i>3 Not Nee</i>	1	\$ 228.00 ✗	

SUB TOTAL SPARE PARTS

: **\$ 14,127.00**

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SCX 73 C

		DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	REAR DOOR HANDLE MOUNTING BAR - LH <i>nee</i>	1	\$ 162.00	✓
22	REAR DOOR LATCH CABLE - LH <i>. nee</i>	1	\$ 52.00	✓
23	AIRBAG STICKER <i>} nee</i>	1	\$ 24.00	✓ \$19.04
24	WARNING STICKER	1	\$ 29.00	✓ \$22.48
25	ALUMINIUM POWER <i>} nee</i>	1	\$ 573.00	✓ \$458.40
26	HARDENER	1	\$ 210.00	✓ \$168.00
27	ALUMINIUM PRIMER <i>} nee</i>	1	\$ 212.00	✗
28	REAR EPOXY ADHESIVE <i>} nee</i>	1	\$ 113.00	✗
30	STATIC MIXER <i>} nee</i>	1	\$ 8.00	✗
31	CLEANER BLOCK	1	\$ 77.00	✗
32	REAR WHEEL LINER - LH	1	\$ 240.00	✗
33	A/SELANT <i>} nee</i>	1	\$ 180.00	✓
34	C WAX	1	\$ 140.00	✓
35	STONE CHIP	1	\$ 180.00	✓
36	1/4 GLASS SEALANT <i>nee</i>	1	\$ 100.00	✓
37	SUNDRIES <i>nee</i>	S/N	\$ 500.00	✓ 101.76
TOTAL SPARE PARTS		:	\$ 16,927.00	
TOTAL LABOUR CHARGES		:	\$ 19,022.00	
GRAND TOTAL		:	\$ 35,949.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME : *Adrian King*
SURVEYED DATE : *29/06/21*
AUTHORISED DATE :
EXCESS COST :
LIABILITY :
REMARKS : *not authorised, 13 Days* *15 Days* *AS*

PLEASE NOTE : THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORA KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

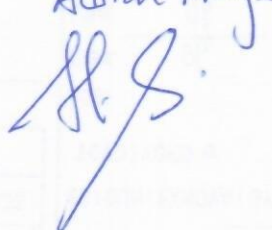


Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/TP/0522/2021/TF 27-Jul-21 CHANG 1 of 1 SCX 73 C AUDI TT COUPE 2 0 TFSI
Quantity	Description	Unit Price	Amount
Parts			
1	COUNTERSUNK RIVET	\$ 105.00	\$ 84.00 ✓
2	POP RIVET	\$ 30.00	\$ 24.00 ✓
3	2-PACK EPOXY ADHESIVE	\$ 226.00	\$ 180.80 ✓
4	STATIC MIXER	\$ 30.00	\$ 23.36 ✓
5	TAIL LIGHT TRIM - LH/RH	\$ 60.00	\$ 47.20 ✓
GRAND TOTAL		\$ 451.00	\$ 359.36

For Premium Automobiles Pte Ltd

Adrian Ling


Authorised Signature