



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2104955

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 14/07/2021
Reference CC4/FCI21006998/Ura3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SDK 7939R
Insured Veh. YN 5740U
Claim No. D21001876MFCV/1
Policy No. D-20096479MFCV
Accident Date 21/06/2021
Inspection Date 24/06/2021

Description	Total
Survey Inspection	294.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	294.00
GST (7%)	20.58
Grand Total	314.58

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI21006998/Ura3q2 Date: 14/07/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 5740U	Veh. Inspected	SDK 7939R	
Policy No.	D-20096479MFCV	Coverage (\$)	0.00	
Claim No.	D21001876MFCV/1	Excess (\$)	0.00	
Assign From	ESTHER	Assign Date	23/06/2021	
2. Vehicle Particulars & Condition				
Make & Model	VOLKSWAGEN POLO (A)	c.c	1197	
Engine No.	HIDDEN	Year of Reg.	2011	
Chassis No.	WWVZZZ6RZBU044147	Colour	BLUE	
Odometer	73769 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/45 R16	FALKEN	6 mm	
L/H Front Tyre	205/45 R16	FALKEN	6 mm	
R/H Rear Tyre	205/45 R16	FALKEN	6 mm	
L/H Rear Tyre	205/45 R16	FALKEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	21/06/2021	Inspection Date	24/06/2021	
Survey held at	ZOOM AUTOWERKS PTE LTD 832 SIMS AVENUE #12-884 EUNOSVILLE SINGAPORE 400832			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SDK 7939R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT FENDER LH	NOT NECESSARY	768.32	-
1	FRONT FENDER INNER SHIELD LH	NOT NECESSARY	213.30	-
1	FRONT FENDER INNER SHIELD EXPANDING RIVETS	NOT NECESSARY	19.80	-
1	WING MIRROR ASSY LH	NOT NECESSARY	785.42	-
1	FRONT DOOR LH	BADLY DENTED	1,045.62	1,045.62
1	FRONT DOOR OUTER MOULDING LH	NOT NECESSARY	195.40	-
1	FRONT DOOR TOP HINGE LH	NOT NECESSARY	155.60	-
1	FRONT DOOR LOWER HINGE LH	NOT NECESSARY	152.43	-
1	FRONT DOOR WEATHERSTRIP LH	NOT NECESSARY	287.65	-
1	FRONT DOOR FRAME STICKER LH	NECESSARY	187.95	187.95
1	REAR DOOR LH	TO REPAIR SEE LABOUR	955.23	-
1	REAR DOOR OUTER MOULDING LH	NOT NECESSARY	154.86	-
1	REAR DOOR TOP HINGE LH	NOT NECESSARY	145.82	-
1	REAR DOOR LOWER HINGE LH	NOT NECESSARY	148.75	-
1	REAR DOOR WEATHERSTRIP LH	NOT NECESSARY	255.45	-
1	REAR DOOR FRAME STICKER LH	NOT NECESSARY	195.62	-
1	SIDE SKIRT LH	NOT NECESSARY	864.52	-
1	SET SIDE SKIRT CLIPS	NOT NECESSARY	66.00	-
	LESS 5% DISCOUNT		-329.89	-61.68
			6,267.85	1,171.89
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT DOOR INNER TRIMBOARD CLIPS (SN)	NOT NECESSARY	80.00	-
1	REAR DOOR INNER TRIMBOARD CLIPS (SN)	NOT NECESSARY	80.00	-
			160.00	-
	<u>LABOUR</u>			
	TO REMOVE ,REPAIR & RENEW REAR AFFECTED ACCIDENT AREAS.INCLUSIVE OF THE REPAIR OF REAR DOOR LH .		1,000.00	250.00
	TO PUTTY ,SPRAY PAINT ON AFFECTED ACCIDENT AREAS.		1,000.00	400.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK & RE-CONNECT ALL ELECTRICAL WIRING .	NOT NECESSARY	50.00	-
	TO REMOVE & INSTALL FRONT DOOR COMPONENTS ,TRIM & GARNISH .		150.00	60.00
	TO REMOVE & INSTALL REAR DOOR COMPONENTS ,TRIM & GARNISH .	NOT NECESSARY	150.00	-
	TO DIAGNOSTIC & RESET TO SPECIFICATION.	NOT NECESSARY	450.00	-
	TO CONDUCT WATER LEAKAGE TEST .	NOT NECESSARY	150.00	-
	TO RUST PROOF AFFECTED AREAS.		200.00	30.00
			3,150.00	740.00
GRAND TOTAL			9,577.85	1,911.89

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,500.00
---	--	--	--	-----------------

Report Ref No. CC4/FCI21006998/Ura3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDK 7939R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

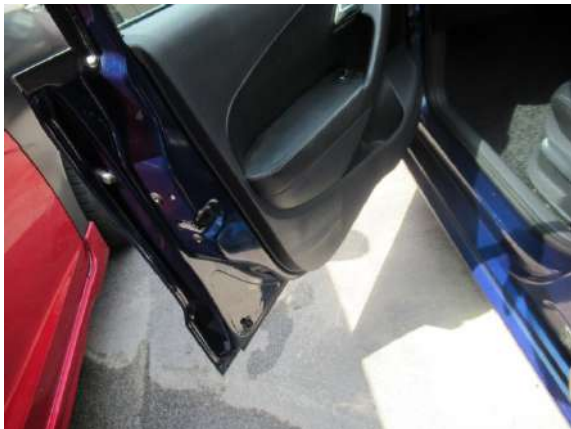



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDK 7939R

RE-INSPECTION

